



Photo 3. Ice in right fuel manifold valve
(Photo Courtesy of Continental Motors)