

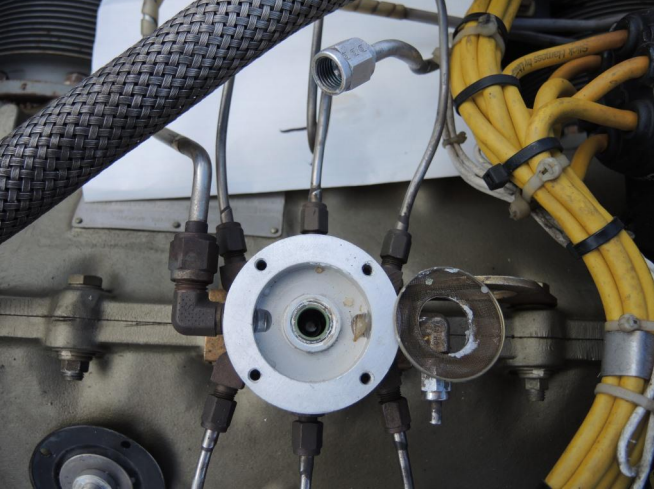


Photo 4. Ice in left fuel manifold valve (Photo courtesy of Continental Motors)