



Photo 2 – View of tail rotor blade damage