

MYERS AVIATION, INC. – OSHKOSH, WI
AIRFRAME LOG ENTRY – N3979X

April 1, 2015 Tach 5450.4

Removed all control surfaces for repair, refer to FAA form 337 this date for details. Removed wing tips, cowl and all plastic tips. Made minor repairs to wheel fairings, as required. Entire aircraft stripped of all paint, prepped, primed with epoxy primer and new polyurethane top coat applied. Red - Imron (custom mix), Las Vegas Gold- Imron (5242EA), Insignia White – Alumigrip (G8022-01). Installed new tips on horizontal stab. and front of vertical stab.(dorsal). Leak checked wing tip tanks and reinstalled. Reinstalled all control surfaces. Installed new bulb in left nav light, replaced ELT antenna and cabin door latch handle with serviceable parts. Installed new BA-3 Brackett induction air filter. Control surface balance maintained in accordance with Piper Service Manual.

Regarding the above listed work performed, this aircraft is safe for return to service.

Steve J. Myers AP [REDACTED]
Myers Aviation, Inc.

NOTICE

Weight and balance or operating limitation changes shall be entered in the appropriate aircraft record. An alteration must be compatible with all previous alterations to assure continued conformity with the applicable airworthiness requirements.

8. Description of Work Accomplished

(If more space is required, attach additional sheets. Identify with aircraft nationality and registration mark and date work completed.)

USA N3979X

4-1-15

Nationality and Registration Mark

Date

1. Made repairs to aircraft by replacing the following parts:

- a. left aileron skin, part no. 68106-000
- b. right aileron skin, part no. 68106-001
- c. left and right upper outbd flap skin, part no. 65589-800
- d. right upper inbd flap skin, part no. 65587-800
- e. left upper inbd flap skin, part no. 65594-801
- f. rudder skin, part no. 63396-802
- g. left upper outbd horizontal stab skin, part no. 68430-800
- h. right upper outbd horizontal stab skin, part no. 68430-801
- i. left inbd upper horizontal stab skin, part no. 63392-800
- j. right inbd upper horizontal stab skin, part no. 63392-801
- k. left upper outbd aft horizontal stab skin, part no. 68431-800
- l. right upper outbd aft horizontal stab skin, part no. 68431-801
- m. left upper aft wing skin, part no. 35603-20
- n. right upper aft wing skin, part no. 35603-20

2. Parts replaced in accordance with Piper Parts and Services Manuals and AC43.13-1b, chapter 4, section 4.

3. Complete aircraft stripped and painted with epoxy primer and polyurethane top coat.

4. Control surface balance maintained in accordance with Piper Service Manual.

5. No weight and balance change.

6. No equipment list revision.

END

☐ Additional Sheets Are Attached