

Westport Aviation Services



RE: Investigation CEN16LA217

Removed all spark plugs. (checked good)

Checked for compression. (checked good)

Removed fuel lines one at a time from fuel pump. (small trace amount found in one line)

Removed fuel line from flow divider. (no fuel found)

Checked mag timing. (Checked good)

Tested electric fuel pump. (no fuel pumped from main fuel line)

Found fuel drain open from impact on belly fuel strainer (closed drain valve)

Tested electric fuel pump again. (pumped fuel from main fuel line)

Fuel pumped from right main tank.

