

SERVICE BULLETIN

REPLACEMENT OF FUEL PUMP FOR ROTAX® ENGINE TYPE 912 (SERIES) SB-912-053UL

MANDATORY

Repeating symbols:

Please, pay attention to the following symbols throughout this document emphasizing particular information.

▲ **WARNING:** Identifies an instruction, which if not followed, may cause serious injury or even death.

■ **CAUTION:** Denotes an instruction which if not followed, may severely damage the engine or could lead to suspension of warranty.

◆ **NOTE:** Information useful for better handling.

1) Planning information

1.1) Engines affected

All versions of the engine type:

- 912 UL from S/N 4,407.646 to S/N 4,408.361
- 912 ULS from S/N 5,646.084 to S/N 5,648.164
- 912 ULSFR from S/N 4,430.267 to S/N 4,430.500 and from S/N 6,374.028 bis S/N 6,374.054

all parts

- Fuel pump part no. 892230, 892232, 892540 (standard version) and part no. 892235, 892236, 892545 (version including flexible fuel line), which was supplied as a spare part.
- Also affected are all engines and gearboxes in which the above mentioned fuel pumps were installed at engine repair/general overhaul as a spare part during the supply period starting January, 2006.

◆ **NOTE:** All engines and gearboxes that were already retrofitted with a new fuel pump part no. 892542 or 892546 are not affected.

For complete instructions and compliance to this Service Bulletin refer to Service Bulletin-SB-912-053, latest edition section 1.2 onward.

◆ **NOTE:** Section 1.6) Approval: Is not required for engines of the type UL (Series).
Section 3) Accomplishment: In addition: persons with adequate type-specific training.

SERVICE BULLETIN

REPLACEMENT OF FUEL PUMP

FOR ROTAX® ENGINE TYPE 912 (SERIES) SB-912-053

MANDATORY

Repeating symbols:

Please, pay attention to the following symbols throughout this document emphasizing particular information.

▲ **WARNING:** Identifies an instruction, which if not followed, may cause serious injury or even death.

■ **CAUTION:** Denotes an instruction which if not followed, may severely damage the engine or could lead to suspension of warranty.

◆ **NOTE:** Information useful for better handling.

1) Planning information

1.1) Engines affected

All versions of the engine type:

- 912 A from S/N 4,410.684 to S/N 4,410.727
- 912 F from S/N 4,412.913 to S/N 4,412.925
- 912 S from S/N 4,923.282 to S/N 4,923.461

all parts

- Fuel pump part no. 892230, 892232, 892540 (standard version) and part no. 892235, 892236, 892545 (version including flexible fuel line), which was supplied as a spare part.
- Also affected are all engines and gearboxes in which the above mentioned fuel pumps were installed at engine repair/general overhaul as a spare part during the supply period starting January, 2006.
- ◆ **NOTE:** All engines and gearboxes that were already retrofitted with a new fuel pump part no. 892542 or 892546 are not affected.

1.2) Concurrent ASB/SB/SI and SL

none

1.3) Reason

Due to high fuel pressure, caused by exceeding pressure in front of the mechanical fuel pump (e.g. due to an electrical fuel pump), in limited cases a deviation in the fuel supply could occur. This can result in exceeding of the fuel pressure and might cause engine malfunction and/or massive fuel leakage.

1.4) Subject

Replacement of fuel pumps with part no. 892230, 892232, 892540 through part no. 892542 and Replacement of fuel pumps with part no. 892235, 892236, 892545 through part no. 892546 for ROTAX® engine type 912 (Series).

1.5) Compliance

- before the first installation*
- At the next maintenance event, but within the next 25 hours of operation*
- At the latest July 1st 2007*

* if the Alert Service Bulletin ASB-912-053 was not already performed.

▲ **WARNING:** The replacement has to be performed regardless the SB-912-050, "Checking or replacement of fuel pump part no. 892230/892235"!

Non-compliance with these instructions could result in engine damages, personal injuries or death.

d02167

1.6) Approval

The technical content is approved under the authority of DOA Nr. EASA.21J.048.

1.7) Manpower

Estimated man-hours:

Engine installed in the aircraft - - -manpower time will depend on installation and thus, no estimate is available from the engine manufacturer.

1.8) Mass data

Change of weight - - - none.

Moment of inertia - - - unaffected.

1.9) Electrical load data

No change

1.10) Software accomplishment summary

No change

1.11) References

In addition to this technical information refer to current issue of

- Operator's Manual (OM)
- Illustrated Parts Catalog (IPC)
- Maintenance Manual (MM)

◆ NOTE: The status of Manuals can be determined by checking the table of amendments of the Manual. The 1st column of this table is the revision status. Compare this number to that listed on the ROTAX WebSite: www.rotax-aircraft-engines.com. Updates and current revisions can be downloaded for free.

1.12) Other publications affected

The following documentations must be replaced as a consequence of this Service Bulletin and will become invalid therefore.

- SB-912-050 "Checking or replacement of fuel pump part no. 892230/892235", current issue
- ASB-912-053 "Replacement of fuel pump", current issue

1.13) Interchangeability of parts

All used parts which cannot be used must be returned F.O.B. to a ROTAX® Authorized Distributors or Service Centers.

2) Material Information

2.1) Material - cost and availability

Price and availability will be supplied on request by ROTAX® Authorized Distributors or their Service Centers.

2.2) Company support information

None

2.3) Material requirement per engine

parts requirement:

Fig.no.	New part no.	Qty/engine	Description	Old part no.	Application
	892542*	1	fuel pump assy.	892230/232/540	fuel system
	892546*	1	fuel pump assy. with fuel line	892235/236/545	fuel system
	950226**	1	gasket	950225	fuel pump

* dependent of engine type (see IPC)

** gasket is included in the fuel pump assy.

2.4) Material requirement per spare part

None

2.5) Rework of parts

None

2.6) Special tooling/lubricant-/adhesives-/sealing compound - Price and availability

Price and availability will be supplied on request by ROTAX® Authorized Distributors or their Service Centers.
parts requirement:

Fig.no.	p/n	Qty/engine	Description	Old p/n	Application
	897651	as required	Loctite 243 blue	-	hex.nut fuel pump

3) Accomplishment/ Instructions

Accomplishment

All the measures must be taken and confirmed by the following persons or facilities:

- ROTAX® -Airworthiness representative
- ROTAX® -Distributors or their Service Centers
- Persons approved by the respective Aviation Authority

▲ **WARNING:** Proceed with this work only in a non-smoking area and not close to sparks or open flames. Switch off ignition and secure engine against unintentional operation. Secure aircraft against unauthorized operation. Disconnect negative terminal of aircraft battery.

▲ **WARNING:** Risk of scalds and burns! Allow engine to cool sufficiently and use appropriate safety gear while performing work.

▲ **WARNING:** Should removal of a locking device (namely lock tabs, self-locking fasteners) be required when undergoing disassembly/assembly, always replace with a new one.

◆ **NOTE:** All work has to be performed in accordance with the relevant Maintenance Manual.

3.1) Instructions

3.1.1) Replacement of the fuel pump

(see Fig.1)

1. Remove fuel pump (1).
2. Gasket (2) replaced by new part.

■ **CAUTION:** Install new gasket supplied with new fuel pump. Do not reuse old gasket.

◆ **NOTE:** On the sealing surfaces of the gearbox housing and the fuel pump no sealing compound has to be used.

3. Install fuel pump.

4. Tighten uniformly hex. nuts (3) with LOCTITE 243. Tightening torque 15 Nm (133 in.lb).

◆ **NOTE:** The additional use of LOCTITE 243 should be applied at each removal/replacement of the fuel pump and/or gasket. A rework of already installed fuel pumps part no. 892542 and 892546 is not necessary.

5. Install fuel line.

3.1.2) Checking and replacement of the electric (auxiliary) fuel pump

Check output pressure and flow rate of electric (auxiliary) fuel pump as per current ROTAX Installation Manual. Repair or replace any pump that does not meet requirements.

- Restore aircraft to original operating configuration.
- Connect negative terminal of aircraft battery.

3.2) Test run

Conduct test run including ignition check and leakage test.

3.3) Summary

These instructions (section 3) have to be conducted in compliance with section 1.5.


Confirm the implementation of the specified Service Bulletin in the Engine Log book.

Approval of translation to best knowledge and judgment - in any case the original text in the German language and the metric units (SI-system) are authoritative.

4) Appendix

The following drawings should provide additional information:

⚡ B LOCTITE 243

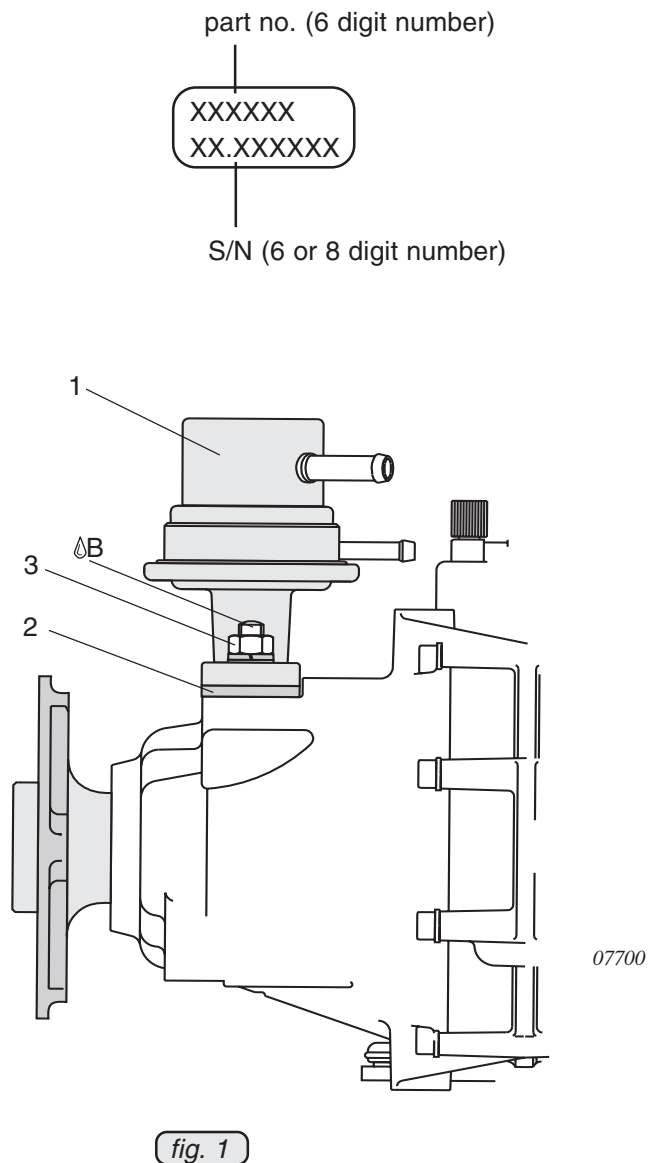

◆ NOTE:

The illustrations in this document show the typical construction. They may not represent full detail or the exact shape of the parts which have the same or similar function.

Exploded views are **not technical** drawings and are for reference only. For specific detail, refer to the current documents of the respective engine type.



SERVICE BULLETIN

Replacement of fuel pumps for ROTAX® Engine Type 912 (Series)

This SB revises the revision 1 dated 24 June 2013.

ATA System: 73-00-00 Fuel system

RECOMMENDED

Symbols used:

Please, pay attention to the following symbols throughout this document emphasizing particular information.

General note



WARNING

Identifies an instruction which, if not followed, may cause serious injury or even fatal injury.



CAUTION

Identifies an instruction which, if not followed, may cause minor or moderate injury.

NOTICE

Denotes an instruction which if not followed, may severely damage the engine or could lead to suspension of warranty.

ENVIRONMENT NOTE

Environment note gives you tips and behaviors to environmental protection.

NOTE:

Information useful for better handling.



A revision bar outside of the page margin indicates a change to text or graphic.

To obtain satisfactory results, procedures specified in this publication must be accomplished with accepted methods and prevailing government regulations.

BRP-Powertrain GmbH & Co KG. cannot be responsible for the quality of work performed in accomplishing the requirements of this publication.

SERVICE BULLETIN

1) Planning information

1.1) Applicability

CAUTION

In accordance with the current Maintenance Manual LINE all mechanical fuel pumps have a 5 year life. Fuel pumps prior to 2008 (with S/N starting 07. or 06.) should have already been replaced in line with the routine maintenance requirements. If this 5 year replacement has been omitted the pump should be replaced with immediate effect. It is necessary to check the part no. & S/N of any pumps previously replaced to ensure that are not in the affected range.

NOTE: Basically, all fuel pumps with part no. 892542 and part no. 892546 are affected. Pumps with following serial numbers (S/N) are originally installed in the engines and/or delivered as spare parts and are affected by this replacement.

All versions of the engine type:

Engine type	Serial number
912 UL	from S/N 4,408.362 up to S/N 4,410.000 inclusive/6,770.101 up to 6,770.278 inclusive
912 ULS/ ULSFR	from S/N 5,648.164 up to S/N 5,653.000 inclusive/6,374.055 up to S/N 6,374.205 inclusive/6,775.001 up to 6,778.295 inclusive

In Addition all fuel pumps part no. 892542
from S/N 06.005924 up to 06.005981 inclusive/07.000529 up to 07.008428 inclusive/08.000001 up to 08.002984 inclusive/09.000001 up to 09.002805/10.000061 up to 10.005298 inclusive/11.000121 up to 11.000840 inclusive and
fuel pumps part no. 892546
from S/N 06.005914 up to 06.005933 inclusive/07.000259 up to 07.008848 inclusive/08.000511 up to 08.002863 inclusive/09.000211 up to 09.002895 inclusive/10.000001 up to 10.005088 inclusive/11.000001 up to 11.000330 inclusive are affected,
which has been installed at engine repair/ general overhaul.

NOTE: The fuel pumps part no. 893110, 893114 and 893115 are not affected by this replacement.

For complete instruction and compliance to this Service Bulletin refer to Service Bulletin SB-912-063, latest edition section 1.2 onward.

NOTE: Section 1.6) Approval: Is not required for engines of the type UL (Series).
Section 3) Accomplishment: In addition: persons with adequate type-specific training.

SERVICE BULLETIN

Replacement of fuel pumps for ROTAX® Engine Type 912 (Series)

This SB revises the initial issue dated 24 June 2013.

ATA System: 73-00-00 Fuel system

RECOMMENDED

Symbols used:

Please, pay attention to the following symbols throughout this document emphasizing particular information.

General note



Identifies an instruction which, if not followed, may cause serious injury or even fatal injury.



Identifies an instruction which, if not followed, may cause minor or moderate injury.

NOTICE

Denotes an instruction which if not followed, may severely damage the engine or could lead to suspension of warranty.

ENVIRONMENT NOTE

Environment note gives you tips and behaviors to environmental protection.

NOTE:

Information useful for better handling.



A revision bar outside of the page margin indicates a change to text or graphic.

SERVICE BULLETIN

1) Planning information

1.1) Applicability

CAUTION

In accordance with the current Maintenance Manual LINE all mechanical fuel pumps have a 5 year life. Fuel pumps prior to 2008 (with S/N starting 07. or 06.) should have already been replaced in line with the routine maintenance requirements. If this 5 year replacement has been omitted the pump should be replaced with immediate effect. It is necessary to check the part no. & S/N of any pumps previously replaced to ensure that are not in the affected range.

NOTE:

Basically, all fuel pumps with part no. 892542 and part no. 892546 are affected. Pumps with following serial numbers (S/N) are originally installed in the engines and/or delivered as spare parts and are affected by this replacement.

The part no. and S/N can be found on the edge of the mounting flange.

All versions of the engine type:

Engine type	Serial number
912 A	S/N 4,410.728 up to S/N 4,410.905 inclusive
912 F	S/N 4,412.926 up to S/N 4,412.989 inclusive
912 S	S/N 4,923.462 up to S/N 4,924.184 inclusive

In Addition all fuel pumps part no. 892542 from S/N 06.005924 up to 06.005981 inclusive/ 07.000529 up to 07.008428 inclusive/08.000001 up to 08.002984 inclusive/09.000001 up to 09.002805/10.000061 up to 10.005298 inclusive/11.000121 up to 11.000840 inclusive and fuel pumps part no. 892546 from S/N 06.005914 up to 06.005933 inclusive/07.000259 up to 07.008848 inclusive/08.000511 up to 08.002863 inclusive/09.000211 up to 09.002895 inclusive/ 10.000001 up to 10.005088 inclusive/11.000001 up to 11.000330 inclusive are affected, which has been installed at engine repair/ general overhaul.

NOTE:

The fuel pumps part no. 893110, 893114 and 893115 are not affected by this replacement.

1.2) Concurrent ASB/SB/SI and SL

Latest SI-912-020, regarding the general notes, measurements, changes etc.

1.3) Reason

Field observation over the years has shown that in isolated cases failures of the mechanical fuel pump (part no. 892542 and 892546) can occur, which may subsequently lead to malfunctions. To prevent possible problems with the fuel system, the fuel pumps have to be replaced.

1.4) Subject

Replacement of fuel pumps for ROTAX® engine type 912 (Series).

1.5) Compliance

- At the next scheduled maintenance event.
- A replacement of the fuel pumps according to the instructions in section 3 has to be carried out May 01 2014 at the latest.

WARNING

Non-compliance with these instructions could result in engine damages, personal injuries or even fatal injury.

d05679.fm

SERVICE BULLETIN

1.6) Approval

The technical content of this document is approved under the authority of DOA ref. EASA.21J.048.

1.7) Labor time

Estimated labor time:

engine installed in the aircraft - - - labor time will depend on installation and therefore no estimate is available from the engine manufacturer.

1.8) Mass data

change of weight - - none.

moment of inertia- - - unaffected.

1.9) Electrical load data

no change

1.10) Software accomplishment summary

no change

1.11) References

In addition to this technical information refer to current issue of

- Illustrated Parts Catalog (IPC)
- Heavy Maintenance Manual (HMM)

NOTE:

The status of Manuals can be determined by checking the table of amendments of the Manual. The 1st column of this table is the revision status. Compare this number to that listed on the ROTAX® WebSite: www.FLYROTAX.com. Updates and current revisions can be downloaded for free.

1.12) Other publications affected

none

1.13) Interchangeability of parts

- Fuel pumps which are removed along with insulating flange (gasket), lock washers and nuts in accordance with chap. 3.1 are unserviceable and must be returned to your local ROTAX® Authorized Distributors or their Service Center.

2) Material Information

2.1) Material- cost and availability

Price and availability and any possible support consideration will be supplied on request by ROTAX® Authorized Distributors or their Service Center.

2.2) Company support information

Price and availability and any possible support consideration will be supplied on request by ROTAX® Authorized Distributors or their Service Center.

d05679.fm

SERVICE BULLETIN

2.3) Material requirement per engine

parts requirement:

New part no.	Qty/ engine	Description	Old part no.	Application
945752	2	Lock washer A8		fuel pump assy.
881360	1	Fuel pump set	-	for fuel pump exchange
consists of:				
893110	1	Fuel pump assy. (consists of: 1x fuel pump part no. 893115 2x gasket ring part no. 250425 1x nipple part no. 840740 1x nipple part no. 840745 1x isolating flange part no. 950228 1x O-ring part no. 631870)	-	
942674	2	Hex. nut M8	-	fuel pump assy.
851453	1	1-ear clamp 12.8-15.3 mm/0.50-0.60 in.	-	fuel pump assy. (inlet)
851463	1	1-ear clamp 10.8-13.3 mm/0.43-0.52 in.	-	fuel pump assy. (outlet)
851663	1	1-ear clamp 22.4-25.6 mm/0.88-1.01 in.	-	fuel pump assy. (inlet)
853313	1	1-ear clamp 17.8-21.0 mm/0.70-0.83 in.	-	fuel pump assy. (outlet)

2.4) Material requirement per spare part

none

2.5) Rework of parts

none

2.6) Special tooling/lubricant-/adhesives-/sealing compound

Price and availability will be supplied on request by ROTAX® Authorized Distributors or their Service Center.

Description	Part no.	Application
Clamp/Mounting pliers	n.a.	1-ear clamp

NOTICE

When using the special tools, please note the information supplied by the tool manufacturer.

d056679.fm

SERVICE BULLETIN

3) Accomplishment / Instructions

NOTE: Before maintenance, review the entire documentation to make sure you have a complete understanding of the procedure and requirements.

Accomplishment

All the measure must be taken and confirmed by at least one of the following person or facilities:

ROTAX® - Airworthiness representative

ROTAX® - Distributors or their Service Center

Persons approved by the respective Aviation Authority

NOTE: All work has to be performed in accordance with the relevant Installation Manual and Maintenance Manual.

Safety notice



WARNING

Proceed with this work only in a non-smoking area and not close to sparks or open flames. Switch off ignition and secure engine against unintentional operation. Secure aircraft against unauthorized operation. Disconnect negative terminal of aircraft battery.



WARNING

Risk of scalds and burns! Allow engine to cool sufficiently and use appropriate safety gear while performing work.

NOTICE

Should removal of a locking device (e.g. lock tabs, self-locking fasteners, etc.) be required when undergoing disassembly/assembly, always replace with new ones.

3.1) Removal

NOTICE

Ensure the fuel supply is turned off before disconnecting any hoses.

3.1.1) Removal of fuel pump part no. 892542 (without crimped hose assembly), see Fig. 1

The following work steps are necessary:

Step	Procedure
1	Remove fuel hoses as per aircraft manufacturers instructions. NOTE: Make note of orientation of the hoses (inlet/outlet).
2	Loosen hex. nuts (13 mm/0.51 in) and remove fuel pump with lock washer A8 and insulating flange (gasket).

SERVICE BULLETIN

Graphic

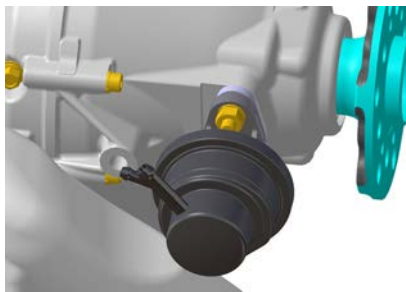


Fig. 1

09865

3.1.2) Removal of fuel pump part no. 892546 (with fire sleeve), see Fig. 2

Figure shows fuel pump part no. 892546 with crimped fuel hose assy. and fire sleeve.
Fuel pump

Graphic

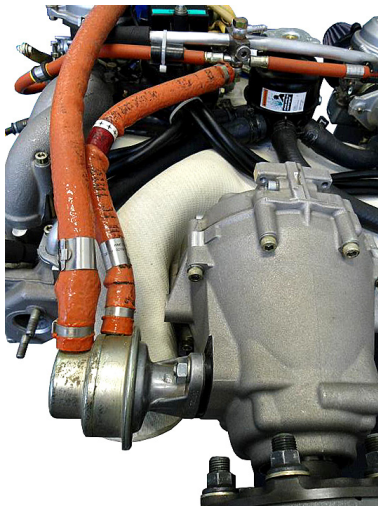


Fig. 2

09841

The following work steps are necessary (see Fig. 3):

NOTICE

Do not use any pliers with sharp surfaces.

Step	Procedure
1	Cut off the 1-ear clamp (1) of fire sleeve (2) with cutting pliers (3).
2	Slide back the fire sleeve (2) to make fuel hose accessible for cutting.
3	Pinch off the fuel hose with hose clamp pliers (4).

ENVIRONMENT NOTE

Ensure, that no fuel gets into the waste water system or the ground - risk of contaminating drinking water!

d05679.fm

SERVICE BULLETIN

Graphic

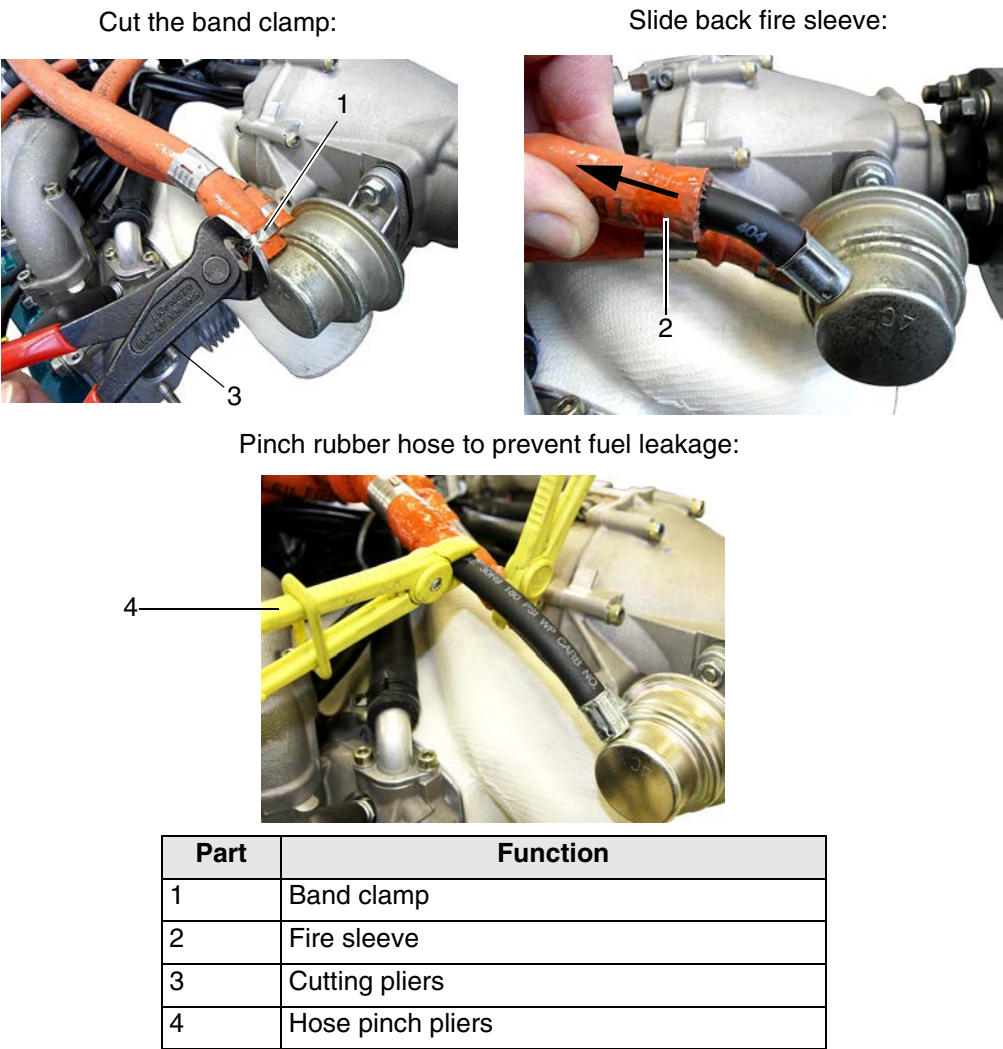


Fig. 3

09842,09843,09854

NOTE: Cut off the fuel hose with a very sharp knife, so that no cutting residues are produced. See Fig. 4.


 **CAUTION**

Risk of cut injuries!
Knives are sharp and may cause injury.
Wear protective gloves.

Step	Procedure
4	The cut should be made adjacent to the crimped ferrel, to avoid losing any needed length. The fuel hose is reduced by approx. 20 mm (0.79 in.). NOTE: Make note of orientation of the hoses (inlet/outlet) A clean cut surface is very important!
5	Repeat procedure at the second fuel hose assy.

SERVICE BULLETIN

Graphic

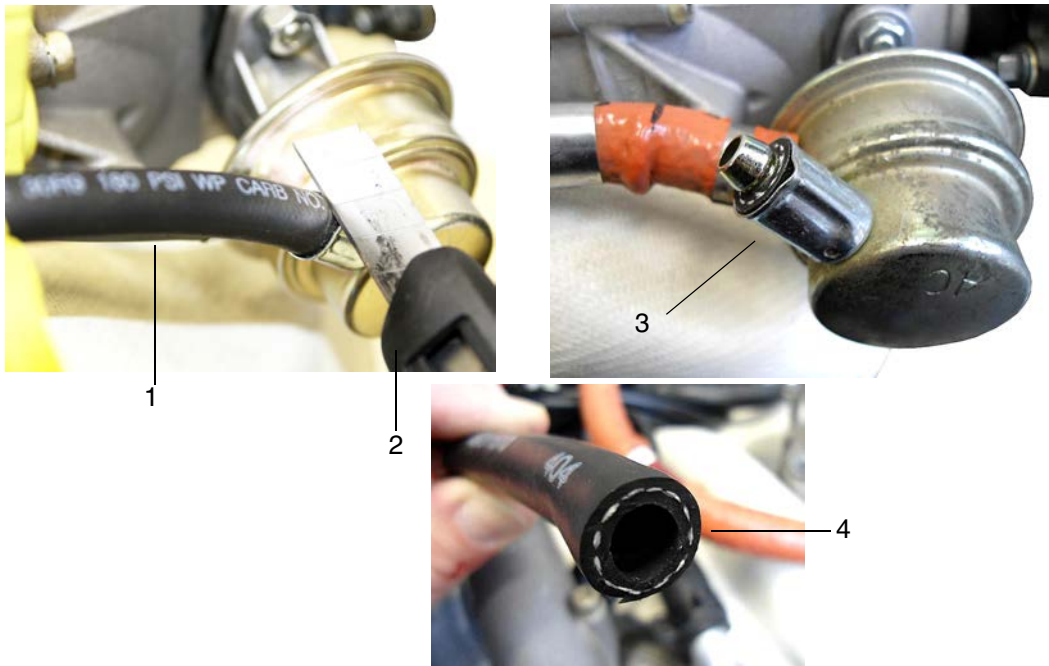

Part	Function
1	Fuel hose
2	Cutting knife
3	Crimped ferrule
4	Surface

Fig. 4

09844,09845,09855

Step	Procedure
6	Loosen hex. nuts (13 mm/0.51 in) and remove fuel pump with lock washer A8 and insulating flange (gasket). See Fig. 5.

Graphic



Fig. 5

09846

d05679.fm

SERVICE BULLETIN

3.2) Assembling of fuel pump assy. part no. 893110

See Fig. 6.

NOTICE

In addition to the insulating flange (gasket) also replace the O-ring at reassembly or assembly of the fuel pump.
Both parts are included in the set of fuel pump assy.


NOTICE

Ensure the O-ring is located in the recess in the fuel pump, before installing the fuel pump!

NOTE: Also all work has to be carried out in accordance with the aircraft manufacturer's instructions

Step	Procedure
1	Install fuel pump (5) with new insulating flange (gasket) (1) and O-ring (2).
2	Secure new hex. nuts M8 (4) and lock washer A8 (3) with LOCTITE 243 and tighten them evenly. Tightening torque 15 Nm (133 in.lb).

Graphic

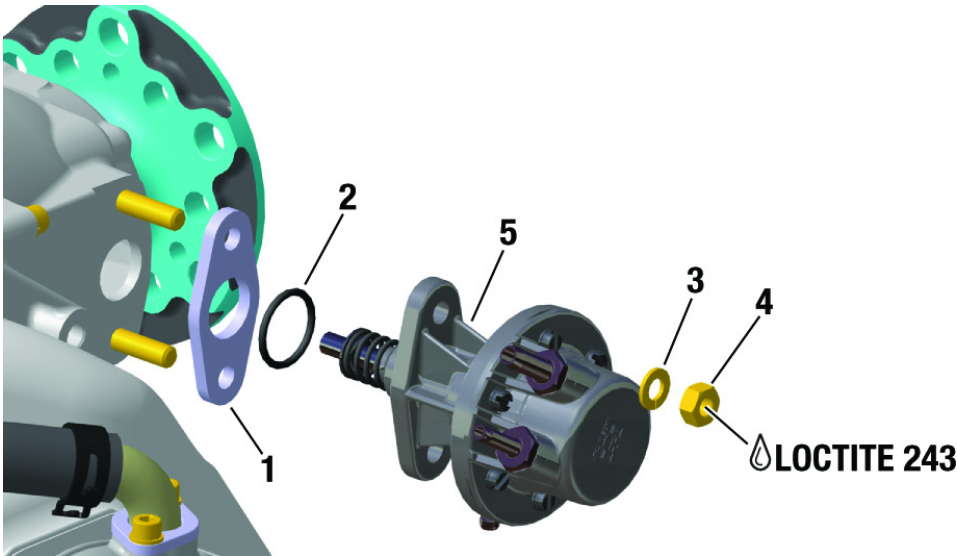

Part	Function
1	insulating flange (gasket)
2	O-ring
3	Lock washer A8
4	Hex. nut M8
5	Fuel pump assy.

Fig. 6

09847


SERVICE BULLETIN

3.3) Inspection of fuel pump assy. part no. 893110

- General

See [Fig. 7](#).
The fuel pump cover (1) must not be opened for inspection. Check the security markings (witness paint) (2).
Check the connecting nipples (3)+(4) for tightness. If necessary secure them with LOCTITE 243.
Tightening torque 10 Nm (88.5 in.lb).
- Graphic

Fuel pump part no. 893110

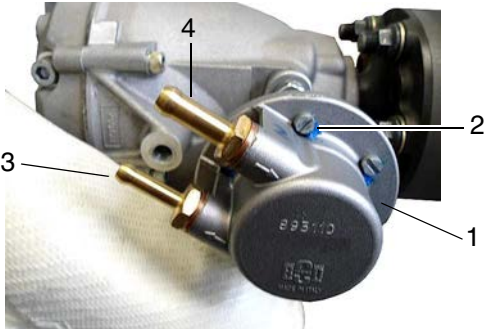

Steps	Function
1	Fuel pump cover
2	Security marking (witness paint)
3	Connecting nipple - outlet (inner) D = 3.8 mm/0.15 in.
4	Connecting nipple - inlet (inner) D = 5.7 mm/0.22 in.

Fig. 7

09848

3.4) Assembling of the fuel hoses assy.

NOTICE

All lines must be installed free of kinks, avoid tight bends.
Prevent the hoses from chafing on components or against each other.
Ensure there is adequate free length in the hose to allow for engine movement.

3.4.1) Assembling of the fuel pump part no. 893110 without crimped on hose assy. supplied by BRP-Powertrain

Perform assembly according to the service manual of the aircraft manufacturer.
Instruction and materials are not supplied by BRP-Powertrain.
When connecting the hoses make sure the orientation is correct.

Step	Procedure
1	Connect the hose from the fuel tank to the connecting nipple identified as 4 in Fig. 7 .
2	The hose that goes to the carburetors should be connected to the connecting nipple identified as 3 in Fig. 7 . NOTE: After installation of the hoses ensure the fuel tap is turned back ON.

SERVICE BULLETIN

3.4.2) Assembling of the fuel pump part no. 893110 when replacing fuel pump part no. 892546

See Fig. 8.

ENVIRONMENT NOTE

Ensure, that no fuel gets into the waste water system or the ground - risk of contaminating drinking water!

Step	Procedure
1	Remove hose clamp pliers from fuel hose assy.

NOTE: Thereby, the fuel contained in the lines flow out and flush the residual debris from the fuel line.
Be prepared with a suitable container and/or cloth to catch the outcoming fuel.

Step	Procedure
2	Before the fuel hose (2) is fitted with a 1-ear clamp (1), the two fuel hoses have to be marked (3) 16 mm (0.63 in.) from the end of the hose (2).
3	Slide all 4 1-ear clamps (1) on the fuel and fire sleeves. NOTE: Clamps part no. 853313/851663 on fire sleeve and clamps part no. 851463/851453 on fuel hose.
4	Slide the fuel hoses (2) onto nipple completely up to the end stop.
5	Crimp 1-ear clamp (1)- outlet side part no. 851463 with suitable crimp pliers . NOTE: The edge of the 1-ear clamp (1) must align with mark (3) from fuel hose (2) , because otherwise there is too little space for the 1-ear clamp (1) of the fire sleeve.
6	Repeat steps on inlet-side with 1-ear clamp (1) part no. 851453 for fuel hose assy. (2).

Graphic

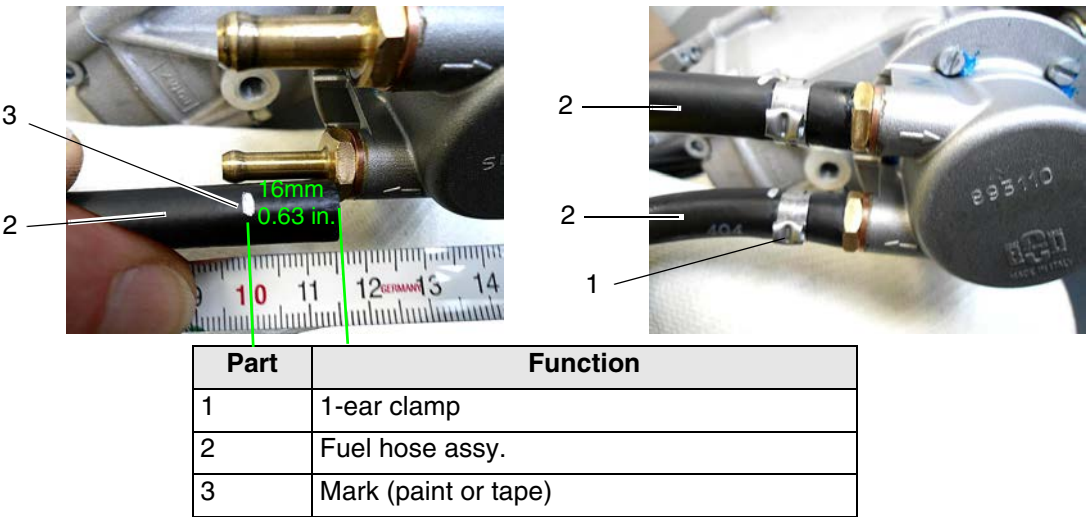


Fig. 8

09849, 09850

SERVICE BULLETIN

3.4.3) Leakage test

Because all fuel hose connections are visible and accessible now, inspect the whole fuel system for leaks. Therefore pressurize the system (for example by an electric fuel pump) with the operating pressure.

NOTE: Reconnect of battery may be necessary for operating the fuel pump in order to perform this test.

3.5) Assembling of fire sleeves with crimp clamp connection

See Fig. 9.


NOTICE

The distance from the 1-ear clamp (2) to the nipple flange (3) has to be measured, so that the outer 1-ear clamp (5) can be mounted on the fire sleeve (4) in the correct position.

Step	Procedure
1	Measure the distance at fuel hose assy. (1) from 1-ear clamp (2) to nipple flange sealing surface (3) and mark the fire sleeve (4) correspondingly. NOTE: The clamp securing the fire sleeve should be as close as possible but without impeding on the fuel hose clamp

Graphic

Distance measuring

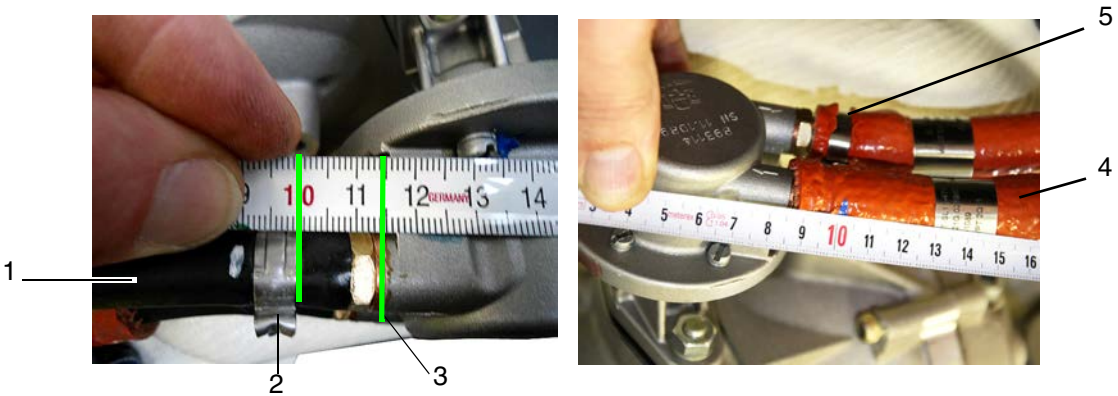

Part	Function
1	Fuel hose assy.
2	1-ear clamp
3	Nipple flange
4	Fire sleeve
5	1-ear clamp on fire sleeve

Fig. 9

09851,09856

SERVICE BULLETIN

See Fig. 10.

Step	Procedure
2	Push fire sleeve (fuel inlet) to stop and mount 1-ear clamp (17.8-21.0 mm/0.70-0.83 in.) with suitable crimp pliers.
3	Repeat steps for fire sleeve (fuel outlet) (22.4-25.6 mm/0.88-1.01 in.).

ENVIRONMENT NOTE


Ensure, that no fuel gets into the waste water system or the ground - risk of contaminating drinking water!

NOTICE

A drain line must be installed, that in the event of a internal leak any fluid is drained to a suitable location/position. See therefore Installation Manual of the relevant engine type and SI-912-020.

Graphic

Modification finished.

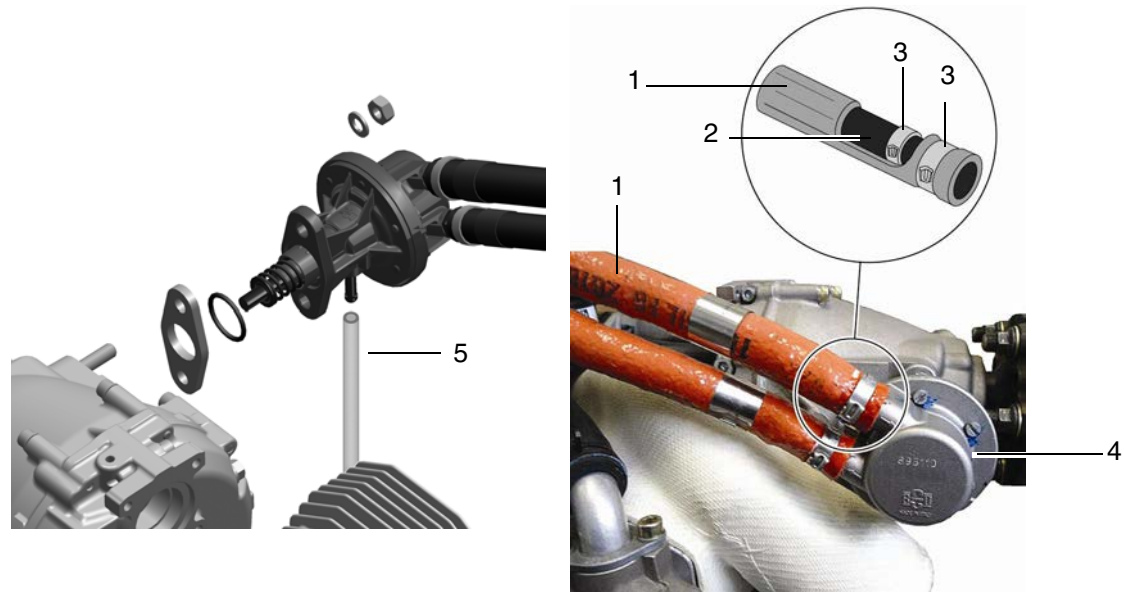

Part	Function
1	Fire sleeve
2	Fuel hose assy.
3	1-ear clamp
4	Fuel pump assy.
5	Drain line

Fig. 10

09853

- Restore the aircraft to standard operating condition.
- Connect the negative terminal of the battery.

SERVICE BULLETIN

3.6) Test run

Conduct test run including ignition check and leakage test.

NOTE: Due to the replacement with the new fuel pump automatically note the changed operating limit. See latest Operators Manual of the 912 Series. Also contact your aircraft manufacturer for further instructions.

3.6.1) Check of fuel pressure

NOTE: The fuel pump part. 893110 has different characteristics as the fuel pumps part no. 892542 and part no. 892546.

Low fuel pressure indications are possible and allowed. But the pressure must stabilize to the operating limit within 5 seconds. If not, the cause should be determined and rectified.

Due to the technical design and installation conditions (construction of the return line, etc.) pressure fluctuations, at the fuel pump part no. 893110 are possible. These pressure fluctuations within the specified operating limits are not considered to a problem.

3.6.2) Check of float chamber

Check float chamber for any debris particles. If any debris particles should be found then their source must be located. If necessary remove, clean and install again the float chamber.

3.6.3) Check drain line

NOTE: A slight leakage on the drain line can be attributed to a slight "sweating" and not considered to be a issue. For a period of 1 minute after the engine has been stopped, no liquid must drip down.

In case of uncertainty determine the oil amount. The maximum leakage is 0.5 ml for a 20 min engine run..

3.7) Summary

These instructions (section 3) have to be conducted in accordance with compliance in section 1.5. The execution of the recommended Service Bulletin must be entered in the engine logbook.

Approval of translation to best knowledge and judgement-in any case the original text in German language and the metric units (SI-system) are authoritative.

NOTE: The illustrations in this document show the typical construction. They may not represent full detail or the exact shape of the parts which have the same or similar function.

Exploded views are **not technical drawings** and are for reference only. For specific detail, refer to the current documents of the respective engine type.

3.8) Enquiries

Enquiries regarding this Service Bulletin should be referred to the ROTAX® authorized distributor of your area. A list of all distributors is provided on www.FLYROTAX.com.

d05679.fm

2.1) Time limit for rubber parts

General note

NOTICE

This time limit must be followed **independently** and **in addition** to the visual inspections (see chap. 05-20-00 section: 5.1)) of the respective components.

Time limit

The following components and systems must be replaced every 5 years:

- venting hose of the carburetors	
- all rubber hoses of the cooling system	
- all rubber hoses of the fuel system (excluding all genuine ROTAX teflon hoses of the fuel system)	See SI-912-022, latest issue.
- venting hose of the fuel pump	
- all rubber hoses of the lubrication system which are part of the engine supply volume and if they are not in the maintenance schedule of aircraft manufacturer	
- carburetor sockets	
- connecting hose of the air intake system	
- diaphragm on both carburetors	
- rubber hoses on compensating tube	
- V-belt	

2.2) Time limit for fuel pump

General note

The fuel pump must be replaced every 5 years.

2.3) Time limit for the coolant

General note

Coolant must be replaced as per manufacturers instructions, at the latest during overhaul or when the engine is replaced.

2.4) Annual inspection

General note

A 100 hr. inspection is to be carried out periodically after every 100 hours of operation **or every 12 months**, whichever comes first.
See chap. 05-10-00 section: 2).