

From: Christopher.L.Kennedy [REDACTED]
Sent: Tuesday, March 7, 2017 4:33 PM
To: Scott Arnold [REDACTED]
Cc: bmayer [REDACTED] com; CLang [REDACTED]
Subject: RE: Meeker, CO

N5VK Teardown Notes

- Little fuel to cylinders.
- No sheering of fuel pump spline.
- Each cylinder has compression.
- Each spark plug looks good and provides a spark.
- Swapping prop to test run engine.
- Rust and debris in gascolator.
- Engine ran with no issue, was a little difficult to start after about 7 tries but then ran fine.
- Lots of water found in wings when flipped wings over and a lot of water poured out of the wings.
- Gas tank lid seals were good.
- Prop cable damaged and came loose from rubber boot.

Best Regards,



Christopher L. Kennedy
Geographic/Airworthiness
Aviation Safety Inspector
Scottsdale FSDO

[REDACTED]
Scottsdale, AZ. 85255
[REDACTED]