



Photo 1 – Damaged Tail Rotor Assembly



Photo 2 – Closeup of Tail Rotor Output Shaft