

Name Paxdarsa AviationShop Order Number 12622Date 1/11/18N-Number U771XWPlease Advise on ☐ Hobbs 62.5 Tach ACTT 6939.1 LG Cycles 6964DISCREPANCY # 1Flaps will NOT retract

CORRECTIVE ACTION:

Hydraulic Line leaking into Cabin belly - found contents of system leaked into belly of Cabin Area - removed interior - removed cabin floor - removed electrical junction box (main) removed cabin ducting - replaced Line + reassembled - Inspected engine driven pumps for damage - serviced system and performed Gear + Flap operations 1 ck's

Quantity	Part Number	Description	Price
✓ 1	5717022-17	Line (LSSNA)	
	PO 20114		
	fdx P1		
	10 barrel charges		
	2 gallons 5606 Hydraulic Fluid		

Initials	Date	Hr/Min	Initials	Date	Hr/Min
TS	1/10	13			
Tren	1/10	6.5			
TS	1/11	1			

TOTAL HOURS / MINUTES 20.5DISCREPANCY # 2Coffee Door Latch broken

CORRECTIVE ACTION:

Replaced

Quantity	Part Number	Description	Price
1	10522-1	LATCH	

Initials	Date	Hr/Min	Initials	Date	Hr/Min
TS	1-11	5			

TOTAL HOURS / MINUTES 5

Beechcraft



Hawker

TEXTRON AVIATION

Sales Order

PARTS TOTAL 2000

Sold-To Customer: Customer #50037
EXECUTIVE AIR, LLC.
2131 AIRPORT DRIVE
GREEN BAY, WI 54313

Ship-To Customer: EXECUTIVE AIR, LLC.
2131 AIRPORT DRIVE
GREEN BAY, WI 54313

Order #: WB0000505207

Order Date: 1/9/2018

Purchase Order #: 20114

Currency: USD

Selected Shipping: Method: By 10:30 a.m.
Priority: 1 Day
Carrier: Fed Ex
Shipping Account #: 199358898

Payment: On Account

Line	Item	Qty	List Price	Disc. Price	Extd. Price
10	5717022-17 LINE AY WICHITA	1 EA			

*Total does not include applicable taxes and shipping charges.

Order Note: N771XV
W/O 12622

Customer Support - Domestic
800.835.4000 parts@txav.com

Customer Support - International
+1.316.517.5603 intparts@txav.com

Date Printed: 1/11/2018 8:21 AM

Page 1 of 1

Pandora Aviation



N771XW
Cessna 441
Serial Number 441-0065

1/11/2018
Work Order # 12622

TT A/C: 6939.1 hr
6964 Landings

Gained access and installed new hydraulic line Cessna part number 5717022-17. Serviced hydraulic system with two gallons of 5606 hydraulic oil and performed landing gear and flap operational checks.

-----END-----

I certify that the above stated maintenance and/or inspection was performed in accordance with the current Federal Aviation regulations. All inspections were performed in accordance with FAR 91.409 (f) (3) and the aircraft component identified above is presently airworthy and is approved for return to service.

Pander DCA Aviation

Executive Air

2131 Airport Drive
Green Bay, WI 54313
Phone: 920-498-4880
Fax 920-498-4890



Shop Order: 12622

Opened: 1/11/2018
Closed:

Sold To: Ponderosa Aviation LLC
N4893 County Rd C
Kewaunee, WI 54216 United States

Aircraft Number:	N771XW	Type:	441	S/N:	441-0065
Total Time:	6,939.1	Hobbs Time:	62.5	Tach Time:	
Discrepancy: 1		LG Cycles:	6,964		

Problem:

Flaps will not retract.

Action Taken:

Hydraulic line leaking. Found contents of system leaked into belly. ~~Cleaned~~ Removed interior, removed cabin floor, removed electrical junction box (main), removed cabin ducting. Replaced line and reassembled. Inspected engine driven pumps for damage. Serviced system and performed gear and flap operational checks. - *Performed Hydraulic pump operational checks*

Charges This Item:

Part Number	Description	Credit	Quantity
5606	Hydraulic Fluid		2.0
5717022-17	Line Assy		1.0

Discrepancy: 2**Problem:**

Coffee door latch broken.

Action Taken:

Replaced latch.

Charges This Item:

Part Number	Description	Credit	Quantity
10522-1	Latch		1.0

Miscellaneous Charges:**Summary:**

Total Parts:	\$		Total Freight:
Misc Supplies:	\$		Total Labor - 2

Totals:

SubTotal:
Total Charges:
Amount Remainin

Terms: Interest of 1.5% will be charged on all invoices over 30 days old.

Payment Due Upon Receipt

Terms: Interest of 1.5% will be charged on all invoices over 30 days old.

Executive Air

2131 Airport Drive
Green Bay, WI 54313
Phone: 920-498-4880
Fax 920-498-4890

Additional Freight Charges may be billed at a later date due to vendor invoicing.

Name Pawhusa AviationDate 11/17/17Shop Order Number 12558N-Number N771XWPlease Advise on ☐ Hobbs 39.0 Tach ACTT 69156 LG Cycles 6951DISCREPANCY # # 2 left hand passenger seat
won't reclineWest Star Squak 13CORRECTIVE ACTION: Removed seat from aircraft disassembled
adjusted cable, ops test good, re installed seat

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
				<u>DW</u>	<u>11/17</u>	<u>.5</u>			
				<u>TS</u>	<u>11/17</u>	<u>.5</u>			
TOTAL HOURS / MINUTES									<u>1.0</u>

DISCREPANCY # Static Wick replacementPer West Star Squak # 20CORRECTIVE ACTION: Replaced

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
<u>1</u>	<u>BD1W</u>	<u>Wick</u>		<u>TS</u>					
TOTAL HOURS / MINUTES									<u>N/C</u>

Page of

Executive Air Maintenance Department 2131 Airport Drive Green Bay, WI 54313 (920) 498-4880

Danden PCA Aviation

Op Order Number _____

Date _____

N-Number _____

Please Advise on ☐ Hobbs _____ Tach _____ ACTT _____ LG Cycles _____

DISCREPANCY # _____

Wing + tail de ice boot
conductive cement missing in areas

CORRECTIVE ACTION:

Cleaned, prepped and re sealed wing
+ tail de ice boots conductive cement

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
				DS	11/17	1.0			

TOTAL HOURS / MINUTES 1.0

DISCREPANCY # _____

Clamps on Rt Engine Toru/woru

CORRECTIVE ACTION:

replaced as necessary

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
5	MS21919-WHB	2 Adul clamp		TS	11/17	1.0			
1	" "WH7								

TOTAL HOURS / MINUTES 1.0

Page _____ of _____

Executive Air Maintenance Department 2131 Airport Drive Green Bay, WI 54313 (920) 498-4880

Dundon DCA Aviation

Date _____

N-Number _____

Please Advise on $\Rightarrow$ Hobbs _____ Tach _____ ACTT _____ LG Cycles _____
 N-Number _____
 DEFICIENCY # _____

DISCREPANCY # _____

Rt Engine Cool Oil bypass door

Spive, Sprung

1. best Smr Squak # 66

CORRECTIVE ACTION:

Unsprunged The Spring Springs
Factor 3 Times

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
				TS	1/17	1/4			
						TOTAL HOURS / MINUTES		1/4	

DISCREPANCY # _____

Forward baggage door's extenders
Weak

West Star Squak #12

CORRECTIVE ACTION:

replaced

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
2	Few 118	Spring		TS	11/17	.5			
from Customer Stock									
TOTAL HOURS / MINUTES						.5			

Page ____ of ____

Executive Air Maintenance Department 2131 Airport Drive Green Bay, WI 54313 (920) 498-4880

Davidson Davidson

Op Order Number _____

Date _____

Please Advise on ☐ Hobbs _____

Tach _____

ACTT _____

N-Number _____

LG Cycles _____

DISCREPANCY # _____

Service Nose Strut

CORRECTIVE ACTION: _____

Serviced N²

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
				TS	11/17	1/4			

TOTAL HOURS / MINUTES

1/4

DISCREPANCY # _____

Removed Engine Cowls To Verify
Cowl Seals needed - inspect
squaks from West Star

CORRECTIVE ACTION: _____

Remain Cowls - inspected squaks
from West Star - ordered correct seals
Reinstalled cowl

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
				TS	11/17	1.0			
				DW	11/17	1.0			

TOTAL HOURS / MINUTES

2.0

Page _____ of _____

Executive Air Maintenance Department 2131 Airport Drive Green Bay, WI 54313 (920) 498-4880

David DCA Aviation

Executive Air

Purchase Order/Tracking Number

20031

To:	From:
Textron Aviation	Executive Air
	Austin Straubel Field
	2131 Airport Drive
	Green Bay, WI 54313

Date: 11/14/17	Ship Via (Ground)
Terms: ACCOUNT	Tracking Number:

Shipment To Be Received ☐Core Return ☐Overhaul/Repair ☐Incorrect Part ☐

Qty.	Part Number	Serial Number	Description	Acft. N-#	Weight
*2	FEN118		Gas spring	771XW	
1	606C66-8		Tine	" "	
1	M328775-268		O/R	" "	
1	302 246-400		Tube	" "	
1	277K08-1		Tine	" "	

Comments:
Bill Pawlarsa Aviation
Customer Stock

If you have any questions, please contact: Tony

Phone # (920) 498-4880

Fax # (920) 498-4890

Thank You!

Sales Order

parts.txtav.com

Sold-To Customer: Customer #50037
EXECUTIVE AIR, LLC.
2131 AIRPORT DRIVE
GREEN BAY, WI 54313

Ship-To Customer: EXECUTIVE AIR, LLC.
2131 AIRPORT DRIVE
GREEN BAY, WI 54313

Order #: WB0000475610
Order Date: 11/14/2017
Purchase Order #: 20031
Currency: USD
Selected Shipping: Method: Ground
Priority: 4 Day
Carrier: Fed Ex
Payment: On Account

Line	Item	Qty	List Price	Disc. Price	Extd. Price
10	FEN118 GAS SPRING WICHITA - WEST	2 EA			
20	606C66-8 TIRE 6.00X6 6PLY FLCIII TT WICHITA - EAST	1 EA			
30	MS28775-269 O-RING WICHITA - WEST	1 EA			
40	302-246-400 TUBE G15/6.00X6 TR67/BENT 90 WICHITA - EAST	1 EA			
50	277K08-1 TIRE 22X7.75-10 10PLY RIB TL WICHITA - EAST	1 EA			

*Total does not include applicable taxes and shipping charges.

Order Note: N771XW
Ponderosa Aviation stock

Customer Support - Domestic
800.835.4000 parts@txtav.com

Customer Support - International
+1 316.517.5603 intparts@txtav.com

Packing Sheet

Deechcraft



Lowker

PACKING SHEET NO.	REQUESTED VIA	PERMIT CODE	FILE	TERMS	Texttron Aviation Inc.
2901223	FED-G	PP	SP	N30	PACKING SHEET DATE
				SHIP TO	Nov/14/2017
EXECUTIVE AIR, LLC. 2131 AIRPORT DRIVE GREEN BAY WI 54313 UNITED STATES					

NOTES

Web Order Number: WB0000475610

N771XW Ponderosa Aviation stock

Order: 0005889547 Line: 000030 NO 8130 REQUIREMENTS

SALES ORDER NUMBER: 5889547
PACKING SHEET NUMBERS: 2901223

CUSTOMER P.O. NUMBER: 20031

LINE NUMBER	QTY ORDERED	QTY BAK ORDERED	UOM	PARTS/UNIT	DESCRIPTION	MODEL SERIAL NUMBER	CANCEL CODE	QTY SHIPPED	UNIT PRICE	DIS
20	1	0	EA	606C06-8	TIRE 6.00X6 6PLY FLCIII TT					
SRN: 70972281										
ECCN: 9A991 EXPORT HTS CODE: 4011300010										
VENDOR: 402563 ORIGIN SEE PART/PACKAGE										
US IMPORT HTS: 4011300010										
40	1	0	EA	302-246-400	TUBE G15/6.00X6 TR67/BENT 90					
302-246-400 IS BENT STEM 302-246-401 IS STRAIGHT STEM										
ECCN: 9A991 EXPORT HTS CODE: 4013905050										
VENDOR: 402582 ORIGIN SEE PART/PACKAGE										
US IMPORT HTS: 4013905050										
50	1	1	EA	277K08-1	TIRE 22X7.75-10 10PLY RIB TL					
									TOTAL	

NOTES

If these commodities are exported from the United States, neither Textron Aviation nor any of its subsidiaries shall be listed as the US exporter of record.

***** Certificate of Compliance *****

Seller certifies that the item(s) on this order were manufactured and inspected in accordance with Textron Aviation Inc's FAA-approved Quality System. Where item(s) or service(s) have been procured from an approved supplier, the seller further confirms, attests, or certifies, or alternatively has on file, applicable supplier's certifications.

Ponderosa Aviation

Packing Sheet

Beechcraft



Textron Aviation

PACKING SHEET NO.	SUGGESTED VIA	FREIGHT CODE	P.O.B.	TERMS	PACKING SHEET DATE
2901235	FED-G	PP	SP	N30	Nov/14/2017
SHIP TO					
EXECUTIVE AIR, LLC. 2131 AIRPORT DRIVE GREEN BAY WI 54313 UNITED STATES					

NOTES

Web Order Number: WB0000475610

N771XW Ponderosa Aviation stock

Order: 0005889547 Line: 000030 NO 8130 REQUIREMENTS

SALES ORDER NUMBER: 5889547
PACKING SHEET NUMBERS: 2901235

CUSTOMER P.O. NUMBER: 20031

LINE NUMBER	QTY ORDERED	QTY BACK ORDERED	UOM	PART NUMBER	DESCRIPTION	MODEL SERIAL NUMBER	CANCEL CODE	QTY SHIPPED
10	2	0	EA	FEN118	GAS SPRING			2
NON-HAZARDOUS								
ECCN: EAR99 EXPORT HTS CODE: 8302496035								
VENDOR: 675971 ORIGIN: SEE PART/PACKAGE								
US IMPORT HTS: 8302496035								
30	1	0	EA	MS28775-269	O-RING			1
LOT: 0081041247								
MATERIAL COMPOSITION NITRILE 120 MONTH SHELF LIFE								
PER CSRS021								
ECCN: 9A991 EXPORT HTS CODE: 4016935010								
VENDOR: 865151 ORIGIN: MEXICO								
US IMPORT HTS: 4016935010								
50	1	1	EA	277K08-1	TIRE 22X7.75-10 10PLY RIB TL			0
TOTAL								

NOTES

If these commodities are exported from the United States, neither Textron Aviation nor any of its subsidiaries shall be listed as the US exporter of record.

***** Certificate of Compliance *****

Seller certifies that the item(s) on this order were manufactured and inspected in accordance with Textron Aviation Inc's FAA-approved Quality System. Where item(s) or service(s) have been procured from an approved supplier, the seller further confirms, attests, or certifies, or alternatively has on file, applicable supplier's certifications.

Ponderosa Aviation

Packing Sheet

Beechcraft



Towhee

TEXTRON AVIATION

Textron Aviation Inc.

PACKING SHEET NO. 2903095	SUGGESTED VIA FED-G	FREIGHT CODE PP	POB SP	TERMS N30	PACKING SHEET DATE Nov/15/2017
				SHIP TO EXECUTIVE AIR, LLC 2131 AIRPORT DRIVE GREEN BAY WI 54313 UNITED STATES	

NOTES

Web Order Number: WB0000475610
N771XW Ponderosa Aviation stock

SALES ORDER NUMBER: 5889547
PACKING SHEET NUMBERS: 2903095

CUSTOMER P.O. NUMBER 20031

LINE NUMBER	QTY ORDERED	QTY BACK ORDERED	LYM	PART NUMBER	DESCRIPTION	MODEL SERIAL NUMBER	CANCEL CODE	QTY SHIPPED	UNIT PRICE	DIS.
50	1	0	EA	277K08-1	TIRE 22X7.75-10 10PLY RIB TL			1		
SRN: 63522699										
THIS PART IS A REPLACEMENT FOR 277K08-1 PER VENDOR FAX. YJ 6/98										
FREE FEDERAL EXPRESS GROUND FREIGHT IN THE USA AND CANADA.										
ECCN: 9A991 EXPORT HTS CODE: 4011300010										
VENDOR: 402582 ORIGIN: UNITED STATES										
US IMPORT HTS: 4011300010										

TOTAL

NOTES

If these commodities are exported from the United States, neither Textron Aviation nor any of its subsidiaries shall be listed as the US exporter of record.

***** Certificate of Compliance *****

Seller certifies that the item(s) on this order were manufactured and inspected in accordance with Textron Aviation Inc's FAA-approved Quality System. Where item(s) or service(s) have been procured from an approved supplier, the seller further confirms, attests, or certifies, or alternatively has on file, applicable supplier's certifications.

Cesscraft



Hawker

TEXTRON AVIATION

Sales Order

Sold-To Customer: Customer #50037
EXECUTIVE AIR, LLC.
2131 AIRPORT DRIVE
GREEN BAY, WI 54313

Ship-To Customer: EXECUTIVE AIR, LLC.
2131 AIRPORT DRIVE
GREEN BAY, WI 54313

parts.txtav.com

Order #: WB0000475610
Order Date: 11/14/2017
Purchase Order #: 20031
Currency: USD
Selected Shipping: Method: Ground
Priority: 4 Day
Carrier: Fed Ex
Payment: On Account

Line	Item	Qty	List Price	Disc. Price	Extd. Price
10	FEN118 GAS SPRING WICHITA	2 EA			
20	606C66-8 TIRE 6.00X6 6PLY FLCIII TT WICHITA	1 EA			
30	MS28775-269 O-RING WICHITA	1 EA			
40	302-246-400 TUBE G15/6.00X6 TR67/BENT 90 WICHITA	1 EA			
50	277K08-1 TIRE 22X7.75-10 10PLY RIB TL WICHITA	1 EA			

*Total does not include applicable taxes and shipping charges.

Order Note: N771XW
Ponderosa Aviation stock

Customer Support - Domestic
800.835.4000 parts@txtav.com

Customer Support - International
+1 316.517.5603 intparts@txtav.com

Date Printed: 11/20/2017 10:18 AM

Page 1 of 1

TOTAL HOURS / MINUTES



Shop Order: 12558

Opened: 11/16/2017
 Closed:

Sold To: Ponderosa Aviation LLC

✓

Aircraft Number: **N771XW** Type: **441** S/N: **441-0065**
 Total Time: 6,915.6 Hobbs Time: 39.0 Tach Time: LG Cycles: 6,951

Discrepancy: 1

Problem:

#2 left hand passenger seat won't recline.

Action Taken:

Removed seat from aircraft, disassembled, adjusted cable, ops test good, reinstalled seat.

Charges This Item:

1.00 Hours @

Total For This Discrepancy

Discrepancy: 2

Problem:

Static wick replacement per West Star squawk #20.

Action Taken:

Replaced.

Part Number	Description	Credit	Quantity	Units	Unit
DD1W	Static Discharger		1.00	Each	
			Total For This Discrepancy		

Discrepancy: 3

Problem:

Wing and tail deice boot conductive cement missing in areas.

Action Taken:

Cleaned, prepped and resealed wing and tail deice boots conductive cement.

Charges This Item:

1.00 Hours @

Total For This Discrepancy

Discrepancy: 4

Problem:

Clamps on right engine torn/worn.

Action Taken:

Replaced as necessary.

Charges This Item:

1.00 Hours @

Part Number	Description	Credit	Quantity	Units	Unit
MS21919WH8	Clamp		5.00	Each	
MS21919WH7	Clamp		1.00	Each	
			Total For This Discrepancy		

Discrepancy: 5

Problem:

Right engine cowl oil bypass door spring sprung. West Star squawk #66.

TOTAL HOURS / MINUTES

Action Taken:

Unsprung the sprung spring fast 3 times.

Charges This Item:

Discrepancy: 6

Problem:

Forward baggage doors extenders weak. West Star squawk #12.

Action Taken:

Replaced.

Charges This Item:

Part Number

Description

FEN118

Gas Spring

Credit

0.50 Hours @

Quantity Units

Unit

2.00 Each

Total For This Discrepancy

Discrepancy: 7

Problem:

Service nose strut.

Action Taken:

Serviced nitrogen.

Charges This Item:

0.25 Hours @

Total For This Discrepancy

Discrepancy: 8

Problem:

Removed engine cowls to verify cowl seals needed. Inspect squawks from West Star.

Action Taken:

Removed cowls, inspected squawks from West Star, ordered correct seals, reinstalled cowls.

Charges This Item:

2.00 Hours @

Total For This Discrepancy

Discrepancy: 9

Problem:

Order parts for customer stock.

Action Taken:

Ordered parts and placed into stock for N771XW.

Part Number	Description	Credit	Quantity	Units	Unit Price
606C66-8	600-6-6 Tire		1.00	Each	
MS28775-269	Packing		1.00	Each	
302-246-400	Tube G15/8.00x6		1.00	Each	
277K08-1	Tire		1.00	Each	

Total For This Discrepancy

Miscellaneous Charges:

Misc Supplies

Summary:

Total Parts: \$ [REDACTED] Misc Supplies: \$ [REDACTED]
 Total Labor - 6.25 Hours: \$ [REDACTED]

Totals:

SubTotal:

Total Charges:

Amount Remaining:

Terms: Interest of 1.5% will be charged on all invoices over 30 days old.

Payment Due Upon Receipt


Executive Air

Executive Air
2131 Airport Drive
Green Bay, WI 54313
Phone: 920-498-4880
Fax: 920-498-4890

Terms: Interest of 1.5% will be charged on all invoices over 30 days old.

Additional Freight Charges may be billed at a later date due to vendor invoicing.

[illegible]

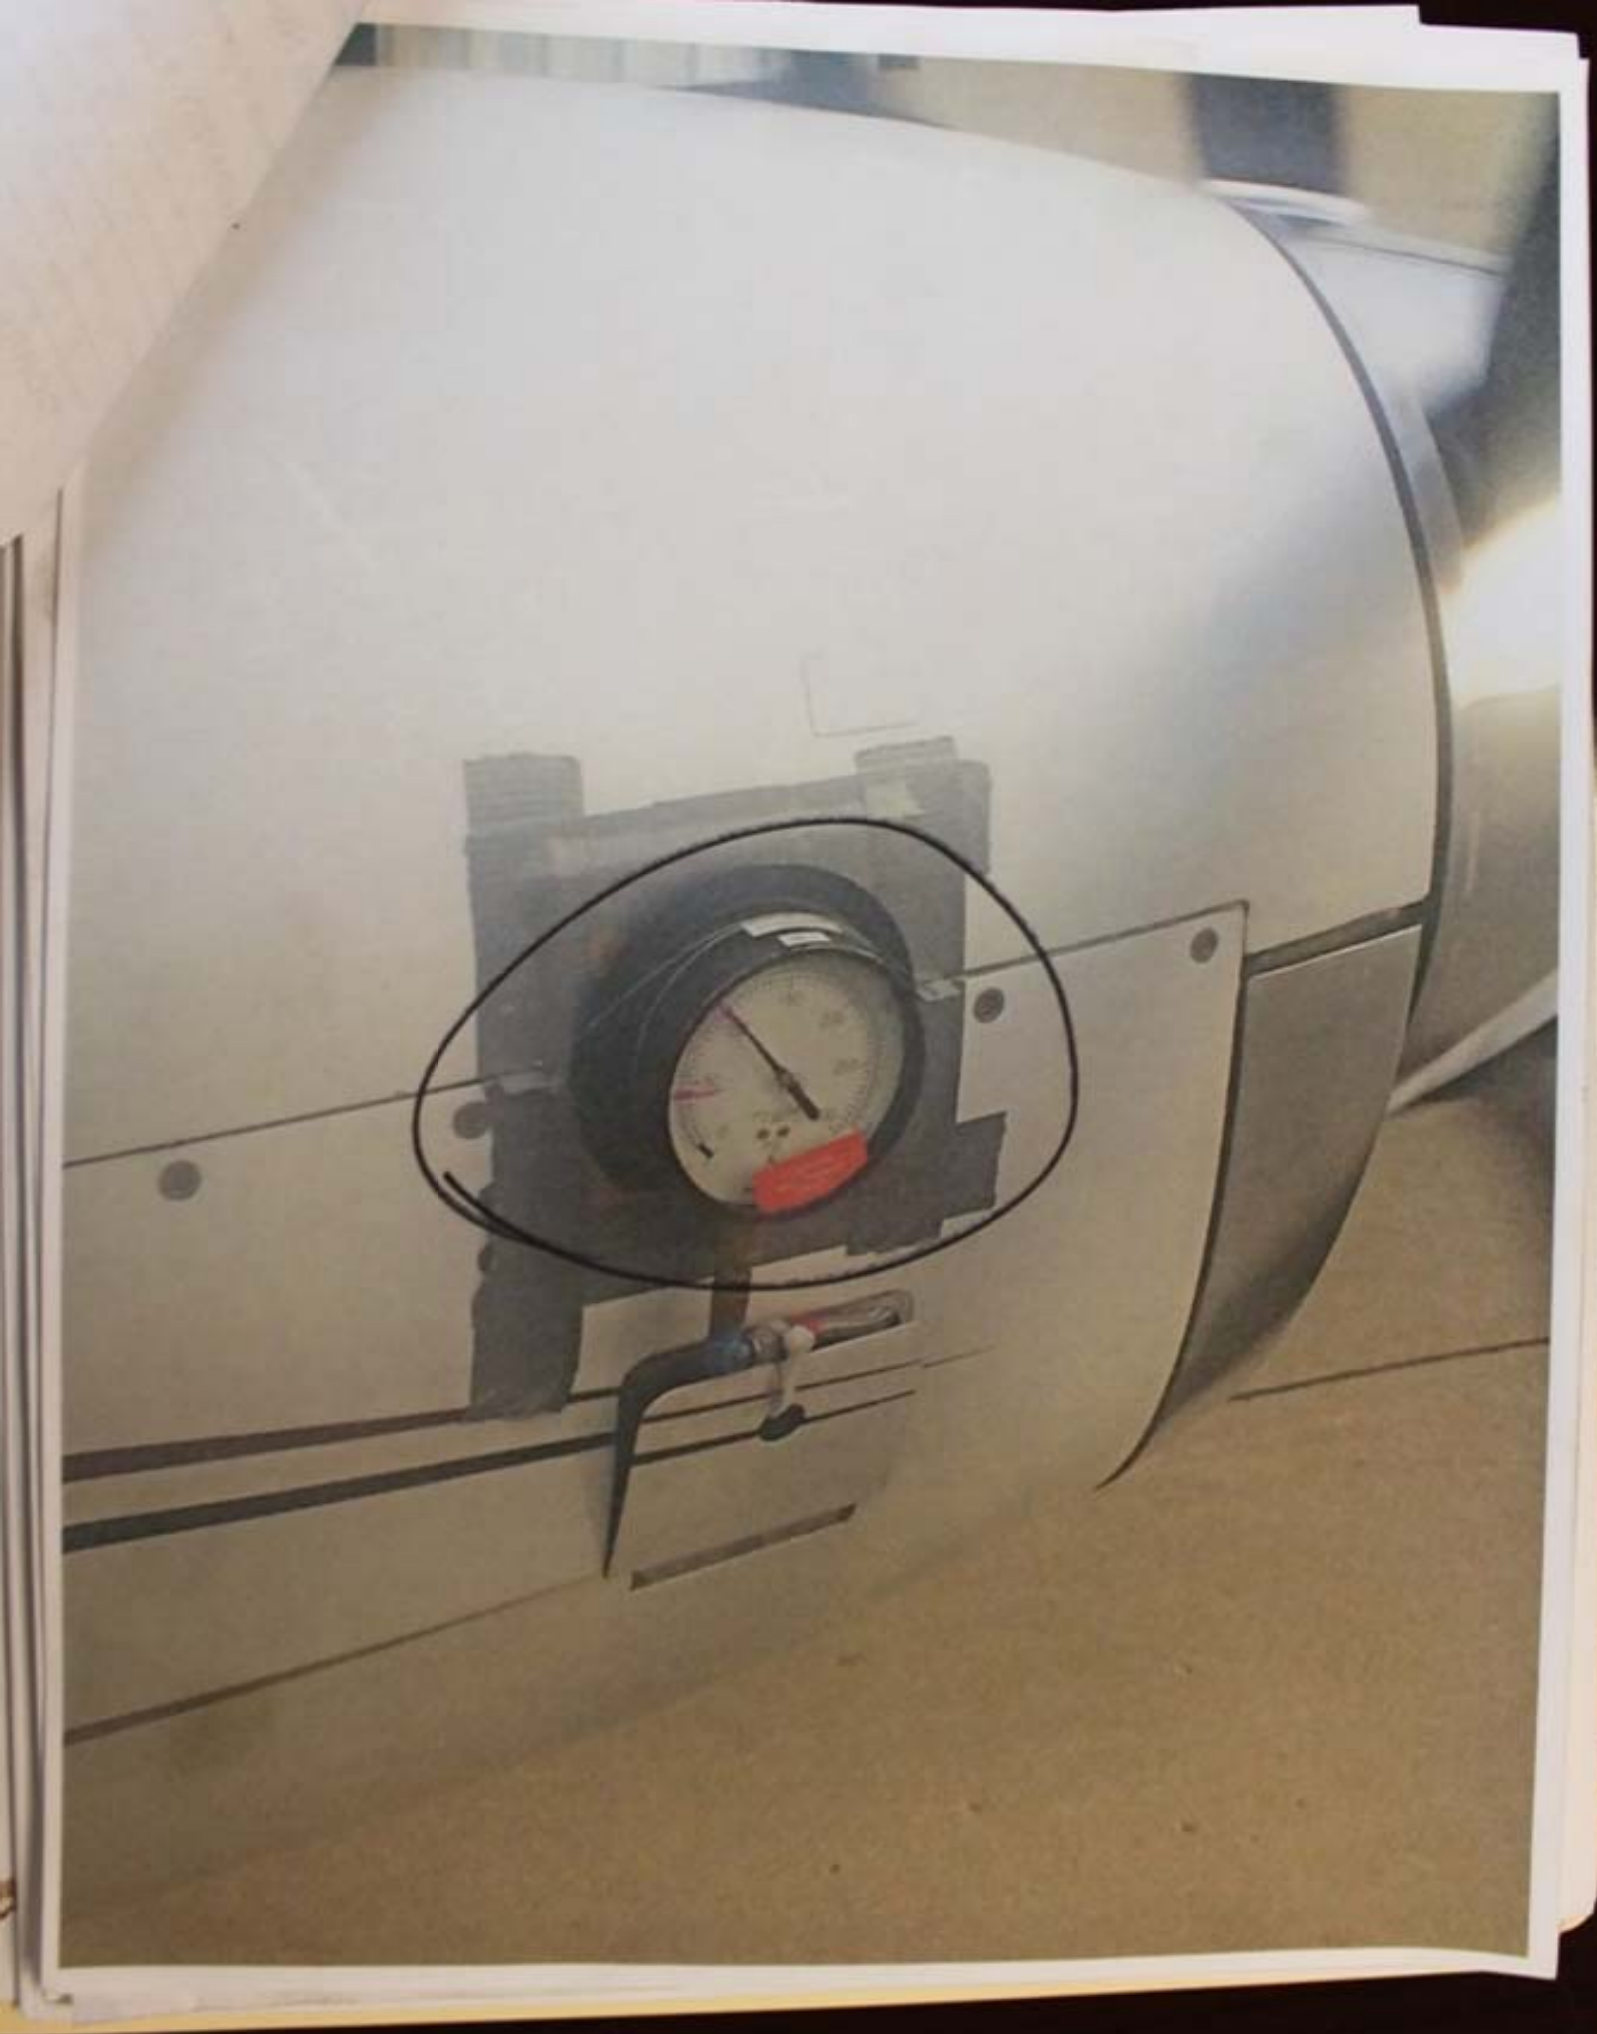



MODE SELECTOR

FD	IF	VR
HOG	NAV	NAV
ALT	GO	BC

EMER GEAR CONTROL

GEAR UNLOCKED

COM VLOC

GREEN IDENT VFR

0 1

GREEN IDENT ON ALT

NOSE

Executive Air
2131 Airport Drive
Green Bay, WI 54313
Phone: 920-498-4880
Fax 920-498-4890



Shop Order: 12566

Opened: 11/22/2017
Closed:

Sold To: Ponderosa Aviation LLC
N4893 County Rd C
Kewaunee, WI 54216 United States

Aircraft Number: N771XW Type:441 S/N: 441-0065

Discrepancy: 1

Problem:

Left engine indicating low oil pressure.

Action Taken:

Performed pressure calibration test on left indication system. Cleaned all connections, swapped left to right, installed raw gage into left oil system and performed engine runs to verify engine oil pressure within operational limits. Restored systems and performed leak check of both engines. Oil pressure transducers remain swapped for trouble shooting purposes.

Charges This Item:

4.50 Hours @

Part Number	Description	Credit	Quantity	Units	Unit Price	Extended
BP TURBO 2380	Oil		1.00	Quart		

Total For This Discrepancy: \$

Miscellaneous Charges:

Misc Supplies: \$

Summary:

Total Oil:	\$		Misc Supplies:	\$
Total Labor - 4.50 Hours:	\$			

Totals:

SubTotal:	\$
Sales Taxes:	\$
Total Charges:	\$
Amount Remaining:	\$

Terms: Interest of 1.5% will be charged on all invoices over 30 days old.

****Payment Due Upon Receipt****

Terms: Interest of 1.5% will be charged on all invoices over 30 days old.

Additional Freight Charges may be billed at a later date due to vendor invoicing.

W. Powderosa Aviation

Date 12/15/17

Shop Order Number 12585

N-Number 771XW

Please Advise on ☒ Hobbs 46.8 Tach ACTT 6923.3 LG Cycles 6955

DISCREPANCY # 1 Left Engine Oil Pressure Low

#2 INVESTIGATION

CORRECTIVE ACTION: Transposed ~~gauge~~ Cockpit Indicators
Swapped Engine Oil Pressure Regulator's, verified correct
P/W installed

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
2	99413-014	O/R		TS	12/15	1.5			
2	" 016	O/R		DC	12/15	.5			

TOTAL HOURS / MINUTES 2.0

DISCREPANCY # 2 LT MLG Actuator Leaking

CORRECTIVE ACTION: Removed P/W 9910136-3 P/W CE 1318
Installed P/W 9910136-3 P/W 8998
Time on part 15.8
Cycles on part 9

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
2	MS28778-6	O/R		TS	12/15	8.5			
				PF	12/15	2.0			

TOTAL HOURS / MINUTES 10.5

Page of

Executive Air Maintenance Department 2131 Airport Drive Green Bay, WI 54313 (920) 498-4880

Number _____

Date _____

N-Number _____

Please Advise on ☐ Hobbs _____

Tach _____

ACTT _____

LG Cycles _____

DISCREPANCY # _____

~~INSTALL NEW GPS ANTENNAS~~

CORRECTIVE ACTION:

~~Removal Sealant Liner - removal
Existing Antennas - INSTALLED P/N 013-00235-00 GASS
3/4 Left 140619 3/4 Right 140605
Pressure sealed antenna mounting Hardware~~

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
1	PR-1422 B-1/2	Proseal 602		TS					

TOTAL HOURS / MINUTES 9.5

DISCREPANCY # _____

Replace Engine Cool Seals

CORRECTIVE ACTION:

9/15 RT 5.0 Hr - removal cowls
removal old seal - replaced seal + reinstalled cowls

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
34	Cherry note	Rt Cool CR3243PR4-03		TS	9/15	5.0			
1	Seal B860019	7							
		Customer Stock							

TOTAL HOURS / MINUTES 5.0

Page _____ of _____

Executive Air Maintenance Department 2131 Airport Drive Green Bay, WI 54313 (920) 498-4880

Purchase Order/Tracking Number

ATTN Joe Carr	From:
West Star Aviation	Executive Air
796 Heritage Way	Austin Straubel Field
Grand Junction CO 81506	2131 Airport Drive
	Green Bay, WI 54313

Date: 12/6/17	Ship Via
Terms: Core - Warranty	Tracking Number:

Shipment To Be Received ☐ Core Return ☒ Overhaul/Repair ☐ Incorrect Part ☐

[illegible]**Comments:**

Core Return Shipping # [redacted] 12585

$$\frac{\pi \text{SOH}}{\text{CSOH}} = \frac{15.8}{9}$$

Thanks Joe!

If you have any questions, please contact: 1024

Phone # (920) 498-4880
Fax # (920) 498-4890

Thank You!

Executive Air

Purchase Order/Tracking Number

20041

From:	
Executive Air	
Austin Straubel Field	
2131 Airport Drive	
Green Bay, WI 54313	

Date: 11/17/17	Ship Via USPS
Terms: C/C	Tracking Number:

Shipment To Be Received ☒ Core Return ☐ Overhaul/Repair ☐ Incorrect Part ☐

Qty.	Part Number	Serial Number	Description	Acft. N-#	Weight
1	01-0268469	CO	Flasher Assembly	771XW	

Comments:
PAID w C/C Shop Mastercard
Powdermill Aviation N771XW

If you have any questions, please contact: T\$ Phone # (920) 498-4880
Fax # (920) 498-4890

Thank You!

PAID ON NCA Aviation

Invoice Number: 171626
Invoice Date: Dec 1, 2017
Page: 1

Invoice Number: 171626
Invoice Date: Dec 1, 2017
Page: 1

Sales Order Number: LM17-1373

WEST STAR AVIATION
2 AIRLINE COURT
EAST ALTON, IL 62024

EXECUTIVE AIR
2131 AIRPORT DRIVE
GREEN BAY, WI 54313

Customer ID	Customer PO	Payment Terms	
WESTST	POG17-19963/WARRANTY	Net 30 Days	
Sales Rep ID	Shipping Method	Ship Date	Due Date
	FED-EX P1	12/1/17	12/31/17

Order Qty	Item	Description	Shipped Prior	This Shipment	Corrections
1.00	9910136-3; OH	MLG ACTUATOR			
1.00	DEP-9910136-3	Core is due in 30 days to avoid a billing of [REDACTED]. Customer will be responsible for any above normal charges for the core repair.		1.00	

025
0400
STY CT
BAY WI 54304

FINISHMASTER
Automotive & Industrial Paint
INVOICE

Page Number 1 of 1
Print Time 12/01/17 11:34:00

76289103 (920) 498-4880
EXECUTIVE AIR
2131 AIRPORT DR.
GREEN BAY WI 54313

Ship To: 76289103 (920) 498-4880
EXECUTIVE AIR
2131 AIRPORT DR.
GREEN BAY WI 54313

Route #:
Stop #:

15771XW

Invoice	Invoice Date	Salesman	Counter Code	Tax Rate	Terms	Order #	Ship Via	PO#
78234640	12/01/17	875	66126	5.00 %	Charge	59658159		

H	Item Number	Description	Tax	Order	Ship	B/O	UOM	Unit Price
	IDE110	TOUCH UP BOTTLE EACH	Y	4	4		EA	
X	..XOMI-100-1Z	OMI-100 MISC MIX ROOM SALES 10	N	8	8		OZ	

Taxable Amount: 5.04
Non-Taxable Amount: 48.00

Total Invoice Amount

Thank you for your business

Signature _____

Chemical Emergency Contact - 1-800-535-5053				INFOTRAC 77821	
Hazardous Material Information		# Pks	Units	Weight	
UN1263, Paint, 3, II LTD QTY		8	OZ		
Non-Hazardous Material		4	-	.2400	
		Weight		.2400 LBS	

Have you visited our new ecommerce portal?

It has lots of new features. Check it out! shopfinishmaster.com

 
Need a Safety Data Sheet? Find it online! www.fmsds.com

____/____/____ PULLED PACKED DRIVER

Form of Payment

☐ Cash (M) ☐ Check (C) Check # _____ ☐ Credit Card (P) Last 4 digits of CC # _____

When you provide a check as payment, you authorize us either to use information from your check to make a one-time electronic fund transfer from your account or to process the payment as a check transaction. For inquiries please call 1-888-211-3678 ext. 2037.



N771XW
Cessna 441
Serial Number 441-0065

12/20/2017
Work Order # 12585

TT A/C: 6923.3 hr
6955 Landings

Swapped left and right engine oil pressure transducers. Engine ground run and leak check complete. Removed left leaking main landing gear actuator Part number 9910136-3 serial number CE 1318. Installed exchange part number 9910136-3 serial number 8998. Replaced right engine cowl seal Cessna part number R860019. Repaired belly beacon with flasher assembly repair kit Whelen part number 01-0268469

-END

I certify that the above stated maintenance and/or inspection was performed in accordance with the current Federal Aviation regulations. All inspections were performed in accordance with FAR 91.409 (f) (3) and the aircraft component identified above is presently airworthy and is approved for return to service.

AP 32 [REDACTED]

Textron Aviation Inc.
Textron Aviation Inc.
1 Cassia Blvd., Wichita, KS

Executive Air
2131 Airport Drive
Green Bay, WI 54313
Phone: 920-498-4880
Fax 920-498-4890

Shop Order: 12585

Opened: 12/06/2017
Closed:

Sold To: Ponderosa Aviation LLC
N4893 County Rd C
Kewaunee, WI 54216 United States

Aircraft Number: N771XW Type: 441
Total Time: 6,923.3 Hobbs Time: S/N: 441-0065
Discrepancy: 1 Tach Time: 46.8 LG Cycles: 6,955

Problem:

Left engine oil pressure low.

Action Taken:

Transposed cockpit indications. Swapped engine oil pressure regulations. Verified correct P/N installed.

Charges This Item:

Part Number	Description	Credit	Quantity	Units	Unit
S9413-014	O-Ring		2.00	Each	
S9413-016	Packing		2.00	Each	

Total For This Discrepancy

Discrepancy: 2

Problem:

LT MLG actuator leaking.

Action Taken:

Removed P/N 9910136-3 S/N CE1318. Installed P/N 9910136-3 S/N 8998. Time on part: 15.8. Cycles on part:

Charges This Item:

10.50 Hours @

Part Number	Description	Credit	Quantity	Units	Unit
MS28778-6	O-Ring		2.00	Each	

Total For This Discrepancy

Discrepancy: 3

Problem:

Replace engine cowl seals.

Action Taken:

Complied with RT 5.0 hour and removed cowls. Removed old seals, replaced seals, and reinstalled cowls.

Charges This Item:

5.00 Hours @

Part Number	Description	Credit	Quantity	Units	Unit
CR3243-4-02	Cherry Rivets		34.00	Each	

Total For This Discrepancy

Discrepancy: 4

Problem:

Developed touch up paint kit.

Action Taken:

Complied with development of touch up paint kit.

Charges This Item:

1.00 Hours @

Printed: 12/20/2017 2:19 PM

Shop Order: 12585

2131 Airport Drive
Green Bay, WI 54313
Phone: 920-498-4880
Fax 920-498-4890

Item Number	Description	Credit	Quantity	Units	Unit Price	Extended
PAINT KIT	Paint Kit		1.00	Each		
Total For This Discrepancy: \$						

Discrepancy: 5
Problem:

Problem:

Action Taken:

Charges This Item:

Part Number	Description	Credit	Quantity	Units	Unit
01-0268469-00	Flasher Assembly Repair Kit		1.00	Each	

Total For This Discrepancy

Misc Sup

Total Freight:

Total Labor - 20.50 Hours

SubTotal:

Total Charges:

Amount Remaining:

****Payment Due Upon Receipt****

Additional Freight Charges may be billed at a later date due to vendor invoicing.

TOTAL HOURS / MINUTES

Green Bay, WI 54313 (920) 498-4880

Executive Air Maintenance Department 2131 Airport Drive Green Bay, WI 54313 (920) 498-4880

Davidson, A. J. H.



2131 Airport Drive • Green Bay, Wisconsin 54313
920.498.4880 • www.executiveair.com

N771XW
Cessna 441
Serial Number 441-0065

12/20/2017
Work Order # 12956

TT A/C: 6923.3 hr
6955 Landings

GPS WAAS Upgrade.

Replaced Garmin GA56 GPS antennas with new GA35 antennas part number 013-00235-00 serial numbers 140619 and 140605. Installed Garmin GNS 530W part number 011-01064-40 serial number 78410041 and part number 011-01066-40 serial number 46350252. Installation done IAW Garmin STC upgrade manual part number 190-00357-06 Rev. E and STC no. SA01933LA. See FAA form 337 dated 12/20/2017. FAA approved Airplane Flight Manual Supplement part number 190-00357-03 Rev. F and Instructions for Continued Airworthiness (ICA) document number 190-00357-65 Rev. D. Updated W&B.

-----END-----

I certify that the above stated maintenance and/or inspection was performed in accordance with the current Federal Aviation regulations. All inspections were performed in accordance with FAR 91.409 (d) (3) and the aircraft component identified above is presently airworthy and is approved for return to service.

Philip J Fischer Repairman # [REDACTED]
For Executive Air CR [REDACTED]

MAJOR REPAIR AND ALTERATION (Airframe, Powerplant, Propeller, or Appliance)

 
INSTRUCTIONS: Print or type all entries. See Title 14 CFR §43.9, Part 43 Appendix B, and AC 43.9-1 (or subsequent revision thereof) for instructions and disposition of this form. This report is required by law (49 U.S.C. §44701). Failure to report can result in a civil penalty for each such violation. (49 U.S.C. §46301(a))

1. Aircraft	Nationality and Registration Mark N771XW	Serial No. 441-0065
	Make CESSNA	Model 441 Series
2. Owner	Name (As shown on registration certificate) PONDEROSA AVIATION LLC	Address (As shown on registration certificate) N4893 COUNTY ROAD C
		City KEWAUNEE State WI Zip 54218 Country USA
3. For FAA Use Only		

4. Type		5. Unit Identification			
Repair	Alteration	Unit	Make	Model	Serial No.
☐	☒	AIRFRAME		(As described in Item 1 above)	
☐	☐	POWERPLANT			
☐	☐	PROPELLER			
☐	☐	APPLIANCE	Type Manufacturer		


6. Conformity Statement	
A. Agency's Name and Address	B. Kind of Agency
Name EXECUTIVE AIR	☐ U. S. Certified Mechanic
Address 2131 AIRPORT DRIVE	☐ Foreign Certified Mechanic
City GREEN BAY State WI	☒ Certified Repair Station
Zip 54313 Country USA	☐ Certified Maintenance Organization

D. I certify that the repair and/or alteration made to the unit(s) identified in Item 5 above and described on the reverse or attachments hereto have been made in accordance with the requirements of Part 43 of the U.S. Federal Aviation Regulations and that the information furnished herein is true and correct to the best of my knowledge.

Extended range fuel per 14 CFR Part 43 App. B ☐	Signature/Date of Authorized Individual  12/20/2017
--	--

7. Approval for Return to Service
Pursuant to the authority given persons specified below, the unit identified in Item 5 was inspected in the manner prescribed by the Administrator of the Federal Aviation Administration and is ☒ Approved ☐ Rejected

BY	FAA FR. Standards Inspector	Manufacturer	Maintenance Organization	Persons Approved by Canadian Department of Transport
	FAA Designee	☒ Repair Station	Inspection Authorization	Other (Specify)

 Certificate or Designation No. 3787113	Signature/Date of Authorized Individual  12/20/2017
--	--

DANDON R. A. A. i. - h. m.

N771XW CESSNA 441 S/N 441-0065 December 20, 2017

Validated that the previous installation of one GNS 530 and one GNS 530A was installed IAW Garmin instructions and approved via an FAA- stamped field approval document on FAA form 337 dated 4/14/2004. Verified this aircraft and all interfaced equipment are covered under the STC AML. Both units were removed and upgraded to GNS 530W units. The existing locations of the two units were determined to meet the field of view requirements without the need for external annunciation. The existing RG-400 GPS antenna cable was used. The two existing GA56 antennas were removed and replaced with two GA35 antennas using approved mounting provisions of the previous installation.

1. Removed two Garmin GA56 Antennas P/N 011-00134-00 and installed two new GA35 GPS/WAAS antennas P/N 013-00235-00, S/Ns 140619 and 140605 using the provisions left behind from the standard antenna IAW Garmin upgrade manual P/N 190-00357-06 Rev. E and STC no. SA01933LA.
2. Removed Garmin GNS 530 P/N 011-00550-10 S/N 78410041 unit and installed Garmin GNS 530W P/N 011-01064-40 S/N 78410041, using provision left behind from the standard 530 unit. Installation done IAW Garmin upgrade installation manual P/N 190-00357-06 Rev. E and STC no. SA01933LA.
3. The GNS 530W was configured identical to the original 530 unit. each interface was checked out IAW the 530W installation manual P/N 190-00357-02 section 5. A copy of the check out log was completed and included in the aircraft logs.
4. Removed Garmin GNS 530A P/N 011-00835-00 S/N 46350252 unit and installed Garmin GNS 530W P/N 011-01064-40 S/N 46350252, using provision left behind from the standard 530 unit. Installation done IAW Garmin upgrade installation manual P/N 190-00357-06 Rev. E and STC no. SA01933LA.
5. The two GNS 530W were configured identical to the original 530 units. each interface was checked out IAW the 530W installation manual P/N 190-00357-02 section 5. A copy of the check out log was completed and included in the aircraft logs.
6. Removed the Aircraft Flight Manual supplement for the GNS 530s and installed GNS 530W AMFS P/N 190-00357-03 Rev. F. FAA approved date 11/30/2017 into the Aircraft Flight Manual.
7. Updated aircraft Equipment list and weight and Balance to reflect the new WAAS units. The current electrical load analysis remains valid since the new units draw the same or less current then the original units.

Instructions for Continued Airworthiness (ICA)

1. GNS 530W - Included Garmin document P/N 190-00357-65 Rev. D instructions for Continued Airworthiness in the aircraft maintenance records.

End

Executive Air

FAA CRS E88R142C

2131 Airport Dr

GB, WI 54313

920-498-4880

Part 91: XPart 135: (*)

*Obtain Maint./Inspec. requirements from Operator

Shop Order: 12596

Opened: 12/19/2017

Closed: 12/21/2017

Sold To: Ponderosa Aviation LLC
N4893 County Rd C
Kewaunee, WI 54216 United States

Aircraft Number:	N771XW	Type:	441	S/N:	441-0065
Total Time:	6,923.3	Hobbs Time:		Tach Time:	
				LG Cycles:	6,955

Discrepancy: 1**Problem:**

GPS WAAS Upgrade.

Action Taken:

Replaced Garmin GA56 GPS antennas with new GA35 antennas part number 013-00235-00 serial numbers 140619 and 140605. Installed Garmin GNS 530W part number 011-01064-40 serial number 78410041 and part number 011-01066-40 serial number 46350252. Installation done IAW Garmin STC upgrade manual part number 190-00357-06 Rev. E and STC no. SA01933LA. See FAA form 337 dated 12/20/2017, FAA approved Airplane Flight Manual Supplement part number 190-00357-03 Rev. F and Instructions for Continued Airworthiness (ICA) document number 190-00357-65 Rev. D. Updated W&B.

Charges This Item:

Flat-Fee Labor: \$

Total For This Discrepancy: \$

Miscellaneous Charges:

Misc Supplies: \$

Summary:

Misc Supplies: \$ Total Flat-Rate Labor: \$

Totals:

SubTotal: \$

Total Charges: \$

INSPECTION RESULTSPreliminary By: PfzHidden Damage By: PfzIn-Progress By: PfzFinal Inspection By: [Redacted]Record of Mfg. Maint. Or Insp. Attached: PfzShop Order Reviewed By: Pfz

The aircraft and/or component identified herein has been repaired and/or inspected in accordance with current Federal Aviation Regulations and is approved for return to service.

Signature [Redacted]Repairman Cert #: [Redacted]

Aircraft Weight and Balance Revision

tail Number: **N771XW**

Date: 12/20/2017

Prepared by: Executive Air
2131 Airport Drive
Green Bay, WI 54313

Work Order No: 12956

Type Certificate
Data No: A28CE

Aircraft Make:
Cessna

Model:
441

Serial No:
441-0065

Time:
6923.3

Registered Owner:
Ponderosa Aviation LLC

Address:
N4893 County Road C
Kewaunee, WI 54216

Maximum Weight 9850

CG Range FWD 173.07 AFT 178.08

As Received; Date of Previous Weight and Balance:
6/3/2013

Useful Load:
3149

EW:
6701

EWCG:
174.3

Moment:
1170171.9

Notes: Weight and Balance to reflect GPS WAAS upgrade.

	Weight	Arm	Moment
Removed Garmin GNS 530 P/N 011-00550-00	-6.6	112.00	-739.20
Removed Garmin GNS 530A P/N 011-00835-00	-6.6	112.00	-739.20
Removed Garmin GA56 GPS Antenna P/N 011-00134-00	-.3	266.85	-80.06
Removed Garmin GA56 GPS Antenna P/N 011-00134-00	-.3	266.85	-80.06
	0.00	0.00	0.00
Installed Garmin GNS 530W P/N 011-01064-40	6.6	112.00	739.20
Installed Garmin GNS 530W P/N 011-01066-40	6.6	112.00	739.20
Installed Garmin GA35 GPS Antenna P/N 013-00235-00	.3	266.85	80.06
Installed Garmin GA35 GPS Antenna P/N 013-00235-00	.3	266.85	80.06
	0.00	0.00	0.00

☒ As Calculated

Moment 1170171.90

☐ As Weighed

Weight 6701.00

New Empty Weight CG

174.63

New Useful Load

3149.00

Signature Philip J Fischer

Repair Agency
or License No: Repairman

1. Approving Civil Aviation Authority/Country: FAA/UNITED STATES		2. AUTHORIZED RELEASE CERTIFICATE FAA Form 8130-3, AIRWORTHINESS APPROVAL TAG			3. Form Tracking Number: RMA 99851031	
4. Organization Name and Address: GARMIN International 1200 E 151st Olathe, KS 66062				Certificate No. G6XR582Y		
6. Item: 1.	7. Description: GNS530W,Bk,Upd	8. Part Number: 011-01064-40	9. Quantity: 1	10. Serial Number: 78410041	11. Status/Work: MODIFIED	

12. REMARKS: Confirmed the return issue. Upgraded unit to include WAAS capability. Confirmed all applicable hardware modifications are installed. Updated software to the latest version. Aligned unit for optimum performance. Master cleared unit. Unit passes all tests and is operating within normal limits. Unit acquired satellites. OK to return to Service.

The Main and GPS Softwares are at the latest revision. This unit complies with this Service Bulletin 1317. It is the responsibility of the Installer to verify that the installation complies with the previous listed Service Bulletins. The following Mod's were installed into this unit under its previous configuration prior to it being upgraded and configuration changed to part number 011-01064-40.

This unit complies with MOD 1 per Garmin's Service Bulletin No. 0019.
This unit complies with MOD 2 per Garmin's Service Bulletin No. 0101.
This unit complies with MOD 3 per Garmin's Service Bulletin No. 0111.
This unit complies with MOD 4 per Garmin's Service Bulletin No. 0203B.
This unit complies with MOD 5 per Garmin's Service Bulletin No. 0207.
This unit complies with MOD 6 per Garmin's Service Bulletin No. 0211.

The work that was performed on this unit was done to meet the requirements of all sections of the maintenance manual part number 190-00364-00 Rev- AR, Revision Date 2/22/2017.

Thank You for Choosing Garmin! If you have any questions or concerns please do not hesitate to contact our customer service department at 1-800-800-1020. Please view Garmin's web site at www.garmin.com for any update or product information.

13a. Certifies the items identified above were manufactured in conformity to:

- ☐ Approved design data and are in condition for safe operation
☐ Non-approved design data specified in block 12

N / A

14a. ☒ 14 CFR 43.9 Return to Service

☐ Other regulations specified in Block 12

Certifies that unless otherwise specified in block 12, the work identified in Block 11 and described in Block 12 was accomplished in accordance with Title 14, Code of Federal Regulations, part 43 and in respect to that work, the items are approved for return to service.

13b. Authorized Signature

N / A

13c. Approval/Authorization No.:

N / A

14b. Authorized Signature

14c. Approval/Certificate No.:

13d. Name (Typed or Printed)

N / A

13e. Date (dd/mm/yyyy)

N / A

14d. Name (Typed or Printed)

Paul E Brand

14e. Date (dd/mm/yyyy)

12 Dec 2017

User/Installer Responsibilities

It is important to understand that the existence of this document alone does not automatically constitute authority to install the aircraft engine/propeller/article.

Where the user/installer performs work in accordance with the national regulations of an airworthiness authority different than the airworthiness authority of the country specified in block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts aircraft engine(s)/propeller(s)/article(s) from the Airworthiness Authority of the country specified in block 1.

Statements in Block 13a and 14a do not constitute installation certification. In all cases, aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.

1. Approving Civil Aviation Authority/Country: FAA/UNITED STATES		2. AUTHORIZED RELEASE CERTIFICATE FAA Form 8130-3, AIRWORTHINESS APPROVAL TAG			3. Form Tracking Number: RMA 99851031	
4. Organization Name and Address: GARMIN International 1200 E 151st Olathe, KS 66062				Certificate No. G6XR582Y		
6. Item:	7. Description:	8. Part Number:	9. Quantity:	10. Serial Number:	11. Status/Work:	
1.	GNS530AW,Blk Upgd	011-01066-40	1	46350252	MODIFIED	

12. REMARKS: Confirmed the return issue. Upgraded unit to include WAAS capability. Confirmed all applicable hardware modifications are installed. Updated software to the latest version. Aligned unit for optimum performance. Master cleared unit. Unit passes all tests and is operating within normal limits. Unit acquired satellites. OK to return to Service.

The Main and GPS Softwares are at the latest revision. This unit complies with this Service Bulletin 1317. It is the responsibility of the Installer to verify that the installation complies with the previous listed Service Bulletin. The following Mod's were installed into this unit under its previous configuration prior to it being upgraded and configuration changed to part number 011-01066-40.

The work that was performed on this unit was done to meet the requirements of all sections of the maintenance manual part number 190-00364-00 Rev- AR, Revision Date 2/22/2017.

Thank You for Choosing Garmin! If you have any questions or concerns please do not hesitate to contact our customer service department at 1-800-800-1020. Please view Garmin's web site at www.garmin.com for any update or product information.

13a. Certifies the items identified above were manufactured in conformity to:		14a. ☒ 14 CFR 43.9 Return to Service ☐ Other regulations specified in Block 12	
☐ Approved design data and are in condition for safe operation ☐ Non-approved design data specified in block 12		Certifies that unless otherwise specified in block 12, the work identified in Block 11 and described in Block 12 was accomplished in accordance with Title 14, Code of Federal Regulations, part 43 and in respect to that work, the items are approved for return to service.	
13b. Authorized Signature	13c. Approval/Authorization No.:	14b. Authorized Signature:	14c. Approval/Certificate No.:
N / A	N / A	[Redacted]	[Redacted]
13d. Name (Typed or Printed)	13e. Date (dd/mm/yyyy)	14d. Name (Typed or Printed)	14e. Date (dd/mm/yyyy)
N / A	N / A	Tim Knutson	13 Dec 2017

User/Installer Responsibilities

It is important to understand that the existence of this document alone does not automatically constitute authority to install the aircraft engine/propeller/article.

Where the user/installer performs work in accordance with the national regulations of an airworthiness authority different than the airworthiness authority of the country specified in block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts aircraft engine(s)/propeller(s)/article(s) from the Airworthiness Authority of the country specified in block 1.

Signatures in Block 13a and 14a do not constitute installation certification. In all cases, aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.

Name Pandora Aviation

Date 1/15/18

Shop Order Number 12632

N-Number D771XW

Please Advise on ☐ Hobbs ☐ Tach ☐ ACTT ☐ LG Cycles ☐

DISCREPANCY # 1 Coffee Pot Leaks

CORRECTIVE ACTION: A Challenge to find replacement
parts - opted to replace

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
1	10664-1	Spigot		VS	1/15	1.0			
	PO 20119	J							
	Parts returned to customer								
	# [REDACTED]								

DISCREPANCY # _____

CORRECTIVE ACTION: _____

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
				TOTAL HOURS / MINUTES					

Page _____ of _____

20119

From:

West Smr

Executive Air

Austin Straubel Field

2131 Airport Drive

Green Bay, WI 54313

Date: 1/11/16

Ship Via

Terms: ACCOUNT

Tracking Number:

Shipment To Be Received ☐

Core Return

Overhaul/Repair ☐Incorrect Part ☐Comments:

Fax # (920) 498-4890

Thank You!

Date 1-26-18

11771XW

Executive Air2131 Airport Drive
Green Bay, WI 54313
Phone: 920-498-4880
Fax 920-498-4890

Shop Order: 12632

Opened: 1/15/2018
Closed:

Sold To: Ponderosa Aviation LLC
N4893 County Rd C
Kewaunee, WI 54216 United States

Aircraft Number: N771XW Type: 441 S/N: 441-0065

Discrepancy: 1**Problem:**

Coffee pot leaks.

Action Taken:

A challenge to find replacement. Parts opted to replace.

Charges This Item:

1.00 Hours @

Part Number	Description	Credit	Quantity	Units	U
10664-1	Spigot		1.00	Each	
Total For This Disc					

Miscellaneous Charges:

Misc

Summary:

Total Parts:	\$		Total Freight:
Misc Supplies:	\$		Total Labor - 1.00 Hours:

Totals:**SubTotal:****Total Charges:****Amount Remaining:**

Terms: Interest of 1.5% will be charged on all invoices over 30 days old.

****Payment Due Upon Receipt****

Terms: Interest of 1.5% will be charged on all invoices over 30 days old.

Additional Freight Charges may be billed at a later date due to vendor invoicing.

Executive Air
2131 Airport Drive
Green Bay, WI 54313
Phone: 920-498-4880
Fax 920-498-4890



Shop Order: 12641

Opened: 1/26/2018
Closed:

Handwritten initials

Sold To: WAK Aviations LLC
2677 Dutchman Road
Green Bay, WI 54311

Aircraft Number:		N369WK	Type: Cessna 441		S/N: 0012	
Eng#	Type	S/N	Time	Cycles	Prop Type	Prop S/N
1						

Discrepancy: 1

Problem:

Order SOAP Kits for stock.

Action Taken:

Complied with.

Part Number	Description	Credit	Quantity	Units	Unit Price	Extended
831043-3	SOAP Kit		2.00	Each		

Total For This Discrepancy: \$

Miscellaneous Charges:

Misc Supplies: \$

Summary:

Total Parts: \$ Misc Supplies: \$

Totals:

SubTotal:	\$
Total Charges:	\$
Amount Remaining:	\$

Terms: Interest of 1.5% will be charged on all invoices over 30 days old.

****Payment Due Upon Receipt****

Terms: Interest of 1.5% will be charged on all invoices over 30 days old.

Additional Freight Charges may be billed at a later date due to vendor invoicing.

Name Pandora AviationShop Order Number 12636Date 2/1/18N-Number N771XWPlease Advise on ☐ Hobbs ☐ Tach ☐ ACTT 6952 DG Cycles 6968DISCREPANCY # 1Fuel Leak Rt Wing

CORRECTIVE ACTION: Found 4 Leaking Areas - Defueled
resealed 1 forward panel wing 1 2 nutplates holding engine
Cowl, boost pump panel assb - & Sealed all Areas
fuelled Rt Wing - Leak ck OK -

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
1	5722315-15	Seal		TS	1/30	9			
1	5722315-16	Seal		TS	1/31	4			
1	PR1422 B 1/2	PRO Seal KIT							
4	CR3243PR-4-03	Rivet							

TOTAL HOURS / MINUTES 13.0DISCREPANCY # 2replace Cowl Seal - LT Eng

CORRECTIVE ACTION:

C/W - remove cowls - R&R seal
Seals purchased prior

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
41	CR3243PR-4-03	Rivet		TS	2/2	4.0			

TOTAL HOURS / MINUTES 4.0Page 1 of 1

Executive Air Maintenance Department 2131 Airport Drive Green Bay, WI 54313 (920) 498-4880

Executive Air Maintenance Department 2131 Airport Drive Green Bay, WI 54313 (920) 498-4880

九

Packing Sheet

Textron



Textron

www.textron.com

PACKING SHEET NO. 2983169	MANUFACTURED BY FED-G	UNIT PRICE PP	QUANTITY SP	TRANS N30	Texttron Aviation Inc. PACKING SHEET DATE Jan/29/2018
EXECUTIVE AIR, LLC 2131 AIRPORT DRIVE GREEN BAY WI 54313 UNITED STATES					

NOTES

Web Order Number: WB0000516618
N771XW

SALES ORDER NUMBER: 5897703
PACKING SHEET NUMBERS: 2983169

CUSTOMER P.O. NUMBER: 20147

LINE NUMBER	QTY ORDERED	QTY BULK ORDERED	UOM	PART NUMBER	DESCRIPTION	AVIATION NUMBER	UNIT PRICE	QTY ORDERED	UNIT PRICE	QTY ORDERED
10	1	0	EA	C2000-1	SNUBBER			1		
REPAIR PROCEDURE SNL87-20										
ECCN: 9A991 EXPORT HTS CODE: 8803300030										
VENDOR: 220661 ORIGIN: UNITED STATES										
US IMPORT HTS: 8803300030										

TOTAL

NOTES

If these commodities are exported from the United States, neither Textron Aviation nor any of its subsidiaries shall be listed as the US exporter of record.

***** Certificate of Compliance *****

Seller certifies that the item(s) on this order were manufactured and inspected in accordance with Textron Aviation Inc's FAA-approved Quality System. Where item(s) or service(s) have been procured from an approved supplier, the seller further confirms, attests, or certifies, or alternatively has on file, applicable supplier's certifications.

Executive Air

Purchase Order/Tracking Number

20147

To:	From:
Textron	Executive Air
	Austin Straubel Field
	2131 Airport Drive
	Green Bay, WI 54313

Date: 1/29/18	Ship Via
Terms: ACCOUNT	Tracking Number:

Shipment To Be Received ☐ Core Return ☐ Overhaul/Repair ☐ Incorrect Part ☐

Qty.	Part Number	Serial Number	Description	Acft. N-#	Weight
1	C2000-1		Snubber	771XW	

Comments:

If you have any questions, please contact: Tex

Phone # (920) 498-4880
Fax # (920) 498-4890

Thank You!

Beechcraft



Hawker

TEXTRON AVIATION

Sales Order

parts.txtav.com

Sold-To Customer: Customer #50037
EXECUTIVE AIR, LLC.
2131 AIRPORT DRIVE
GREEN BAY, WI 54313

Ship-To Customer: EXECUTIVE AIR, LLC.
2131 AIRPORT DRIVE
GREEN BAY, WI 54313

Order #: WB00000516618
Order Date: 1/29/2018
Purchase Order #: 20147
Currency: USD
Selected Shipping: Method: Ground
Priority: 4 Day
Carrier: Fed Ex
Payment: On Account

Line	Item	Qty	List Price	Disc. Price	Extd. Price
10	C2000-1 SNUBBER Wichita - WEST	1 EA		\$707.25	

\$ USD Order Total*:

*Total does not include applicable taxes and shipping charges.

Order Note: N771XW

Customer Support - Domestic
800.835.4000 parts@txtav.com

Customer Support - International
+1.218.517.5503 intparts@txtav.com

Date Printed: 1/29/2018 10:23 AM

Page 1 of 1

File

✓\$

Executive Air

2131 Airport Drive
Green Bay, WI 54313
Phone: 920-498-4880
Fax 920-498-4890



Shop Order: 12636

Opened: 1/24/2018
Closed:



Sold To: Ponderosa Aviation LLC
N4893 County Rd C
Kewaunee, WI 54216 United States

Aircraft Number:	N771XW	Type:	441	S/N:	441-0065
-------------------------	---------------	--------------	------------	-------------	-----------------

Discrepancy: 1

Problem:

Fuel leak right wing.

Action Taken:

Found four leaking areas and defueled. Resealed one forward panel wing, two nutplates holding engine cowl, boost pump panel assembly. Sealed all areas. Fueled right wing. Leak check ok.

Charges This Item:

13.00 Hours @

Part Number	Description	Credit	Quantity	Units
5722315-15	Seal		1.00	Each
5722315-16	Seal		1.00	Each
PR1422B1/2-6OZ	Sealant, Courtualds		1.00	Each
			Total For This D	

Discrepancy: 2

Problem:

Replace cowl seal left engine.

Action Taken:

Complied with. Removed cowls. Removed and replaced seals.

Charges This Item:

4.00 Hours @

Part Number	Description	Credit	Quantity	Units
CR3243-4-03	Rivet		41.00	Each
			Total For This D	

Discrepancy: 3

Problem:

Door snubber (cabin).

Action Taken:

Removed damaged unit and reinstalled new.

Charges This Item:

0.50 Hours @

Part Number	Description	Credit	Quantity	Units
C2000-1	Snubber		1.00	Each
			Total For This D	

Miscellaneous Charges:

Misc

Summary:

Total Parts: \$
Total Labor - 17.50 Hours: \$

Misc Supplies:

Totals:

Printed: 2/05/2018 9:02 AM

Shop Order: 12636

Executive Air

2131 Airport Drive
Green Bay, WI 54313
Phone: 920-498-4880
Fax 920-498-4890

SubTotal:

Total Charges:

Amount Remaining:

\$

\$

\$

Terms: Interest of 1.5% will be charged on all invoices over 30 days old.
Payment Due Upon Receipt

Terms: Interest of 1.5% will be charged on all invoices over 30 days old.

Additional Freight Charges may be billed at a later date due to vendor invoicing.

Ponderosa Aviation

Name _____

Date _____

Shop Order Number _____

N-Number _____

Please Advise on ☐ Hobbs _____ Tach _____ ACTT _____ LG Cycles _____DISCREPANCY # 3For Pilots HSI INOP

CORRECTIVE ACTION:

Part on orderP/N ~~IG-895A~~ P/N 44680-0000

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
1	44680-0000	HSI							
	PO 20178								
	+ Insured shipping								

TOTAL HOURS / MINUTES

DISCREPANCY # _____

CORRECTIVE ACTION:

Removed left HSI part number 52D137-2331
Serial number 707 B. Installed mid-Continent overhauled
exchange HSI part number 52D137-2331 Serial number 1-554B
Ground run and Compass calibration check complete IAW
Century HSI installation heading Compensation instructions.

Quantity	Part Number	Description	Price	Initials	Date	Hr/Min	Initials	Date	Hr/Min
				PF		5.0			
				TS					

TOTAL HOURS / MINUTES



2131 Airport Drive • Green Bay, Wisconsin 54313
920.498.4880 • www.executiveair.com

N771XW
Cessna 441
Serial Number 441-0065

2/19/2018
Work Order # 12666

TT A/C: 6972.7 hr
6977 Landings

Removed left HSI part number 52D137-2331 serial number 707B. Installed Mid-Continent overhauled Exchange HSI part number 52D137-2331 serial number 1-554B. Ground run and compass calibration check complete IAW Century HSI installation & heading compensation instructions.

END- [REDACTED] A+P [REDACTED]

I certify that the above stated maintenance and/or inspection was performed in accordance with the current Federal Aviation regulations. All inspections were performed in accordance with FAR 91.409 (f) (3) and the aircraft component identified above is presently airworthy and is approved for return to service.

1. Approving Civil Aviation Authority/Country: FAA/United States		2. AUTHORIZED RELEASE CERTIFICATE FAA Form 8130-3, AIRWORTHINESS APPROVAL TAG			3. Form Tracking Number: 000322908	
4. Organization Name and Address:  9400 E. 34th Street N. Wichita KS 67226 FAA CRS OL2R061L					5. Work Order/Contract/Invoice Number: 000322908	
6. Item:	7. Description:	8. Part number:	9. Quantity:	10. Serial number:	11. Status/Work:	
1	Navigation Situation Display	52D137-2331 IG-895A	1	1-554B	Overhauled	
12. Remarks: THE WORK ORDER REFERENCED DESCRIBES THE ACTUAL WORK PERFORMED. ALL WORK WAS PERFORMED REF. MANUAL # 68S304 / 2 / 1 Dec 1996						
13a. Certifies the items identified above were manufactured in conformity to: ☐ Approved design data and are in a condition for safe operation. ☐ Non-approved design data specified in Block 12.			14a. ☒ 14 CFR 43.9 Return to service ☐ Other regulation specified in Block 12 Certifies that unless otherwise specified in Block 12, the work identified in Block 11 and described in Block 12 was accomplished in accordance with Title 14, Code of Federal Regulations, Part 43 and in respect to that work, the items are approved for return to service.			
13b. Authorized signature:		13c. Approval/Authorization No.:		14b. Authorized signature:		14c. Approval/Certificate No.:
				[Redacted Signature]		FAA CRS [Redacted]
13d. Name (Type or Printed):		13e. Date (dd/mm/yyyy):		14d. Name (Type or Printed):		14e. Date (dd/mm/yyyy):
				Nick Howe		19/Jan/2018
User/Installer Responsibilities						
It is important to understand that the existence of this document alone does not automatically constitute authority to install the aircraft engine/propeller/article. Where the user/installer performs work in accordance with the national regulations of an airworthiness authority different than the airworthiness authority of the country specified in Block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts aircraft engine(s)/propeller(s)/article(s) from the airworthiness authority of the country specified in Block 1. Statements in Blocks 13a and 14a do not constitute installation certification. In all cases, aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by user/installer before the aircraft may be flown.						

9400 E. 34th Street N.
Wichita KS 67226
USA

Final Work Order

FAA CRS OL2R061L

000322908



Page 1 of 2

NOMENCLATURE Navigation Situation Display	SERIAL NUMBER 1-554B	SALES ORDER NUMBER	AR NUMBER
MANUFACTURERS PART NUMBER 52D137-2331	MODEL NUMBER IG-895A	QUANTITY 1	
MANUFACTURER Century	CUSTOMER ITEM NUMBER	SERVICE PERIOD	
CUSTOMER	CUSTOMER PO NUMBER	CHARGES	

REASON FOR REMOVAL:

PRELIMINARY INSPECTION:

- | | | | |
|---------------------------------------|--|--|--|
| ☐ SEALS BROKEN | ☐ COVER DAMAGED | ☐ NAMEPLATE DAMAGED | ☐ CONNECTOR DAMAGED |
| ☐ GLASS BROKEN | ☐ DIAL DISCOLORED | ☐ AIR PORTS DAMAGED | ☐ HIDDEN DAMAGE INSPECTION REQUIRED |

FINDINGS:

PREVIOUS SERVICE BULLETINS: N/A

PRELIMINARY INSPECTOR: Sergio Garcia

DATE: January 16, 2018

FAILURE ANALYSIS:

- ☒ CONTAMINATION

DESCRIBE IN DETAIL:

Filter is black. Pigtail connector and shaft gear old. CRS pointers, L/R meter, and lubber line faded. Rotor is noisy. G/S flag faded and out of calibration. NAV sticky on stops. G/S deviation has friction. Bearings are stiff.

WORK & INSTRUCTIONS:

SPECIAL INSTRUCTIONS:

- | | | |
|--|--|--|
| ☐ NEW | ☒ OVERHAUL | ☐ MODIFIED |
| ☐ WARRANTY REPAIR | ☐ REPAIR | ☐ WARRANTY OVERHAUL |
| ☐ FUNCTIONAL TEST | ☐ RETURN AS IS | |

INPUT: Air 14/28V

PANEL TILT:

LIGHTING: 14/28V

WORK ACCOMPLISHED:

Disassembled, cleaned, inspected, and repaired as necessary using parts listed. Reassembled and inspected in accordance with manufacturers specifications. Unit is overhauled.

REF. MANUAL # 685304 / 2 /

1 Dec 1996

OUTGOING SERVICE BULLETINS: N/A

 
TECHNICIAN: Johnny Nguyen	DATE: January 19, 2018
SHOP INSPECTOR: Douglas A Edwards	DATE: January 19, 2018
FINAL INSPECTOR: Nicholas Ryan Howe	DATE: January 19, 2018

9400 E. 34th Street N.
Wichita KS 67226
USA

Final Work Order

FAA CRS OL2R061L


000322908



Page 2 of 2

PARTS USED:

PART DESCRIPTION	QUANTITY
Rotor, Gyro Capsule Vac	1
Filter	2
Knob, Blank, See Notes	1
Decal Card, Set Green	1
Insulator, Flat, Kapton, Cut for TO-220	1
NPN, 80V 4A, Darlington, TO225	1
Pigtail, Assy, Century, 52D137 Series HSI	1
Bearing, See Notes	2
Bearing, See Notes	1
Bearing, Ball, Flanged, See Notes	1

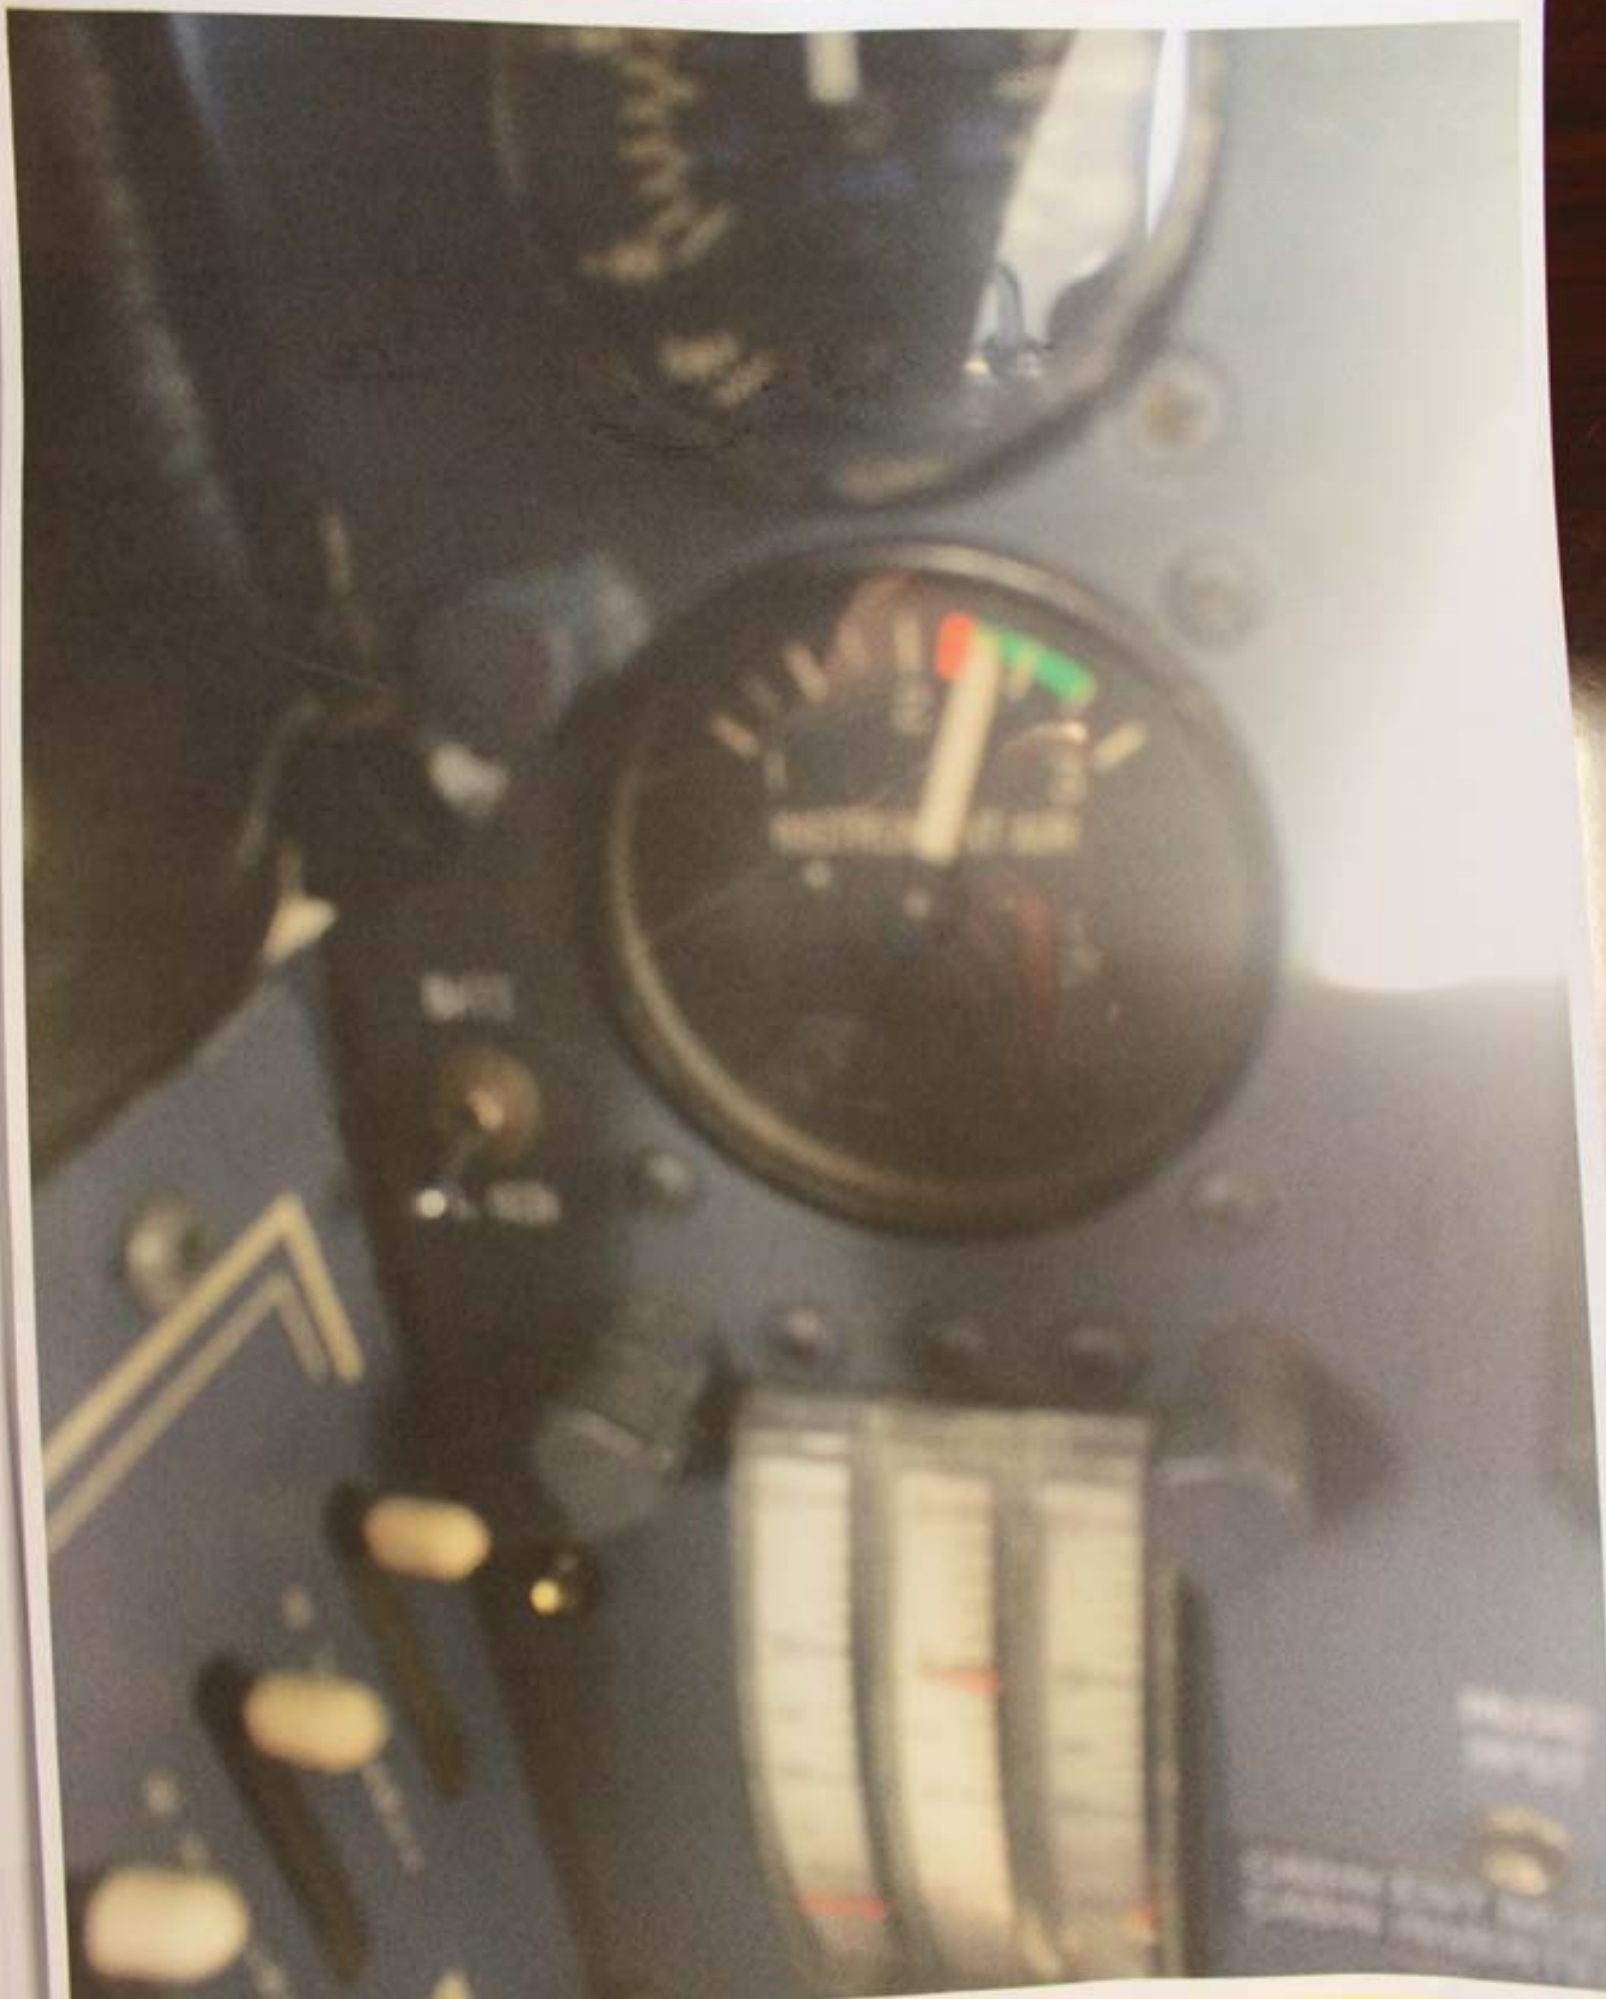

[illegible]

AUTHORIZED RELEASE FBI - NEW YORK, ARRESTED PERSONS, ALTHOUGH AT THIS	5977269
Textcon Aviation Inc. (PCC) Textcon Aviation Inc. 1 Creston Blvd, Wichita, KS 67215	2967922
30 SEAL	5722315-16
1	N/A
New	New

AUTHORIZED RELEASE DOCUMENT
 Lot#Batch # 1006Z021 Serial# exp: 06/Oct/2021
 POF: 20128

Terry Weeks
 13/Jun/2018

12666	AIRFRAME TOTAL TIME		ENGINE(S) SINCE OVER-HAUL			
			LEFT	RIGHT		
BRT FWD	6972.7		2260.8	2260.8		
THIS PAGE						
TOTAL						
ENGINE DATA	OAT			HOUR METER		
	PRESS ALT.			END		
	IAS			START	96.1	
	TORQUE (Tq)			PAGE TOTAL		
	PROP RPM (Np)			CYCLES		
	% RPM (Ng)			BRT FWD	2466	2219
	EGT (ITT)			THIS PAGE		
	FUEL FLOW (Wt)			TOTAL		
LANDINGS BRT FWD		6977	LANDINGS THIS PAGE		TOTAL LANDINGS	

20192

To:	From:
Mid-Continent	Executive Air
9400 E 34th Street N.	Austin Straubel Field
Wichita, KS	2131 Airport Drive
67226	Green Bay, WI 54313

Date: 2/19/2018	Ship Via UPS
Terms: Account # 19570	Tracking Number: 1Z 27W 394 12 69453789

Shipment To Be Received

Core Return

Overhaul/Repair

Incorrect Part

[illegible]

Comments: Core return per Sales order # 200898434

Thank you

If you have any questions, please contact: Phil Fischer Phone # (920) 498-4880

Phone # (920) 498-4880

Fax # (920) 498-4890

Thank You!

CORE RETURN FORM

Street N.
67226-2615
800-821-1212 or 316-630-0101
316-630-0723
www.mcico.com

Created Date: 02/12/2018
Return Core by: 03/14/2018

Account Number: 19570

Executive Air LLC
2131 Airport Dr
Green Bay WI 54313
USA

RETURN CORE TO:
Mid-Continent Instruments and Avionics
9400 E. 34th Street N.
Wichita, KS 67226-2615 USA
Phone: 800-821-1212 or 316-630-0101
Fax: 316-630-0723

Salesperson: Donald Burull

Contact Name Tony Sobiesczyk

Questions:
Customer Service
800-821-1212 or 800-345-7599
kelley@mcico.com

PO Number 20178

Sales Order 200898434

Quantity	Item Number	Serial Number	Description
1	52D137-2331		Horizontal Situation Indicator
Transaction Type		RMA Reason Code	
Order		COR	
Reason for Removal			

Complete this section and return full page with core.
Thank You!

Item Number Returned:	<u>52D137-2331</u>	Reason for removal (Please be specific)
Serial Number Returned:	<u>707 B</u>	<u>Gyro failed. will not</u>
Quantity Returned:	<u>1</u>	<u>hold heading.</u>
Install Date:	_____	_____
Service Hours	_____	_____

Mid-Continent

INSTRUMENTS + AVIONICS

34th Street N.
Wichita, KS 67226-2605
Phone: (800) 821-1212 (316) 630-0101
Fax: (316) 630-0723
www.mcico.com

Packing slip

Sales Order Number	200898434
Packing Slip Number	PS0254039
	
Ship Date	2/12/2018

Ship To

Executive Air LLC
2131 Airport Dr
Green Bay WI 54313
USA

Bill To

19570 Executive Air LLC
2131 Airport Dr
Green Bay WI 54313
USA

Notes

PO:



Phone: (920) 498-4880 Fax: (920) 869-1387
Contact: Tony Sobiesczyk

Purchase Order No.	Order Contact	Customer ID	Sales Person	Shipping Method	Payment Terms
20178	Tony Sobiesczyk	19570	Donald Burull	UPS Ground	1% 10 Net 30

Order	Ship	B/O	Item No.	Description	Cust Item/Model No.	Type of Sale	W/O No.
1	1	0	520137-2331	Horizontal Situation Indicator - IG-895A Core Value: XXXXXXXXXX Int'l Ship Info: Schedule B: 9014107040 ECCN: 7A994 S/N: 1-5548		Overhaul Exchange Order	Exchange

Incoterm 2010: FCA Mid-Continent Instruments and Avionics 9400 E.
34th Street N. Wichita, KS 67226.

Please notify your customer in advance that a 15%
Recertification Fee will be charged on all returned units.

Certificate of Conformance - It is hereby certified that all
articles included in this shipment are in conformance with the
requirements, specifications, and drawings applicable to the
above listed order and that supporting evidence to this effect
is on file at this office.

Authorized Signature



Insufficient fund checks will be charged a service fee of \$35.00.

Thank you for doing business with Mid-Continent Instruments and Avionics!

Thank You!

MidContinent™

INSTRUMENTS+AVIONICS

9400 E. 34th Street N.
Wichita, KS 67226-2605
Phone: (800) 821-1212 (316) 630-0101
Fax: (316) 630-0723
www.mcico.com

Packing slip

Sales Order Number	200898434
Packing Slip Number	P50254039
	
Ship Date	2/12/2018

Ship To

Executive Air LLC
2131 Airport Dr
Green Bay WI 54313
USA

Bill To

19570 Executive Air LLC
2131 Airport Dr
Green Bay WI 54313
USA

Notes

PO:



Phone: [REDACTED] 0 Fax: (920) 869-1387
Contact: Tony Sobiesczyk

Purchase Order No.	Order Contact	Customer ID	Sales Person	Shipping Method	Payment Terms
20178	Tony Sobiesczyk	19570	Donald Burull	UPS Ground	1% 10 Net 30

Order	Ship	B/O	Item No.	Description	Cust Item/Model No.	Type of Sale	W/O No.
1	1	0	520137-2331	Horizontal Situation Indicator 1G-895A Core Value: \$1,500.00 Int'l Ship Info: Schedule B: 9014107040 ECCN: 7A994 S/N: 1-5548		Overhaul Exchange Order	Exchange

Incoterm 2010: FCA Mid-Continent Instruments and Avionics 9400 E.
34th Street N. Wichita, KS 67226.

Please notify your customer in advance that a 15%
Recertification Fee will be charged on all returned units.

Certificate of Conformance - It is hereby certified that all
articles included in this shipment are in conformance with the
requirements, specifications, and drawings applicable to the
above listed order and that supporting evidence to this effect
is on file at this office.

Authorized Signature

Insufficient fund checks will be charged a service fee of \$35.00.

Thank you for doing business with Mid-Continent Instruments and Avionics!