



Photo 1 – Right side of inverted airplane in a field (Courtesy of owner)



Photo 2 – Damage to vertical stabilizer and rudder (Courtesy of owner)



Photo 3 – Carburetor heat control missing (Courtesy of owner)