



Incorporated 2010, R
Topanga Canyon, B
Please notify your club
Recertification Fee will be
Insufficient fund checks will be charged
Thank you for doing business with us

YEAR 20 <u>22</u> DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------------	---------------------------	-------------------	-----------------------------	--

wo: GA1492

Engine - page 1 of 1

Great Planes Aviation - [REDACTED] - Rochester, MN 55902 - [REDACTED]

N4081S
HOBBS: 2292.4

Lycoming, IO-360-C1C, S/N: L-14534-51A
TACH: 3500.37

October 17, 2022

1. Complied with Annual inspection in accordance with 14 CFR 43, Appendix D using Piper and Lycoming maintenance manuals as a guide.
2. Compression check #1 70/80 #2 76/80 #3 75/80 #4 76/80.
3. Oil was drained, filter removed and cut open to inspect for contamination, filter found satisfactory. New AA48110-2 filter installed and safetied. Engine serviced with 8 quarts of Phillips 20w50 Victory oil. Run and leak check performed good. Installed (1 Each) P/N AA48110-2 - Oil Filter.
4. AD's checked through this date.
5. Replaced all spark plugs with new. Installed (8 Each) P/N UREM38E - spark plugs.
6. Complied with AD 2015-19-07 Fuel injection line inspection. No defects noted. Next Due 3610.37 Tach.

I certify that this engine has been inspected in accordance with an annual inspection and was determined to be airworthy. With respect to the work performed, this engine is approved for return to service. Details of work performed are on file with Great Planes Aviation under work order: GA1492.

Ryan Fay A&P/IA [REDACTED]

wo: GA1684

Engine - page 1 of 1

Great Planes Aviation - [REDACTED] - Rochester, MN 55902 - [REDACTED]

N4081S
TACH: 3554.26

August 02, 2023

Oil was drained, filter removed and cut open to inspect for contamination, filter found satisfactory. New AA48110-2 filter installed and safetied. Engine serviced with 7 quarts of Phillips 20w50 Victory oil. Run and leak check performed good.

With respect to the work performed, this engine is approved for return to service. Details of work performed are on file with Great Planes Aviation under work order: GA1684.

Ryan Fay A&P/IA [REDACTED]

wo: GA1756

Engine - page 1 of 1

Great Planes Aviation - [REDACTED] - Rochester, MN 55902 - [REDACTED]

N4081S
HOBBS: 2292.4

Lycoming, IO-360-C1C, S/N: L-14534-51A
TACH: 3578.29

November 08, 2023

1. Complied with annual inspection in accordance with 14 CFR 43, Appendix D using Piper and Lycoming maintenance manuals as a guide.
2. Compression check #1 72/80 #2 77/80 #3 73/80 #4 73/80.
3. AD's checked through this date.
4. Complied with AD 2015-19-07 Fuel injection line inspection. No defects noted. Next Due 3688.29 Tach.

I certify that this engine has been inspected in accordance with an annual inspection and was determined to be airworthy. With respect to the work performed, this engine is approved for return to service. Details of work performed are on file with Great Planes Aviation under work order: GA1756.

Ryan Fay A&P/IA [REDACTED]



YEAR 20 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
--------------------	---------------------------	-------------------	-----------------------------	--

Engine - page 1 of 1

wo: GA1861



Great Planes Aviation - [redacted] - Rochester, MN 55902 - [redacted]

Lycoming, IO-360-C1C, S/N: L-14534-51A

March 05, 2024

N4081S

TACH: 3626.98

Oil was drained, filter removed and cut open to inspect for contamination, filter found satisfactory. New AA48110-2 filter installed and safetied. Engine serviced with 7 quarts of Phillips 20w50 Victory oil. Run and leak check performed good.

With respect to the work performed, this engine is approved for return to service. Details of work performed are on file with Great Planes Aviation under work order: GA1861.

Ryan Fay A&P/IA [redacted]

YEAR 20 DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
--------------------	---------------------------	-------------------	-----------------------------	--

wo: GA1950

Engine - page 1 of 1



Great Planes Aviation - [redacted] - Rochester, MN 55902 - [redacted]

N4081S

TACH: 3675.86

LYCOMING, IO360 SER, S/N: ENGINE SN TBD

June 14, 2024

Oil was drained, filter removed and cut open to inspect for contamination, filter found satisfactory. New AA48110-2 filter installed and safetied. Engine serviced with 6 quarts of Phillips 20w50 Victory oil. Run and leak check performed good. Installed (6 Each) P/N 20W50 Victory - Phillips 20W50 Victory, Installed (1 Each) P/N AA48110-2 - Oil Filter.

With respect to the work performed, this engine is approved for return to service. Details of work performed are on file with Great Planes Aviation under work order: GA1950.

Ryan Fay A&P/IA [redacted]