



ROCKY MOUNTAIN
AIRCRAFT SERVICES LLC

[REDACTED]
Broomfield CO, 80021

Date: October 1st, 2024

Acft Reg: N434CP

Flight Tach: 1835

Hobbs: 2145.2

ACTT: 1835

SIGNATURE
DATE TYPE
NUMBER

AIRFRAME

Performed a 100hr/Annual inspection in accordance with FAR 43 App (D) and Cessna checklist. Inspected and lubed all flight control surfaces, rod ends, chains and pulleys. C/W FAR 91.207 sub (D) ELT Inspection. Replaced ELT battery with new P/N 452-0133. Ops check is satisfactory at this time. **ELT battery next due for replacement November 2029.** Verified operation of exterior & interior lights. Cleaned/inspected induction air filter. **Filter recommended replacement tach 2236.8.** Cleaned, inspected, and re-greased wheel bearings as required. **CAP corrosion treatment due April 2026.** Adjusted Vacuum regulator for proper pressure IAW AMM. Replaced vacuum filters P/N: RA-D9-18-1 & P/N: RAB3-5-1. Serviced aircraft battery with distilled water as required. Re-sealed and checked windscreen for air leaks. Replaced co-pilot seat back adjust ultraloc with new P/N UL18-020VSP1. Installed new grip tape on pilot side step. Updated XPNDR bluetooth to display "CAP534" to nearby devices. All current and bi-weekly ADs have been complied with/ none new at this time. Ground run/ops/leak check all satisfactory at this time. This AIRFRAME has been inspected IAW a 100hr/Annual inspection and has been found to be in airworthy condition and is approved for return to service at this time.

Alec Abbott

[REDACTED]
A&P [REDACTED]