



ACFT MODEL/ PART NUMBER: AS350B3	DESCRIPTION: MacNeil Aviation LLC	SERIAL NUMBER: 8594	PO/SO#: 3139706	AREA: LUH NHC	STAGE 2 MAR	MRO OFF SITE	PAGE 20 OF 38
DISCREPANCY/TASK				CORRECTIVE ACTION/WORK PERFORMED			

ITEM # 58	☒ DISCREPANCY ☐ TASK	DATE: 6 Nov 19	P/N: DESC: A/C Hose	☒ N/A S/N: QTY: 1	☒ N/A	CATEGORY TYPE: ☐ C ☐ E ☒ M ☐ F ☐ S ☐ T ☐ O	RESPONSIBLE AREA: ☒ AHI ☐ AHD ☐ SUPP ☐ AH	QN ? ☐ YES ☒ NO
R/R COND. HOSE IS CHIPPING ON FWD FUEL CAVITY WALL - FLOW OUT FROM SWITCH, HIGH PRESS HOSE RUN, RH SIDE AFTER SECOND TIE-BLOCK						Repositioned line for clearance and added teflon tape to air frame		
TECH: [REDACTED]						TECH / DATE: [REDACTED] QA / DATE: [REDACTED]		
REWORK? ☐ YES ☒ NO						HRS: N/A 11/5/19 11-6-19		

ITEM # 59	☐ DISCREPANCY ☐ TASK	DATE: NOV 04 2019	P/N: DESC: RH MGB Cowl	☒ N/A S/N: QTY: 1	☒ N/A	CATEGORY TYPE: ☐ C ☐ E ☒ M ☐ F ☐ S ☐ T ☐ O	RESPONSIBLE AREA: ☐ AHI ☐ AHD ☐ SUPP ☐ AH	QN ? ☐ YES ☒ NO
RH MGB Lower Cowl bowed near aft-most rivet for hinge half.						Adjusted ⁷⁴³⁷⁸ 74378 ⁷¹²³⁷⁸ 712378 cowl Removed & reinstalled. All mags cowl. No defect noted in 2 found within limits		
TECH: [REDACTED]						TECH / DATE: [REDACTED] QA / DATE: [REDACTED]		
REWORK? ☐ YES ☒ NO						HRS: N/A 11-5-19 NOV 06 2019		

ITEM # 60	☐ DISCREPANCY ☒ TASK	DATE: NOV 04 2019	P/N: DESC: Belt Driven Hyd. Pump	☒ N/A S/N: QTY: 1	☒ N/A	CATEGORY TYPE: ☐ C ☐ E ☒ M ☐ F ☐ S ☐ T ☐ O	RESPONSIBLE AREA: ☒ AHI ☐ AHD ☐ SUPP ☐ AH	QN ? ☐ YES ☒ NO
Wipe hydraulic pump grease from MGB Deck and MGB RH Cowl, and and on MGB Coupling						Scrub off grease from MGB Deck, MGB RH cowl and mag coupling		
TECH: [REDACTED]						TECH / DATE: [REDACTED] QA / DATE: [REDACTED]		
REWORK? ☐ YES ☒ NO						HRS: N/A 05 Nov 19 11-6-19		

