

INVOICE

AMPHIBIANS PLUS LLC

BARTOW, FLORIDA

Tel. FAX

SOLD TO: Bill Booth

INVOICE NO. 120604

DATE: 12-Jun-2012

Deland, FL

WORK PERFORMED:

Reg. No.		S/N:	Model:	Hobbs:	TT:
N522WB		56	LA250 Renegade	1529.9	2684.9
QTY	UNIT	PART NUMBER	DESCRIPTION	UNIT PRICE	PRICE EXTENSION

1.00	EA	GE327	BULB - 28v		
2.00	EA	LM29710	RACE		
2.00	EA	LM29700LA	BEARING ASSEMBLY 902A1		
2.00	EA	LM6700LA	BEARING ASSEMBLY		
2.00	EA	LM67010	RACE		
1.00	EA	MS28775-112	O'RING		
2.00	EA	MS28775-212	O'RING		
0.50	QT	ACF-50	CORROSION INHIBITOR		
3.00	EA	77611	GASKET, EXHAUST		
2.00	EA	71481	O'RING, LYCOMING		
2.00	EA	LW18661	SEAL - PUSH ROD		
2.00	EA	70310	O'RING SEAL		
9.00	QT	SHELL 100W PLUS	OIL		
1.00	EA	CH48110-1	OIL FILTER 34.00		
2.00	EA	71973	GASKET, INTAKE		
2.00	EA	LW12272	LOCK PLATE		
2.00	EA	CLEAT	CLEAN, ALUMINUM		
1.00	AR	MISC PAINT	MISC PRIMER & PAINT SUPPLIES		
1.00	AR	MISC	MISC HARDWARE & DISPOSABLES		

TOTAL PARTS

\$

1.00	EA	LA250 ANNUAL	100 HR/ANNUAL INSPECTION		
	HR	DISCREPANCY	LABOR		
	HR	DISCOUNT	LABOR PER HOUR		

TOTAL LABOR

\$

LA250 100 Hr./Annual
DISCREPANCY LIST

OWNER:		DATE: 4 June 12
N 522WB	S/N 56	HOBBS
TACH 1558.7		TT 2713.7
		PAGE 2 OF 3
NO.	DISCREPANCY CORRECTIVE ACTION	MECHANIC
17	Check wing attach bolt torque. checked all JSH	[REDACTED] .25
18	Corrosion Treat Aircraft Treat aircraft with Corrosion-X corrosion inhibitor. complete	[REDACTED] .5
19	Clean & Service Spark Plugs CLEAN AS REQ	[REDACTED] 1.0
20	Lycoming Mandatory Svc. Buln. No. 565 [dated 2-21-2005] [Fuel pumps LW15473 w/datecode 3201]	[REDACTED]
21	AD2008-19-05 ECI Cylinders [cyl. p/n AEL65102, head AEL85099 s/n 1138-02 to 35171-22 Grp A; 35239-01 to 37016-28 Grp B] N/A not ECI	[REDACTED]
22	Oil leak in engine area R+I #4 & #6 CYL SEAL THRU BOLTS	[REDACTED] 1.5 NC
23	Paint chipped on Aft engine cowl Right side lower cowl PREP & PAINT AS REQ	[REDACTED] .5
24	Replace Bow cleats with metal REPLACED CLEATS TOUCH-UP PAINT & SAND	[REDACTED] 3.0
25	check & adjust Elevator Trim ind. Adjusted Trim ind	[REDACTED] .5
26	Tighten canopy spring Brackets Tightened Brackets	[REDACTED] .25
27	Nav centering	[REDACTED] 4.0/d
28	Black seal loose on left side canopy Reglued	[REDACTED] .25
29	Touch up left comm Antenna. Sanded, etch, Alclad & Primed & Painted	[REDACTED] 1.5
30	Sheared Rivet under ballast box in Vert tail Rmv Rmt, Sealed & installed new Rivet, Primed & Painted	[REDACTED] .5
31	1" of water in Right float Added water no leaks found	[REDACTED] 1.0
32	1" of water in Left float Added water no leaks found	[REDACTED] 1.0