



New Kent Aviation LLC

Aircraft: N8372Y Hobbs: 0.5 Estimated TT 6595.2 Date: 10/19/12

Removed existing battery box, cleaned and repaired aft mount and installed new mount tabs, installed Bogert Aviation battery box IAW STC SA01502SE AML approved installation instructions 06A-01m Rev IR. Installed Bogert PMA copper cables IAW STC SA3531NM AML approved installation instructions. Cables replaced: Battery to ground, battery to main relay, main relay to starter relays, external power relay to main relay. W&B change negligible. 337 filled with RIC FSDO. Replaced L and R engine starter solenoid with new Piper 602-850 units and master power relay 455-151 sourced from Webco IAW Piper document 88371 kit no 767-390~767-399. Installed Gill G35S PMA battery which is on approved list. Electrical system ops check OK. Reinstalled cargo latch key cylinder, repaired broken pin in emergency handle, ops check OK. Adjusted heater control switch at air duct and heater ops check OK. R&R L and R engine oil and filter with 8 qts each of Aeroshell 15/50 and 48110 filters. Old filters inspected OK and sample taken for analysis, R&R Vacuum pump on right engine with Rapco 215CC, engine run and leak check OK, vacuum system checks OK. All work IAW Bogert, Piper PA-30 SM, and AC43.13-1b. Mark D Weaver [REDACTED]



New Kent Aviation, LLC

Aircraft: N8372Y Hobbs: 1065.0 estimated 6380.2 TT Date: 07/27/12

Removed left engine starter PN 1109511, installed new B & C light weight starter PN BC315-100-2 SN 08125719. New Weight and Balance calculated. ICA per STC install manual. Ops check normal. 337 filed this date with RIC FSDO. STC SE00839W1. Work accomplished IAW B&C install instructions, Piper PA-30 SM, Lycoming SM, and AC43.13-1b. Mark D Weaver



New Kent Aviation, LLC

Aircraft: N8372Y Hobbs: 1060.0 estimated 6575.2 Date: 07/19/12

Removed generators and voltage regulators and parallel unit. Installed Plane Power STC SA10682C alternators FN TAL12-70(Left SN C2-122404, Right SN C2-122405) and solid state regulators per instructions utilizing existing wiring; circuit breakers remain the same as before 60 amp per alternator. Installed in place of field switches, two 7.5 amp kilxon circuit breakers to control field power to regulators. Installed two alternator inop indicator lights with 1 amp in line fuse in upper forward instrument panel. Wire load calculations per AC 43.13-1b. New Weight and Balance calculated. ICA per STC install manual. Ops check normal. 337 filed this date with R/C FSDO. Supervised owner installation of new vacuum pump Repco 215CC SN A48203 on left engine with new oil seal, ops check OK, also replaced vacuum filter with RA D9-18-1. Work accomplished IAW Plane Power STC SA10682C, Piper PA-30 SM, Lycoming SM, and AC43.13-1b. Mark D Weaver

Date	Invoice #
11/18/2013	2206

Bill To
MIKE BRONZBURG

PAID
12/30/2013

			N #	Terms
			8372Y	
Item	Qty	Description	Rate	Amount
PA30	1	INSPECTION	1,770.00	1,770.00T
SHOP FEE	1	SHOP FEE	40.00	40.00
CH48110-1	2	OIL FILTER	29.00	58.00T
154-01300	1	FELT GREASE SEAL	6.25	6.25T
100AD	16	ASHLESS DISPERSANT	7.02	112.32T
B3-5-1	2	VAC. REGULATOR FILTER	3.36	6.72T
MS35769-21	2	CRUSH WASHER	1.50	3.00T
LABOR	0.65	SET TIMING ON BOTH ENGINES	68.00	44.20
LABOR	3.51	REPLACED 18 NUT PLATES FOR FLOORING ATTACHMENT	68.00	238.68
MS21059L3K	6	NUTPLATE	1.20	7.20T
MS21059L08	6	NUTPLATE	1.00	6.00T
MS21059L06	7	NUT PLATE	1.75	12.25T
MS21069L3	1	NUTPLATE	1.10	1.10T
LABOR	0.42	THREAD REPAIR FOR WHEEL COVERS	68.00	28.56
HELICOIL 8-32	6	HELICOIL INSERT	4.55	27.30T
LABOR	5.53	REMOVED STARTER CABLES & INSTALLED NEW CABLES SUPPLIED BY OWNER	68.00	376.04
MS25171-3S	4	TERMINAL NIPPLE	4.80	19.20T
MS21919WDG6	3	CLAMP	5.40	16.20T
MS21919 WDG10	1	CLAMP	2.00	2.00T
MS21919WDG16	1	CLAMPS	1.25	1.25T
MS21919WDG9	2	CLAMP	1.25	2.50T
LABOR	0.2	REPLACE ELT BATTERY	68.00	13.60
BS2173	1	ELT BATTERY DATED 2015	56.67	56.67T
LABOR	1.77	REPAIR CRACK IN FLOOR BOARD PANEL	68.00	120.36
2024T3.040	0.5	ALUM.	32.09	16.05T
LABOR	2.16	REPLACE BRAKE PADS	68.00	146.88
066-14100	8	LINING	29.00	232.00T
105-00200	24	RIVET	0.58	13.92T
LABOR	1.8	REPLACED 5 ROLLER BOLTS ON L/R FLAPS	68.00	122.40
Thank you for your business.			Total	

A MONTHLY FINANCE CHARGE OF 1.5% WILL BE APPLIED AFTER 30 DAYS.

Phone #

Date	Invoice #
11/18/2013	2206

Bill To

MIKE BRONZBURG

[REDACTED]

PAID
12/30/2013

			N #	Terms
			8372Y	
Item	Qty	Description	Rate	Amount
AN3-11A	5	BOLT UNDRILLED	0.40	2.00T
LABOR	0.7	DRESS PROPELLER BLADES	68.00	47.60
LABOR	1.13	RIG NLG DOORS	68.00	76.84
LABOR	3.2	REPLACE BAD HINGE ON COWL FLAP	68.00	217.60
MS20257C2	1	HINGE S/S	4.89	4.89T
2024T3.032	1	ALCLAD ALUMINUM	26.25	26.25T
LABOR	1.7	REMOVE LFT ENGINE COWL FLAP ACTUATOR BAR FOR REPAIR	68.00	115.60
LABOR	0.68	REMOVE & REINSTALL UPPER ENGINE MOUNTS INSTALLED INCORRECTLY	68.00	46.24
LABOR	3.8	REMOVE ADF ANTENNA AND FABRICATE COVER FOR ANTENNA HOLES	68.00	258.40
2024T3.032	1	ALCLAD ALUMINUM	26.25	26.25T
LABOR	3.85	REPLACE LFT ENGINE FUEL PUMP SHROUD	68.00	261.80
USED PARTS	1	FUEL PUMP SHROUD	78.00	78.00T
SL60096	2	GASKET	2.00	4.00T
MS29512-06	2	ORING	0.75	1.50T
LABOR	1.08	ADJUST FUEL SELECTOR VALVE	68.00	73.44
LABOR	3.77	REPLACE RT ENGINE THROTTLE CABLE	68.00	256.36
MS21919WDG12	1	CLAMPS	1.10	1.10T
LABOR	0.75	REINDEXED GOV. ARM FOR STOP CONTACT	68.00	51.00
LABOR	2.8	REPLACED LEFT ENGINE PROP CONTROL CABLE	68.00	190.40
89307-000	1	BALL JOINT ROD END	39.75	39.75T
454-219	1	CABLE THROTTLE,PROP GOV	308.37	308.37T
MS21919WDG12	2	CLAMPS	1.10	2.20T
LABOR	0.4	REPLACE LFT ENGINE #1 CYLINDER FOR INJECTION LINE	68.00	27.20
SL12098-0-210	1	PRIMER LINE	103.77	103.77T
LABOR	0.87	RIGHT AUX TANK LEAK	68.00	59.16
MIL-DTL6000-5	1	HOSE	8.73	8.73T
Thank you for your business.			Total	

A MONTHLY FINANCE CHARGE OF 1.5% WILL BE APPLIED AFTER 30 DAYS.

Phone #

[REDACTED]

Date	Invoice #
11/18/2013	2206

Bill To

MIKE BRONZBURG

[REDACTED]

PAID
12/30/2013

			N #	Terms
			8372Y	
Item	Qty	Description	Rate	Amount
LABOR	2.55	CLEAN OUT INDUCTION BOXES ON BOTH L&R ENGINE	68.00	173.40
		TREAT W/CORROSION X AND REINSTALL		
BA10	2	ELEMENT	21.03	42.06T
LABOR	4.44	REMOVE ALT. AIR BOX FROM RT&LFT ENGINE FOR	68.00	301.92
		REPAIR		
MS20257C2	3	HINGE S/S	4.89	14.67T
AN742-3	2	CLAMP	1.02	2.04T
LABOR	23.7	REMOVE VERTICAL FIN FOR REPAIR AND INSTALL STC'D	68.00	1,611.60
		BEACON		
MS35489-6	2	GROMMET	0.48	0.96T
MS35489-9	1	RUBBER GROMMET	1.04	1.04T
USED PARTS	1	VOR ANTENNA	190.00	190.00T
LABOR	1	REPLACE FUEL LINE TO SERVO ON LEFT ENGINE	68.00	68.00
MS21919WDG16	1	CLAMPS	1.25	1.25T
MS21919WDG10	1	CLAMPS	2.00	2.00T
111-4	3	HOSE	16.30	48.90T
LABOR	1.92	8 SPACERS & INSTALLED TO REPLACE MISSING SEAT	68.00	130.56
		BELT BUSHINGS & INSTALLED SEATBELTS		
LABOR	1.96	REPLACE BAD/MISSING/BROKEN/NUTPLATES IN WINGS	68.00	133.28
MS21061L08	2	NUTPLATE	1.10	2.20T
MS21059L08	3	NUTPLATE	1.00	3.00T
A8K-75	8	RIVNUT	0.45	3.60T
LABOR	0.4	REPLACE #4 INJECTOR LINE RIGHT ENGINE	68.00	27.20
SL12098-0-140	1	PRIMER	77.74	77.74T
MS21919WDG12	4	CLAMPS	1.10	4.40T
MS21919WDG2	3	CLAMP	0.75	2.25T
MS21919WDG4	2	CLAMP	0.43	0.86T
MS21919WDG6	1	CLAMP	5.40	5.40T
MS21919WDG16	1	CLAMPS	1.25	1.25T
LABOR	4	HEATER AD	68.00	272.00
Thank you for your business.			Total	

A MONTHLY FINANCE CHARGE OF 1.5% WILL BE APPLIED AFTER 30 DAYS.

Phone #

[REDACTED]

Date	Invoice #
11/18/2013	2206

[REDACTED]

PAID
12/30/2013

Item	Qty	Description	Rate	Amount
LABOR	1.6	REPAIR RIGHT STABILIZER TIP	68.00	108.80
FUEL	14.4	FUEL 100 LOW LEAD	5.79	83.38
		Sales Tax	5.00%	169.02
Thank you for your business.			Total	\$9,271.88

Phone #