

TTR ref.	date	A/C	S/N	title	abstract	depressurization	parts removed	expertise report
2812	08/10/2015	TBM900	1042	Bleed temp CAS message followed by loss of pressurization at FL310	during flight a depressurization event at FL310	Yes	OTSW	
2776	29/06/2015	TBM900	1054	S207 OTSW overheat thermal switch	"BLEED TEMP" and "BLEED OFF" CAS MESS are sometimes displayed in flight.	Yes	OTSW	
2678	27/03/2015	TBM900	1045	PRESSURIZATION SYSTEM FAIL OTSW	@FL270 CAS - AIR BLEED OFF cass mess followed by depressurization RESTART the BLEED AIR - back to normal	Yes	OTSW	
2677	26/03/2015	TBM900	1038	Bleed Off Warning	@FL270, CAS messages CAB ALT & bleed temp recycled the bleed switch with no change	Yes	OTSW	
2606	17/11/2014	TBM900	1023	CAS CABIN ALTITUDE Message	@FL280, CAB ALT increase & CAB ALT CASS MESS	Yes	ITS small drift OTSW NFF	RAPPORT D'EXPERTISE AQFP JB CRE F11985 10122014 OTSW TBM 1023
2376	10/01/2014	TBM850	682	Cabin rate of climb not steady	@FL270 Cabin Alt up to 8900, diff press down to 5.5 PSID.	No	pilot's door leak OTSW	
2224	27/06/2013	TBM850	559	Air conditioning inop			OTSW	
2211	19/06/2013	TBM850	650	BLEED TEMP CAS message - S207 Overtemp switch	BLEED TEMP CAS message at 27,000 feet	Yes	OTSW	Rapport expertise overtemperature A042010300-5 (déposés des TBM 604, 648...
2196	10/06/2013	TBM850	648	S207 Bleed air overtemp. switch	at FL270, the bleed temp CAS warning illuminated at 27000 ft , and the bleed air shut off and could not be turned back on by cycling the bleed switch	Yes	OTSW FAULTY	Rapport expertise overtemperature A042010300-5 (déposés des TBM 604, 648...
1782	20/03/2012	TBM850	604	Bleed off CAS message in flight followed by bleed temp after 30 seconds	BLEED TEMP + BLEED OFF CAS Message reset and bleed temp went away reoccured 3times	Yes	OTSW FAULTY	Rapport expertise overtemperature A042010300-5 (déposés des TBM 604, 648...
1452	21/04/2011	TBM850	437	ECS Heat fault	at FL260 lost cabin pressurization and got a CAS message BLEED OFF. Reset the bleed air by switching it off then back on, it came back on for 10 to 15 min	Yes	ITS OTSW	
1193	06/07/2010	TBM850	464	BLEED OFF, and no pressurization above FL200	cruise @FL240, bleed off cass mess followed by progressive depress.	Yes	BPV OTSW	
1127	27/04/2010	TBM850	511	Bleed Temp and bleed off on ground	CAS message BLEED TEMP often displayed during the start up sequence The bleed was reseted (Bleed OFF then ON) and the trouble disappeared	No	OTSW	
838	18/05/2009	TBM850	491	Bleed temp message during start sequence	At start sequence the bleed is off. The message Bleed Temp displayed once ITT reaches 300°C.	No	OTSW	
837	18/05/2009	TBM850	477	Bleed temp message during start sequence	During inspection of wire harness under left aft baggage compartment floor board	No	OTSW	
750	13/03/2009	TBM850	488	Overheat Thermal Switch	on cold starts 30-35F bleed temp message & bleed air inop.	No	OTSW NFF	
380	11/04/2008	TBM850	440	DEPRESSURISATION	@FL280, CAB ALT CASS MESS, cab alt 14000ft. Bleed CAUTION ON (Yellow). system was 'reset'. Fault appeared to reoccur	Yes	OTSW	
378	10/04/2008	TBM850	440	Allumage du voyant Bleed Temp et Bleed Off (bleed Temp & bleed off CAS message on)	BLEED TEMP + BLEED OFF CAS Message Reset and system OK	Yes	OTSW	