

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
				TOTALS brought forward from previous page
05-02-14				Installed power section as received
Hobbs	1537.6			in repaired condition from Turbines. Drained all engine oil. Serviced with Sp 2380 oil to it's Sumps capacity. Checked oil filter for metal. none found. Southern field Aviation
				[Redacted Signature]
05-26-2015				
Hobbs	1987.1			Performed 100 Hr. inspection. flow checked all fuel nozzles, changed 3rd nozzle tips with overhauled assembly. Drained engine oil, took oil sample - sent to Aviation labs for analysis. Checked and cleaned the main oil filter, forward oil screen, forward chip detector, P ₃ filter and fuel pump screen. Replaced with new 1st fuel pump filter and 1st firewal fuel filter. Serviced engine to its Sumps capacity with Sp 2380 turbine oil. Turco washed Compressor. Cleaned and re-oiled air intake filter. Checked and cleaned air intake area. Checked igniter, starter brushes and beta carbon block for excessive wear - good. Ground Run engine all ops normal. Checked overspeed for proper setting. o.k. no oil/fuel leaks noted. Southern field Aviation
				[Redacted Signature]
06-18-2015				
A/C Hobbs	2148.9			Performed 100 Hr. inspection. Checked and cleaned the main oil filter, forward oil screen, chip detector, P ₃ filter, fuel pump screen and air intake filter. Checked igniter, starter brushes and beta carbon block for excessive wear. o.k. Added 3rd quart of Sp 2380 turbine oil
				SUB-TOTALS this page
				TOTALS-Carry forward to next page

[illegible]