 


YEAR: DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
				5-November-2010 Airframe N56553 Zenith CH701 S/NCH701ITEC ENG TT: 100.5 Installed Rotax 912ULS Engine S/N5650681 per Rotax Installation Manual and Zenith CH701 Installation Manual. All related components installed per Rotax and Zenith Configuration. Installed new Zenith mounting brackets for the engine, oil cooler and radiator. C/W Oil Pressure Purge Procedure I/A/W Rotax M/M. Installed new Warp Drive Propeller S/NT12835, 3-Blade Adjustable with Nickel Leading Edges and Taper Tips. Torqued and safety wired bolts - OP's checked OK. Installed new aircraft battery P/N Odyssey PC545 - OP's checked OK. Performed Ground Performance Data Run-Up - Operation and Leak Checks Good. All work completed I/A/W Rotax Maintenance Manual Pertinent details can be found on file @ Lockwood Aviation Repair Under WO6124.
				Signature  A&P  Jeremy Emmsley, A&P
				- manufactured NEW Jan 2008 -
				TBO 2000 Hrs / 15 yrs

The Number of Technician or Repair

[illegible]

