

April 5, 2016 N1863Y C-172C TACH: 3302.55 TAT: 3302.55

1. Performed **Annual Inspection** IAW Scope and Detail of FAR 43 Appendix D.
2. Opened all access panels, inspected and lubricated all flight control linkages.
3. Checked all lights for proper operation.
4. Installed new white tail light bulb.
5. Installed new rotating beacon bulb.
6. Sealed inside area of beacon dome as necessary.
7. Inspected tires for condition, and serviced to proper pressure.
8. Checked brake linings, calipers and disc condition, serviced brake system.
9. Cleaned battery box area and charged battery.
10. This ELT has been inspected IAW FAR 91.207, IAW with an expiration date of March 2017.
11. Inspected instrument panel, engine and flight controls in cockpit area for any malfunctions.
12. Applied Corrosion X compound on interior of aircraft as necessary.
13. Post maintenance turn performed satisfactory with no leaks noted at this time.

C/W AD 76-07-12 Bendix ignition switch operation check satisfactory. Next due @ 3402.55

C/W AD 2011-10-09 by inspection of seat track rails. Next due @ 3402.55

Aero Service of Winchester, Inc.

Winchester, VA

I certify that this AIRCRAFT has been inspected in accordance with a 100 HOUR inspection and determined to be in airworthy condition.

I certify that this AIRCRAFT has been inspected in accordance with an ANNUAL inspection and determined to be in airworthy condition.

P. Daniel Poston A&P

Jonathan Hisghman A&P

April 5, 2016 N1863Y C-172C TACH: 3302.55 SMOH: 1115.5

1. Performed **100 Hour Inspection** IAW Scope and Detail of FAR 43 Appendix D.
2. Performed compression check with the following results:
#1 79/80 #2 78/80 #3 78/80 #4 76/80 #5 78/80 #6 78/80
3. Installed Slick Magneto Kit PN: 6327-38 L/H SN:16020941 R/H SN:1602942.
4. Timed magnetos to engine as required.
5. Changed oil and added 8 quarts Phillips 20w50x/c oil.
6. Cleaned gasolator and installed new gaskets.
7. Washed engine and lubricated controls.
8. Inspected all accessories and hardware for security and serviceability.
9. Replaced all valve cover gaskets.
10. Installed new SCAT hose for carburetor heat.
11. Installed overhauled generator PN: 1101898 SN: FA00210 with new bushings.
12. Post maintenance turn performed satisfactory with no leaks noted at this time.

Aero Services of Winchester, Inc.

Winchester, VA

I certify that this ENGINE has been inspected in accordance with an 100 Hour inspection and determined to be in airworthy condition.

P. Daniel Poston A&P