

| YEAR:<br>DATE | RECORDING<br>TACH <sub>9</sub><br>TIME | TODAY'S<br>FLIGHT | TOTAL<br>TIME IN<br>SERVICE | Description of Inspections, Tests, Repairs and Alterations<br>Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.) |
|---------------|----------------------------------------|-------------------|-----------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 23 JAN 16     | 1141.0                                 | ⊕                 | 1141.0                      | Liberty XL-2 / S/N: 0053 N#: N568XL<br>Date: 23JAN2016 TTIS: 1141.00 H:                                                                                                                                        |
|               |                                        |                   |                             | 1. Adjusted heater box linkage.                                                                                                                                                                                |
|               |                                        |                   |                             | 2. Resecured Alternator Field post.                                                                                                                                                                            |
|               |                                        |                   |                             | 3. Verified SB-11-001-B: Define Inspection Schemes<br>for Wing Pins complied with/ Current Inspection<br>Checklist P/N: 135A-970-100/RevD used for Insp.                                                       |
|               |                                        |                   |                             | 4. Verified SSI-10-001-A Alternator Fuse Holder F3<br>Installation is complied with.                                                                                                                           |
|               |                                        |                   |                             | 5. C/W AD2009-08-05; Heater is enabled, next<br>**inspection due in 25 hours @ Tach 1166.00**                                                                                                                  |
|               |                                        |                   |                             | 6. Inspected FADEC battery, Due for REPLACEMENT<br>prior to MARCH 1, 2017.<br>Powersonic battery P/N: PS12120-F2                                                                                               |
|               |                                        |                   |                             | 7. Cleaned and Reinstalled the Air Filter K&N R-1260                                                                                                                                                           |
|               |                                        |                   |                             | 8. Tightened alternator belt.                                                                                                                                                                                  |
|               |                                        |                   |                             | **Continued next page**                                                                                                                                                                                        |

YEAR:

016

DATE

RECORDING  
TACH  
TIMETODAY'S  
FLIGHTTOTAL  
TIME IN  
SERVICE

\*\*Continued from previous page\*\*

ician or Repair

9. Cleaned &amp; Re-installed AIR/Oil separator IAW

Airwolf Airsep Report AFC-W360, Rev c.

10. Bled and serviced Brakes with MIL-5606 HYD. Fluid

11. Removed and Replaced ELT Batteries with (6) NEW Duracell  
MN1300 batteries

AK-450 ELT: S/N: 503163 (Batteries Due: 2/2017)

Remote Switch: Battery DUE OCT 2019

12. Resecured ground straps on both ECU #1 &amp; ECU#2

13. Safety wired both ECU#1 &amp; ECU#2 Connectors.

14. Adjusted WOT Switch (also recorded in Engine Logbook)

15. Repacked L/H, R/H &amp; NLG wheel bearings.

16. Resecured loose VOR Antenna.

All Work done I/A/W the Liberty XL2 MM and the TCM  
M-22 MM, where applicable

J. Turnbach

AP

signed: \_\_\_\_\_



| YEAR:<br>DATE | RECORDING<br>TACH<br>TIME | TODAY'S<br>FLIGHT | TOTAL<br>TIME IN<br>SERVICE | Description of Inspections, Tests, Repairs and Alterations<br>Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)                                                                                                                                                                                                                                                                                                             |
|---------------|---------------------------|-------------------|-----------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 01FEB16       | 1141.0                    | 0                 | 1141.0                      | <p>Liberty XL-2 / S/N: 0053 N#: N568XL</p> <p>Date: 01FEB2016 TIS: 1141.0 Hobbs:</p> <p>I Certify this AIRFRAME has been inspected I/A/W an ANNUAL inspection as set fourth in the Liberty XL-2 MM; Chapter 05 Annual Inspection Checklist and 14 CFR Part 43, Appendix D and was found to be AIRWORTHY. See Service Bulletins List for compliance to date ; Aircraft is OK for Return to Service. **AD2009-08-05 next due: TTIS: 1166.00 (25 hrs): heater is enabled.**</p> <p>J. Turnbach<br/>signed: [Signature] IA</p> |