


Attachment

Photographs



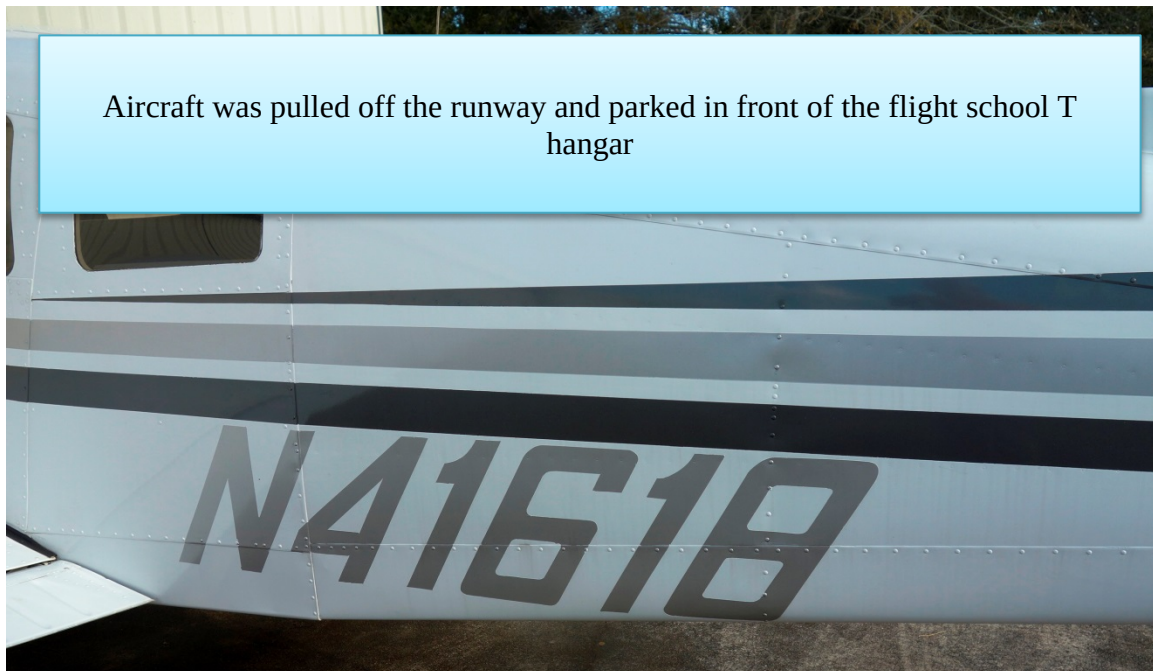

Front left view. Front cowl is destroyed. Propeller and spinner suffered heat damage



It appears fire damage is limited to the firewall forward





Right tail view no damage



Right side view



Engine compartment pictures show damage to aluminum brackets, scorched paint on the firewall from heat, and melted fasteners.







The prop suffered heat exposure, the cowl is very brittle. You could poke your finger through it.

Left side of engine compartment







Landing light blackout





Right panel



Tach reads 7816.00



Interior view