



Photo 1 – Number 3 Cylinder Intake Valve with Carbon Deposit Buildup (Photo Courtesy of Bill Siegel, Mechanic)



Photo 2 - Substantially Damaged Wing Spar Carry Through (Photo Courtesy of Bill Siegel, Mechanic)



Photo 3 – Right Aileron Damage (Photo Courtesy of Bill Siegel, Mechanic)