

2-5-18 Hobbs 3207.6 10885.6 ACTT. Phase one and two inspection completed this date. C/W AD 76-22-03, 440 hour inspection of elevator. S/B 55-21-45R1 elevator torque tube inspection due @ 11137.5 C/W annual inspection of ELT per 91.207D. Complied with the following 400 hour inspections: Aileron & Rudder trim tab actuator lubrication, rudder pedal & bellcrank lubrication, aileron quadrant & bellcrank lubrication, cabin door, latch lubrication, emergency exit door track, guide & latch lubrication. Installed two PT6 fuel filter/ seal kits. Installed two 131765L3M rod end, two AN4-10A bolt, and two AN365-428A nut. Serviced tire pressure and brake fluid. Deep charged aircraft battery. Reset cabin door hinge. Installed 1 / 101-380039-1 filter, 1 / B3-5-1 filter. I certify that this aircraft has been inspected in accordance with Beechcraft Phase inspection program and is approved for return to service.

Dennis A. Handley

John Bitz

N945WS
Removed and reinstalled Garmin repaired GNS-430W P/N 011-01060-40
S/n 97108158. Repaired left course needle wire at the #2 HSI.
(W/O #62059)



ATC/COMMUNICATIONS SECTION
FAA WEST WING, P.O. BOX 13122
412-469-1400
F.A.A. AZ18026K

March 14, 2018

6/1/18 Hobbs 3231.1 Replaced Left outboard tire
2033-6310. Cleared + preflight

Photo 1 -

YEAR:	RECORDING HOUR TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
DATE				
				3-01-19 Hobbs 3306.7 ACTT10984.7 Phase 3 & 4 inspection completed this date. C/W annual inspection of ELT per 91.207(d). ELT batteries expire 1/22. Installed new fuel filter AN6234-3A in left and right positions with PT-6-100 hour inspection kits. Serviced tire pressure and brake fluid. Replaced top static wick on rudder p/n 16165. Reset cabin door hinge. Replaced 1 / 101-380039-1 & 1 / B3-5-1 filter. Cleaned cabin outflow valves. C/W 150 hour inspection of exhaust duct per AD 2004-23-02. Replaced belly beacon bulb GE1939X. Charged aircraft battery. Lubricated landing gear & flight control system. I certify that this aircraft has been inspected in accordance with Beechcraft Phase inspection program and is approved for return to service. [Redacted Signature] Dennis A. Handley [Redacted]
				3-01-2019 Hobbs time 3306.7 ACTT 10984.7 Complied with Beechcraft Mandatory Service Letter MTL-57-01. Fifteen year left and right bolt replacement was completed by Friend Aircare on 3/14/2017 w/o#9509. The hardware used with this installation is exempt from the products affected per MTL-57-01. [Redacted Signature] Dennis A. Handley [Redacted]

Photo 2 -