

Aircraft Maintenance Record

 
 
 
 
 
 
Log Number 3
 Aircraft Registration Number N959CM
 Aircraft Manufacturer BEECHCRAFT
 Model 58
 Serial # TH-1792

Engine (s) Currently Installed

	Left	Right
Manufacturer	<u>CONTINENTAL</u>	<u>CONTINENTAL</u>
Model	<u>IO-550C</u>	<u>IO-550C</u>
Serial #	<u>686508</u>	<u>686512</u>

Propeller (s) Currently Installed

	Left	Right
Manufacturer	<u>MCCAULEY</u>	<u>MCCAULEY</u>
Model	<u>3DF32C512-C</u>	<u>3DF32C512-C</u>
Serial #	<u>960526</u>	<u>150000</u>

DATE	TACH TIME	TOTAL TIME	DESCRIPTION OF WORK PERFORMED Signature & Certificate No. of Person Performing Work
8/1/18	1867.9	1867.9	<u>New Log Book Started</u> <u>This Date 2609070</u>
MAKE: Beech MODEL: 58 S/N: TH-1792 REG. NO: N959CM WORK ORDER: 10484-08-2018			Honeycutt Aviation, Inc.  DATE: 8/31/2018 ACT. NO: 1867.9 HOBBS: 1867.9
Airframe Entries Installed new Goodyear Flight Custom III tire on nose wheel and balanced wheel assembly			SIGNED: [Redacted] DATE: 8/31/2018 Work Order: 10484-08-2018 Printed by EBis 3 (datamedia.com)
MAKE: Beech MODEL: 58 S/N: TH-1792 REG. NO: N959CM WORK ORDER: 10494-03-2018			Honeycutt Aviation, Inc.  DATE: 10/16/2018 ACT. NO: 1867.7 HOBBS: 1867.7
Airframe Entries Installed new brake discs and linings for both left and right main landing gear wheels			SIGNED: [Redacted] DATE: 10/16/2018 Work Order: 10494-03-2018 Printed by EBis 3 (datamedia.com)
FLIGHT LOG BEECH BARON N WRO 60831 EXCHANGED ROLL SERVO KS271A P/N 065-0060-01 S/N 40923 Signed <u>DANA LIBERTONE</u>  Date <u>10-19-2018</u> The Avionics Specialists, Inc. FAA-Approved Repair Station  FLIGHT LOG BARRON N959CM WRO 60838 REPAIRED AUTOPILOT COMPUTER KC295 S/N12346 P/N 065-0034-00 All work was performed IAW AC 43.13-1B & 2B and the equipment Manufacturer's installation instructions Signed <u>DANA LIBERTONE</u>  Date <u>10-23-2018</u> The Avionics Specialists, Inc. FAA-Approved Repair Station No. 			



RAM AIRCRAFT
The Engine Specialist
FOR CESSNA, BEECHCRAFT, & CIRRUS AIRCRAFT



ENGINE MAINTENANCE RECORD

Aircraft Registration N 959 CM
Engine Position Left
Engine Serial No. 686508

7505 Karl May Dr. | P.O. Box 5219 | Waco Regional Airport | Waco, TX 76708 | Phone: (254) 752-8381 | Fax: (254) 752-3307 | www.ramaircraft.com



ENGINE MAINTENANCE RECORDS

Log No. _____

Aircraft Registration No. N1959CM

Engine Manufacturer Continental

Model IO-550-G

Serial No. 686508

Date installed on aircraft 8/19/16

Time Between Overhauls (TBO) 1700 Hours

If used on multi-engine aircraft:

☐ Right

☒ Left

Waco Regional Airport • P.O. Box 5219 • Waco, Texas

Phone

Fax:

www.ramaircraft.com

Page No. _____

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATION NO. OF PERSON PERFORMING WORK
------	-----------------------	---------------------------	------------------------------	---

Date	Total Time In Service	Total Time Since Overhaul	Tach or Recording Meter Time
8/4/16	1623.3	0.0	



CONTINENTAL IO-550-C Left Engine S/N 686508

Above referenced engine overhauled to new parts limits per FAR 43.2(a)(1)(2) to conform w/ CMI (M-16), Continental M-O, Standard Practice Maintenance Manual. Applicable AD's and Service Bulletins C/W at this time. All gears cleaned, polished when required, inspected, magnetic particle inspected, and no cracks found. Finish and dimensional limits within RAM Gear Inspection Specification No. 1818, Rev. M dated 01/18/2016. Installed new RAM camshaft p/n 1058-1A, s/n XD15052 as direct PMA replacement of Continental camshaft. Installed lifters p/n SA628488 int. p/n SA646277 exh. AD 10-11-04 n/a to lifter p/n installed. AD 97-26-17 c/w per installation of overhauled VAR crankshaft p/n 649900, s/n C199601N per TCM CSB96-8. C/W ultrasonic inspection per MSB96-10B, due at next overhaul or when crankshaft removed. AD 99-19-01 c/w and found n/a per crankshaft date of manufacture I/A/W TCM MSB99-3C. AD 2000-23-21 N/A to crankshaft serial number/date of manufacture I/A/W TCM Mandatory Service Bulletin MSB00-5D. Engine assembled with overhauled Continental heavy style crankcase p/n 646613-1, s/n H079116RP. Installed new Superior Steel Cylinders. Installed overhauled oil cooler p/n 635996, s/n 484. Engine accessories exchanged for overhauled or new units with exception of prop governor, tach generator, alternator and vacuum pump which were not installed per this work order. Slick magnetos p/n 6310 installed. Service Bulletin SB3-08A N/A to magneto serial numbers installed. SB1-12 Slick Points assy. N/A per S/N. MSB94-8D on magneto timing procedure c/w per timing to data plate TC degree requirements with TDC locator and protractor with pointer. Installed RAM/FAA/PMA rocker arms p/n 1842-3 and 1842-4. C/W AD 95-03-14 per installation of new style engine mount brackets p/n 653305 and 653306; this terminates inspection requirements of this AD. Category 1 thru 3 CMI Service Bulletin Compliance Listing in RAM Manual. Installed RAM-FAA-PMA rocker arm cover gaskets p/n 1387-1. Installed RAM/FAA/PMA spring loaded induction clamps p/n 1170-2 and double clamp p/n 1170-5. Engine ground run on test stand per RAM specifications for a minimum of 2.25 hours. Engine run-in with Aeroshell 100 Mineral oil. See RAM Recommended Oil Grade Maintenance Tip MT-1 for recommended oils. Engine approved for return to service for the work performed. Engine preserved per Continental M-O, Standard Practice Maintenance Manual temp. storage up to 90 days. Pertinent details on file under Project No. 10075-07-2016

RAM Aircraft, Limited Partnership, _____, Waco Texas 76708 CRS _____

ENGINE MODEL: IO-550-C
ENGINE S/N (L): 686508
G. NO: 959CM
WORK ORDER: 10075-07-2016



Honeycutt Aviation, Inc.

DATE: 8/19/2016
A/C TSN: 1621
ENG TT (L): 1623.3
HOBBS: 1590.8

Left Engine Entries

Installed RAM Aircraft overhauled IO-550-C engine S/N-686508 on left side of aircraft. Installed new Lord engine mounts. Performed post maintenance functional checks. No defects noted.
Propeller governor B210800 S/N- 1999197 was overhauled by American Propeller. Installed on left engine and performed functional checks. No defects noted.
Alternator p/n ALV-9610, s/n H-091494 removed. Installed New alternator p/n ALV-9610, s/n H-Q061242. Tested and installed drive coupling in accordance TCM Manual X30531-4.

8/19/2016

SIGNED: _____
Daniel Honeycutt, IA: _____

Work Order: 10075-07-2016

Printed by EBIS 3 (datcomedia.com)

SUB-TOTALS this page

TOTALS—Carry forward to next page

DATE: 12/7/2016
A/C TSN:
HOBS: 600

MAKE: Raytheon Aircraft
Co
MODEL: 58
S/N: TH-1792
REG NO: 959CM
WORK ORDER: 1907



Chuck's Aircraft, LLC.

WORK

Airframe Entries

Installed overhauled starter PN MHJ-4003, SN H-Q110011

Described maintenance is airworthy with respect to work performed

SIGNED:

Robert McBride, Jr., A

Work Order: 1907

Printed by EBis 3 (datcomedia.com)

DATE: 12/7/2016

Honeycutt Aviation, Inc.

DATE: 3/18/2017
A/C TSN: 1666
ENG TT (L): 1668.3
TSMOH (L): 45
HOBBS: 1666

ENGINE MODEL: IO-550-C
ENGINE S/N (L): 686508
REG NO: 959CM
WORK ORDER: 10174-01-2017

Left Engine Entries

I certify that this engine has been inspected in accordance with an annual inspection and was determined to be in airworthy condition. Installed new AA48108 oil filter. Serviced with 11 qts Aeroshell 100W Plus. No performed oil & filter change. Drained oil, cut and inspected oil filter, no defects noted. AD 16-16-12 ECI Class 71 or 76 cylinder assembly failure N/A. No ECI cylinders installed.

SIGNED:

Work Order: 10174-01-2017

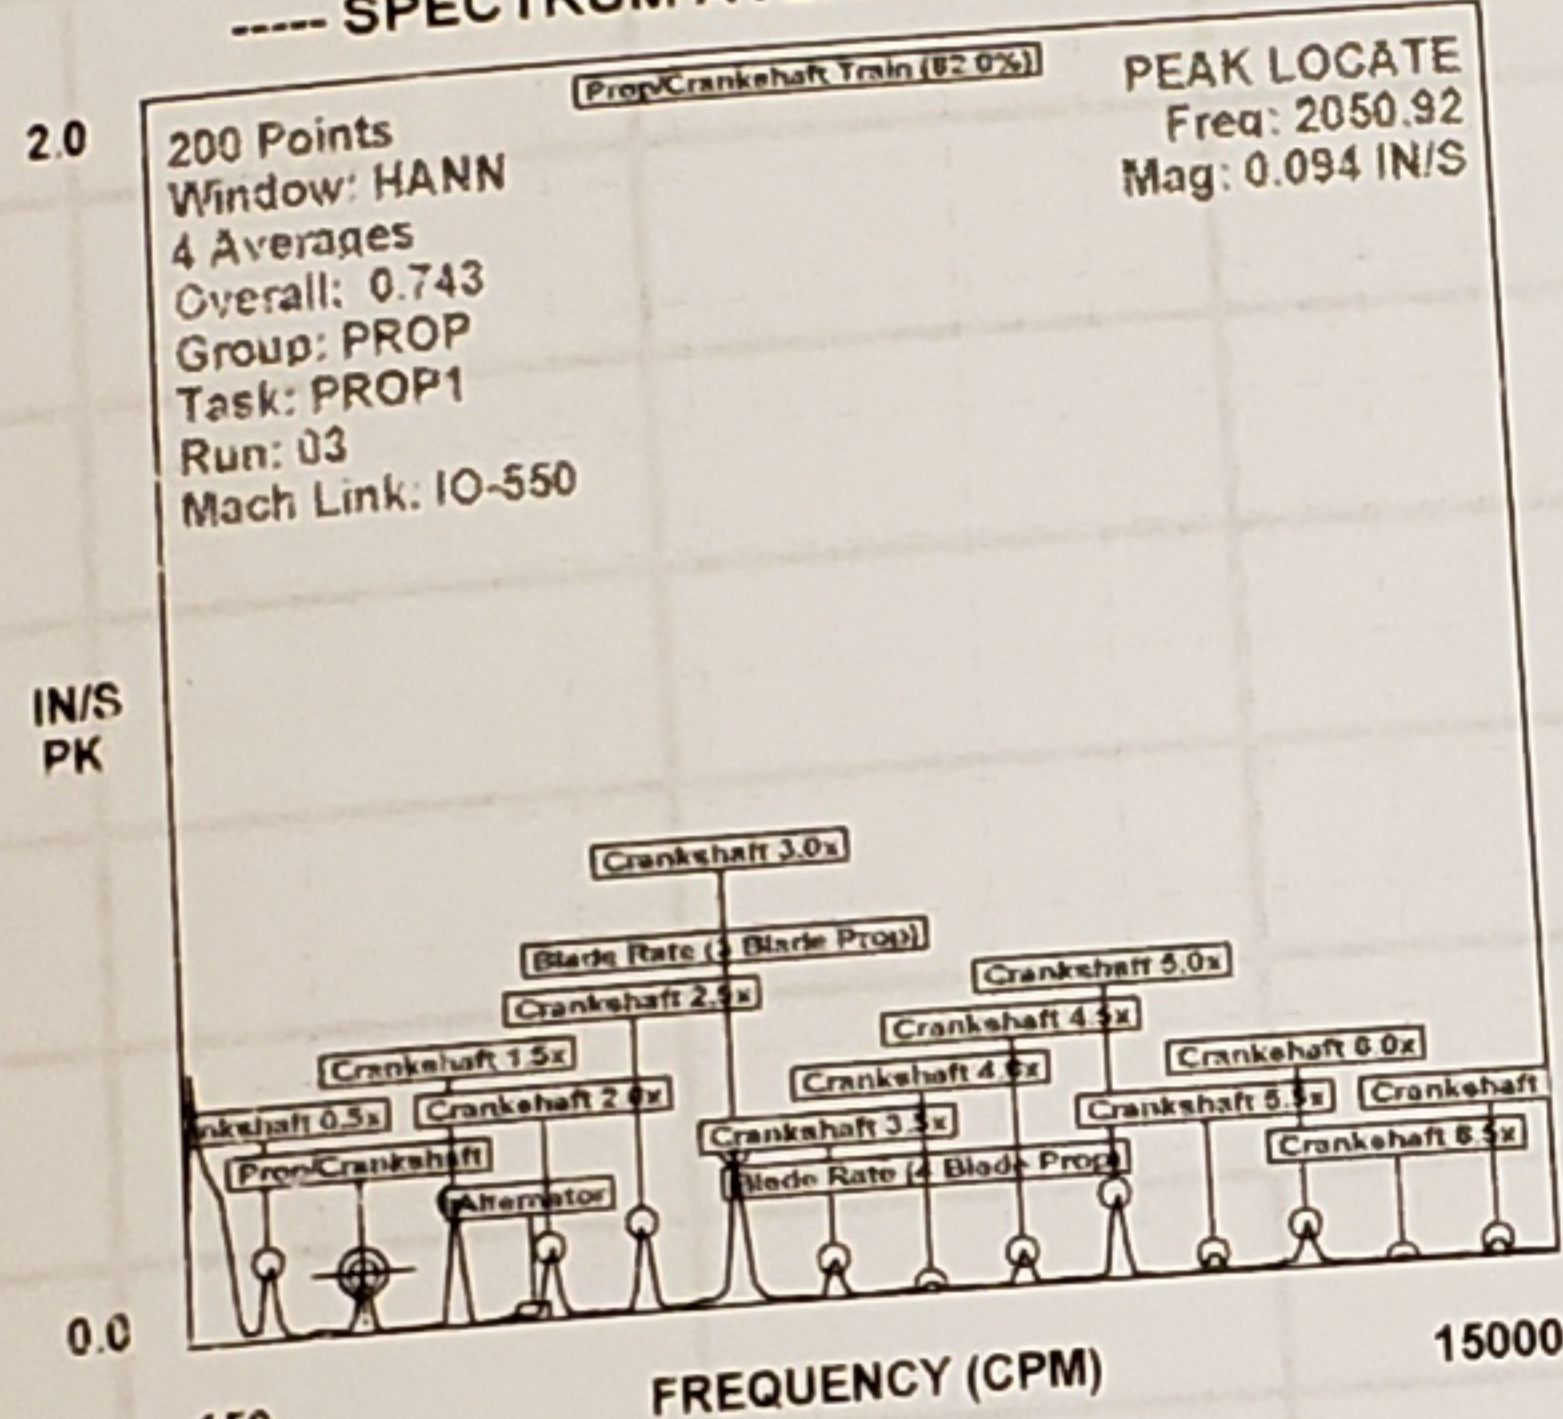
Printed by EBis 3 (datcomedia.com)

DATE: 3/18/2017

ENGINE SPECTRUM ANALYSIS

Operator Comments

----- SPECTRUM AVERAGE PLOT -----



N959CM 58 TH-1792 1666.0 Hrs
IO-550-C 686508

MicroVib II SN:2681 Cal:09/08/2016

Oper:

Date: 03/06/2017

el Honeycutt

ENGINE MODEL: IO-550-C
ENGINE S/N (L): 686508
REG NO: 959CM
WORK ORDER: 10214-04-2017



Honeycutt Aviation, Inc.

Left Engine Entries

Installed new o-ring on left starter base.

SIGNED:

Daniel Hone

DATE: 4/25/2017

Work Order: 10214-04-

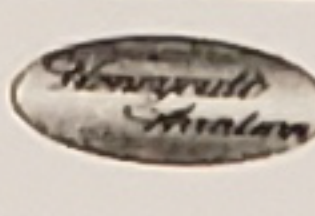
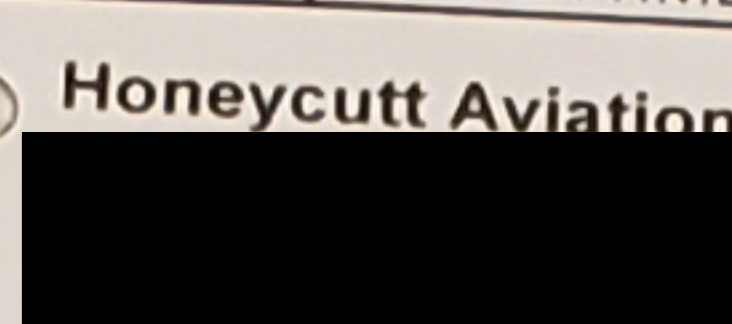
Printed by EBis 3 (datcomedia.com)

DATE: 4/25/2017
A/C TSN: 1666
ENG TT (L): 1690
TSMOH (L):
HOBBS: 1666

SUB-TOTALS this page

TOTALS—Carry forward to next page

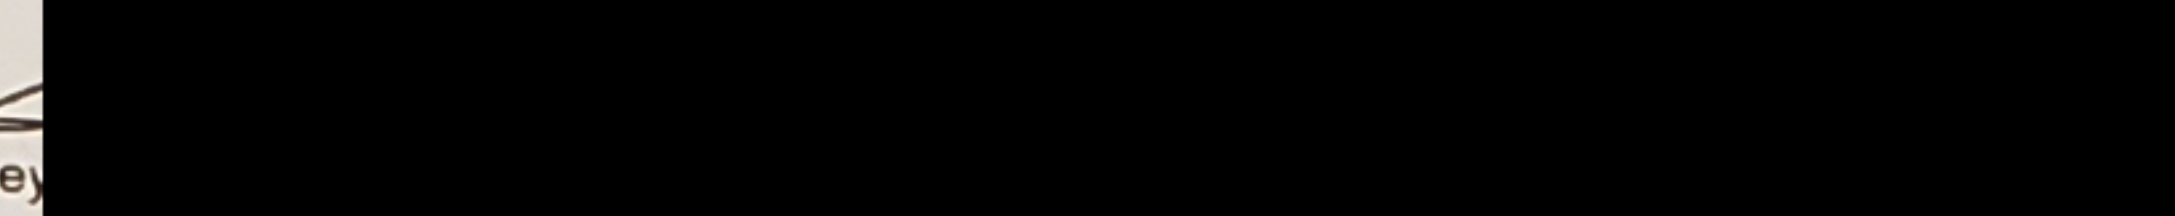
Page No. _____

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATION NO. OF PERSON PERFORMING WORK
ENGINE MODEL: IO-550-C ENGINE S/N (L): 686508 REG. NO: 959CM WORK ORDER: 10256-07-2017				 Honeycutt Aviation, Inc. 

Left Engine Entries

Performed oil & filter change. Drained oil, cut and inspected oil filter, no defects noted. Installed new AA48108 oil filter. Serviced with 11 qts Aeroshell 100W Plus. No leaks noted after run-up.

DATE: 7/7/2017

SIGNED: 

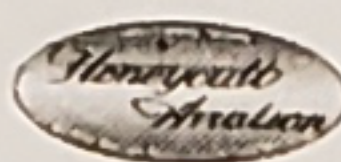
Daniel Honeycutt

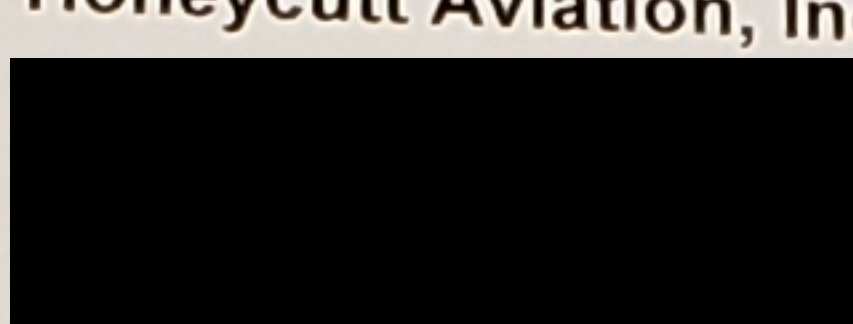
DATE: 7/7/2017
A/C TSN: 1727.1
ENG TT (L): 1729.4
TSMOH (L): 106.1
HOBBS: 1727.1

th 11 qts Aeroshell 100W Plus. No

Work Order: 10256-07-2017
Printed by EBis 3 (datcomedia.com)

ENGINE MODEL: IO-550-C
ENGINE S/N (L): 686508
REG. NO: 959CM
WORK ORDER: 10332-12-2017

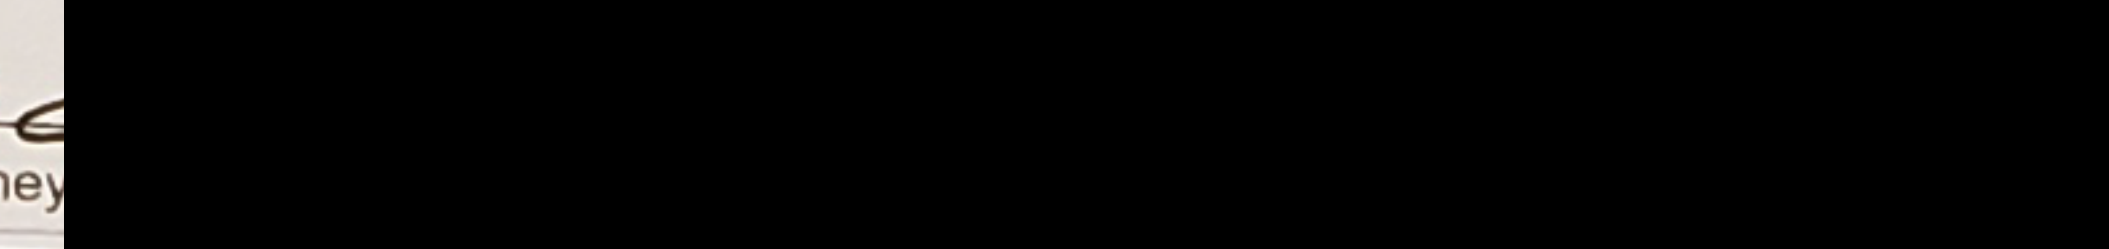


Honeycutt Aviation, Inc.


Left Engine Entries

Performed oil & filter change. Drained oil, cut and inspected oil filter, no defects noted. Installed new AA48108 oil filter. Serviced with 11 qts Aeroshell 100W Plus. No leaks noted after run-up.

DATE: 12/8/2017

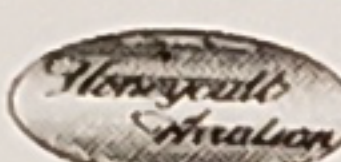
SIGNED: 

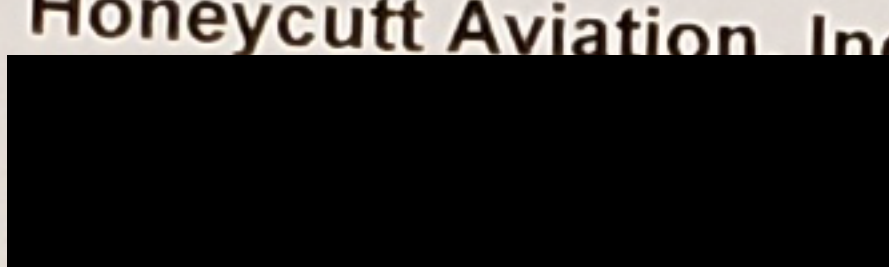
Daniel Honeycutt

DATE: 12/8/2017
A/C TSN: 1782
ENG TT (L): 1784.3
TSMOH (L): 161
HOBBS: 1782

Work Order: 10332-12-2017
Printed by EBis 3 (datcomedia.com)

ENGINE MODEL: IO-550-C
ENGINE S/N (L): 686508
REG. NO: 959CM
WORK ORDER: 10359-01-2018

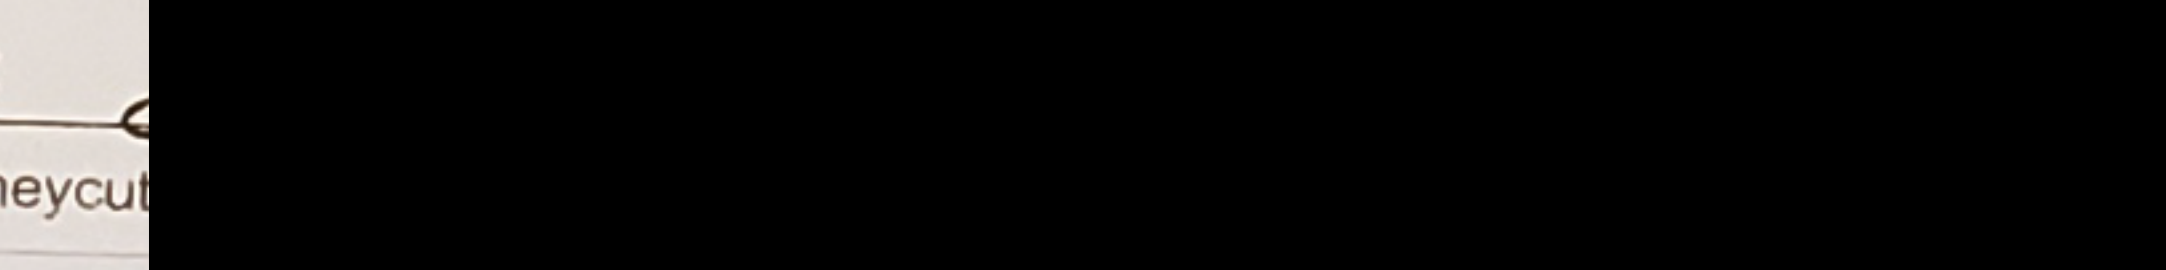


Honeycutt Aviation, Inc.


Left Engine Entries

I certify that this engine has been inspected in accordance with an annual inspection and was determined to be in airworthy condition. Performed oil & filter change. Drained oil, cut and inspected oil filter, no defects noted. Installed new AA48108 oil filter. Serviced with 11 qts Aeroshell 100W Plus. No leaks noted after run-up.

DATE: 3/9/2018

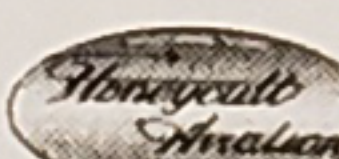
SIGNED: 

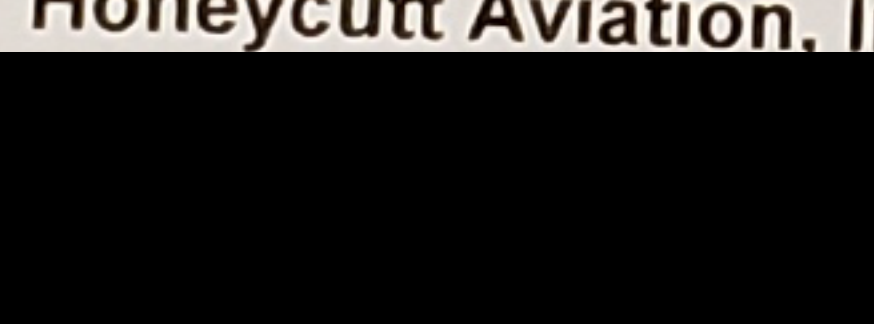
Daniel Honeycutt

DATE: 3/9/2018
A/C TSN: 1795.2
ENG TT (L): 1797.5
TSMOH (L): 174.2
HOBBS: 1795.2

Work Order: 10359-01-2018
Printed by EBis 3 (datcomedia.com)

ENGINE MODEL: IO-550-C
ENGINE S/N (L): 686508
REG. NO: 959CM
WORK ORDER: 10386-03-2018

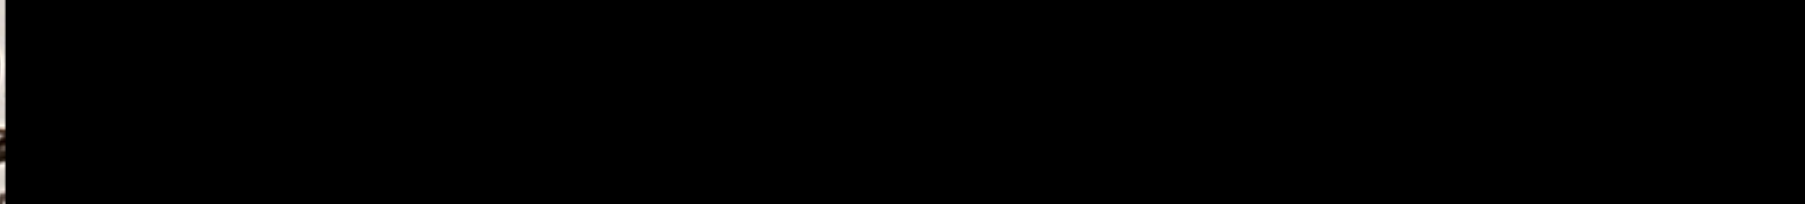


Honeycutt Aviation, Inc.


Left Engine Entries

Installed new stud P/N:402053 in tachometer generator drive pad. Performed functional and leak check, no defects noted.

DATE: 4/4/2018

SIGNED: 

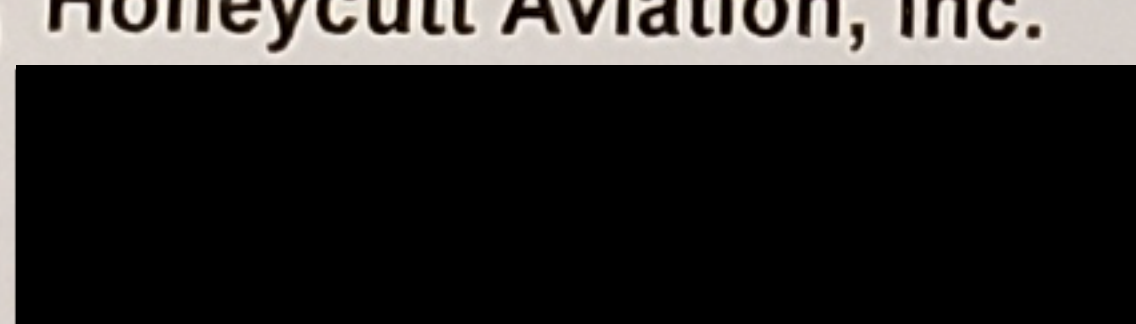
Daniel Honeycutt

Work Order: 10386-03-2018

Printed by EBis 3 (datcomedia.com)

ENGINE MODEL: IO-550-C
ENGINE S/N (L): 686508
REG. NO: 959CM
WORK ORDER: 10460-07-2018

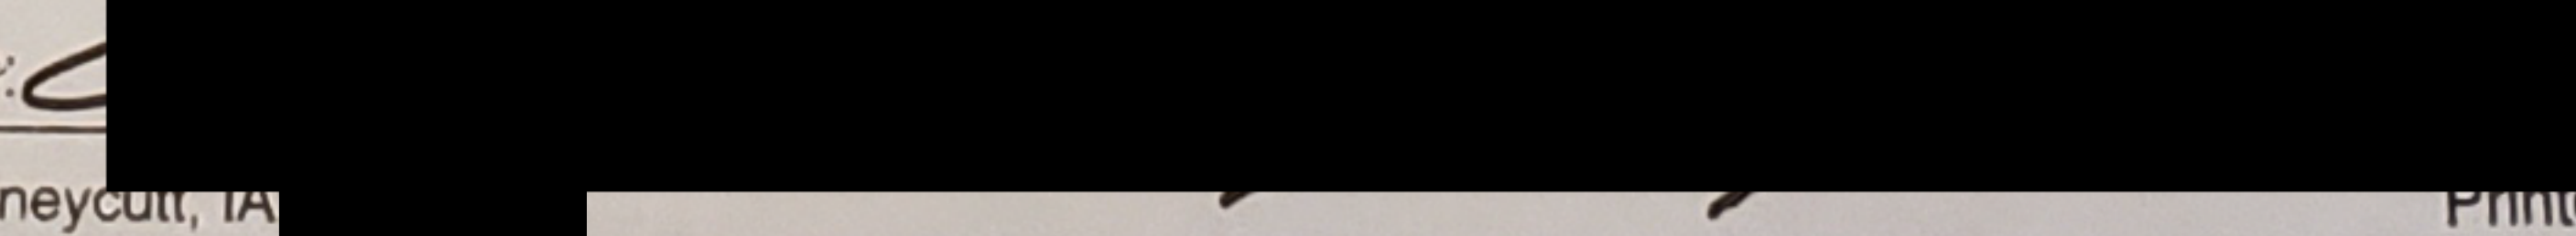


Honeycutt Aviation, Inc.


Left Engine Entries

Installed serviceable tach drive cover 631056A1 inspected and supplied by RAM Engines IAW Continental Manual M-16. Function and leak checked good.

DATE: 8/1/2018

SIGNED: 

Daniel Honeycutt, IA

Work Order: 10460-07-2018

Printed by EBis 3 (datcomedia.com)

Page No.		TOTAL TIME IN SERVICE		TOTAL TIME SINCE OVERHAUL		TACH OR RECORDING METER TIME		DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATION NO. OF PERSON PERFORMING WORK	
DATE		Honeycutt Aviation, Inc.		Honeycutt Aviation, Inc.		Honeycutt Aviation, Inc.		DATE: 3/18/2019 A/C TSN: 1917 9 ENG TT (L): 1920 2 TSMOH (L): 296 9 HOBBS: 1917 9	
ENGINE MODEL: 10-550-C ENGINE S/N (L): 686508 REG. NO. 959CM WORK ORDER: 10553-01-2019		I certify that this engine has been inspected in accordance with an annual inspection and was determined to be in airworthy condition.		Installed new AA48108 oil filter. Serviced with 10 qts Phillips 20/50XC and		Work Order: 10553-01-2019		Printed by EBis 3 (datcomedia.com)	
Left Engine Entries		SIGNED: [Signature]		[Redacted]		[Redacted]		[Redacted]	
DATE: 3/18/2019		Daniel Honeycutt		[Redacted]		[Redacted]		[Redacted]	
ENGINE MODEL: 10-550-C ENGINE S/N (L): 686508 REG. NO. 959CM WORK ORDER: 10686-08-2019		Honeycutt Aviation, Inc.		Honeycutt Aviation, Inc.		Honeycutt Aviation, Inc.		DATE: 8/29/2019 A/C TSN: 1977 ENG TT (L): 1979 3 TSMOH (L): 356 HOBBS: 1977	
Left Engine Entries		I certify that this engine has been inspected in accordance with an annual inspection and was determined to be in airworthy condition.		Installed new CH48108-1 oil filter. Serviced with 10 qts Phillips 20/50XC and		Work Order: 10686-08-2019		Printed by EBis 3 (datcomedia.com)	
DATE: 8/29/2019		Daniel Honeycutt		[Redacted]		[Redacted]		[Redacted]	
SUB-TOTALS this page		TOTALS—Carry forward to next page		[Redacted]		[Redacted]		[Redacted]	

LAST ENTRY
① Ens.



RAM AIRCRAFT
The Engine Specialist
FOR CESSNA, BEECHCRAFT, & CIRRUS AIRCRAFT



ENGINE MAINTENANCE RECORDS

Aircraft Registration N 959CM

Engine Position Right

Engine Serial No. 686512

Dr. | P.O. Box 5219 | Waco Regional Airport | Waco, TX 76708 | Phone: (254) 752-8381 | Fax: (254) 752-3307 | www.ramaircraft.com



ENGINE MAINTENANCE RECORDS

Log No. _____

Aircraft Registration No. N959CM

Engine Manufacturer Continental

Model IO-550-C

Serial No. 686512

Date installed on aircraft 8/19/16

Time Between Overhauls (TBO) 1700 Hours

If used on multi-engine aircraft:

☒ Right

☐ Left

Waco Regional Airport •

Phone. (254) 752-1111

Fax

Texas 76708

2207

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATION NO. OF PERSON PERFORMING WORK
------	-----------------------	---------------------------	------------------------------	---

Date	Total Time In Service	Total Time Since Overhaul	Tach or Recording Meter Time
8/4/16	1623.3	0.0	



CONTINENTAL IO-550-C Right Engine S/N 686512

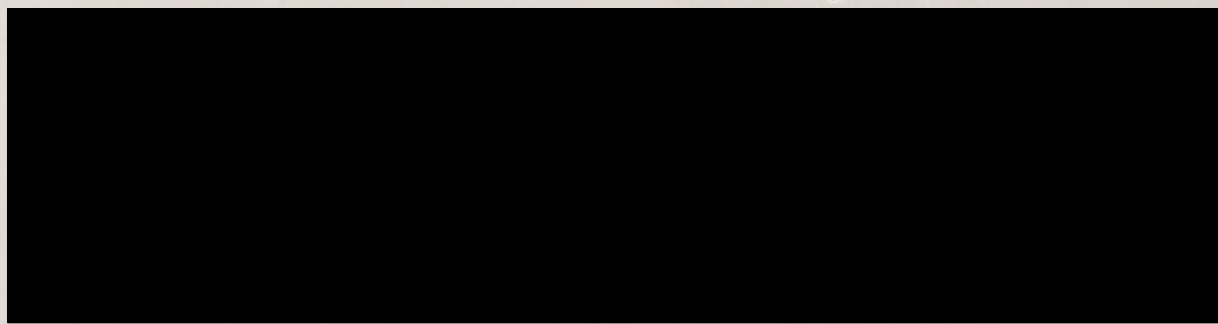
Above referenced engine overhauled to new parts limits per FAR 43.2(a)(1)(2) to conform w/ CMI (M-16), Continental M-O, Standard Practice Maintenance Manual. Applicable AD's and Service Bulletins C/W at this time. All gears cleaned, polished when required, inspected, magnetic particle inspected, and no cracks found. Finish and dimensional limits within RAM Gear Inspection Specification No. 1818, Rev. M dated 01/18/2016. Installed new RAM camshaft p/n 1058-1A, s/n XD15053 as direct PMA replacement of Continental camshaft. Installed lifters p/n SA628488 int. p/n SA646277 exh. AD 10-11-04 n/a to lifter p/n installed. AD 97-26-17 c/w per installation of overhauled VAR crankshaft p/n 649900, s/n A301M4 per TCM CSB96-8. C/W ultrasonic inspection per MSB96-10B, due at next overhaul or when crankshaft removed. AD 99-19-01 c/w and found n/a per crankshaft date of manufacture I/A/W TCM MSB99-3C. AD 2000-23-21 N/A to crankshaft serial number/date of manufacture I/A/W TCM Mandatory Service Bulletin MSB00-5D. Engine assembled with overhauled Continental heavy style crankcase p/n 646613-1, s/n J139408R. Installed new Superior Steel Cylinders. Installed overhauled oil cooler p/n 635996, s/n G93-1540-73. Engine accessories exchanged for overhauled or new units with exception of prop governor, tach generator, alternator and vacuum pump which were not installed per this work order. Slick magnetos p/n 6310 installed. Service Bulletin SB3-08A N/A to magneto serial numbers installed. SB1-12 Slick Points assy. N/A per S/N. MSB94-8D on magneto timing procedure c/w per timing to data plate TC degree requirements with TDC locator and protractor with pointer. Installed RAM/FAA/PMA rocker arms p/n 1842-3 and 1842-4. C/W AD 95-03-14 per installation of new style engine mount brackets p/n 653305 and 653306; this terminates inspection requirements of this AD. Category 1 thru 3 CMI Service Bulletin Compliance Listing in RAM Manual. Installed RAM-FAA-PMA rocker arm cover gaskets p/n 1387-1. Installed RAM/FAA/PMA spring loaded induction clamps p/n 1170-2 and double clamp p/n 1170-5. Engine ground run on test stand per RAM specifications for a minimum of 2.25 hours. Engine run-in with Aeroshell 100 Mineral oil. See RAM Recommended Oil Grade Maintenance Tip MT-1 for recommended oils. Engine approved for return to service for the work performed. Engine preserved per Continental M-O, Standard Practice Maintenance Manual temp. storage up to 90 days. Pertinent details on file under B...

RAM Aircraft, Limited Partnership [Redacted] 76708 CR [Redacted]

ENGINE MODEL: IO-550-C
ENGINE S/N (R): 686512
G. NO: 959CM
WORK ORDER: 10075-07-2016



Honeycutt Aviation, Inc.



DATE: 8/19/2016
A/C TSN: 1621
ENG TT (R): 1623.3
HOBBS: 1590.8

Right Engine Entries

Called RAM Aircraft overhauled IO-550-C engine S/N-686512 on right side of aircraft. Installed new Lord engine mounts. Performed post maintenance functional checks. No defects noted.
Propeller governor B210800 S/N- 1994642 was overhauled by American Propeller. Installed on right engine and performed functional checks. No defects noted.
Removed original alternator p/n 649304, s/n A3088.11 and installed new alternator p/n ALV-9610, s/n H-Q061244. Tested and installed drive coupling in accordance TCM Manual X30531-4.

E: 8/19/2016

SIGNED: [Redacted]
Daniel Honeycutt, IA:

Work Order: 10075-07-2016

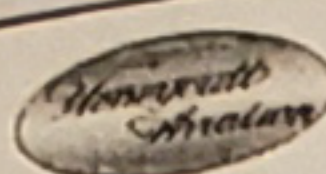
Printed by EBis 3 (datcomedia.com)

SUB-TOTALS this page

TOTALS—Carry forward to next page

Page No. _____

ENGINE MODEL IO-550-C
ENGINE S/N (R) 686512
REG NO 959CM
WORK ORDER 10174-01-2017



Honeycutt Aviation, Inc.

DATE: 3/18/2017
A/C TSN: 1666
ENG TT (R): 1668.3
TSMOH (R): 45
HOBBS: 1666

Right Engine Entries

I certify that this engine has been inspected in accordance with an annual inspection and was determined to be in airworthy condition.
Performed oil & filter change. Drained oil, cut and inspected oil filter, no defects noted. Installed new AA48108 oil filter. Serviced with 11 qts Aeroshell 100W Plus. No leaks noted after run-up.
AD 16-16-12 ECI Class 71 or 76 cylinder assembly failure N/A. No ECI cylinders installed
Timed right magneto to match left magneto at 22 degrees BTDC
The left exhaust manifold PN#96-950004-29 repaired by Knisley Welding

SIGNED: _____

Work Order: 10174-01-2017

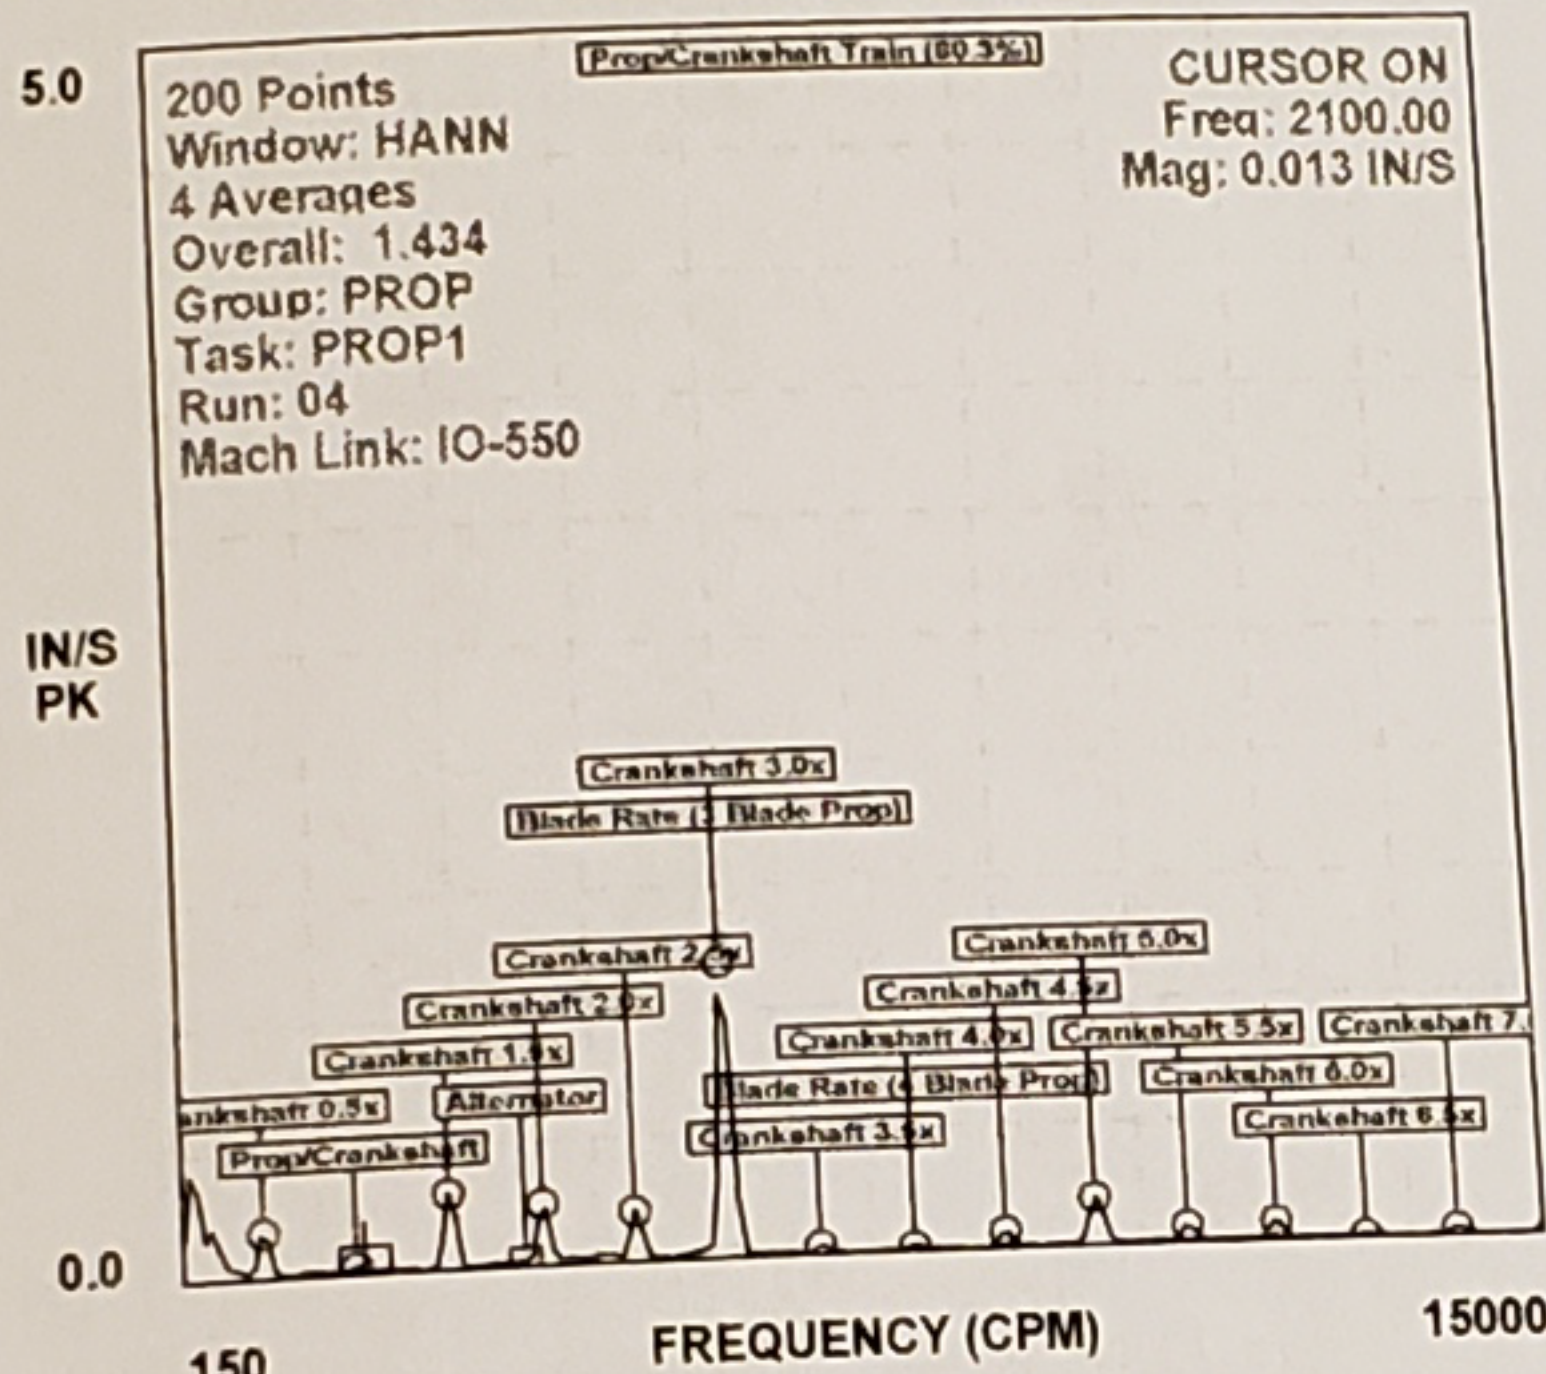
Printed by EBis 3 (datcomedia.com)

DATE: 3/18/2017

ENGINE SPECTRUM ANALYSIS

----- SPECTRUM AVERAGE PLOT -----

Operator Comments

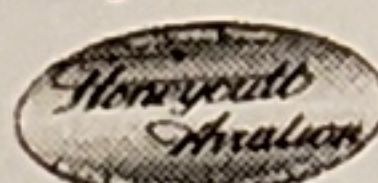


N959CM 58 TH-1792 1666.0 Hrs
IO-550-C 686512

MicroVib II

Oper: _____
Date: 03/02/2017

Daniel Honeycutt



Honeycutt Aviation, Inc.

ENGINE MODEL: IO-550-C
ENGINE S/N (R): 686512
REG NO: 959CM
WORK ORDER: 10214-04-2017

DATE: 4/25/2017
A/C TSN: 1688
ENG TT (R): 1690.3
TSMOH (R): 67
HOBBS: 1688

Right Engine Entries

Installed new clamp and bracket PN# 58-940039-0001 on induction for prop gov control cable assembly. Ops check good.
Tightened right engine oil pressure adjust housing and safetied.

SIGNED: _____

Work Order: 10214-04-2017

Printed by EBis 3 (datcomedia.com)

Daniel Honeycutt, IA _____

SUB-TOTALS this page

TOTALS—Carry forward to next page

Page No. _____

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATION NO. OF PERSON PERFORMING WORK
------	-----------------------	---------------------------	------------------------------	---

ENGINE MODEL: IO-550-C
ENGINE S/N (R): 686512
REG. NO: 959CM
WORK ORDER: 10256-07-2017



Honeycutt Aviation, Inc.

[Redacted Signature]

DATE: 7/7/2017
A/C TSN: 1727.1
ENG TT (R): 1729.4
TSMOH (R): 106.1
HOBBS: 1727.1

Right Engine Entries

Performed oil & filter change. Drained oil, cut and inspected oil filter, no defects noted. Installed new AA48108-2 oil filter. Serviced with 11 qts Aeroshell 100W Plus. No leaks noted after run-up.

DATE: 7/7/2017

SIGNED:

Daniel Honeycutt, IA

Work Order: 10256-07-2017
Printed by EBis 3 (datcomedia.com)

ENGINE MODEL: IO-550-C
ENGINE S/N (R): 686512
REG. NO: 959CM
WORK ORDER: 10332-12-2017



Honeycutt Aviation, Inc.

[Redacted Signature]

DATE: 12/8/2017
A/C TSN: 1782
ENG TT (R): 1784.3
TSMOH (R): 161
HOBBS: 1782

Right Engine Entries

Performed oil & filter change. Drained oil, cut and inspected oil filter, no defects noted. Installed new AA48108 oil filter. Serviced with 11 qts Aeroshell 100W Plus. No leaks noted after run-up.

DATE: 12/8/2017

SIGNED:

Daniel Honeycutt, IA

Work Order: 10332-12-2017
Printed by EBis 3 (datcomedia.com)

ENGINE MODEL: IO-550-C
ENGINE S/N (R): 686512
REG. NO: 959CM
WORK ORDER: 10359-01-2018



Honeycutt Aviation, Inc.

[Redacted Signature]

DATE: 3/9/2018
A/C TSN: 1795.2
ENG TT (R): 1797.5
TSMOH (R): 174.2
HOBBS: 1795.2

Right Engine Entries

I certify that this engine has been inspected in accordance with an annual inspection and was determined to be in airworthy condition.
Performed oil & filter change. Drained oil, cut and inspected oil filter, no defects noted. Installed new AA48108 oil filter. Serviced with 11 qts Aeroshell 100W Plus. No leaks noted after run-up.
Installed new de-ice brushes on right engine. P/N: C-40256-1 and C-40256-2.
Set timing of right magneto to match left at 22° BTDC

DATE: 3/9/2018

SIGNED:

Daniel Honeycutt, IA

Work Order: 10359-01-2018
Printed by EBis 3 (datcomedia.com)

ENGINE MODEL: IO-550-C
ENGINE S/N (R): 686512
REG. NO: 959CM
WORK ORDER: 10386-03-2018



Honeycutt Aviation, Inc.

1489 Sky Harbor Dr.
Olivehurst, CA 95961
Phone: (530) 741-1345

DATE: 4/4/2018
A/C TSN: 1795.2
ENG TT (R): 1797.5
TSMOH (R): 174.2
HOBBS: 1795.2

Right Engine Entries

Installed new tach generator P/N: 102-389015-5 S/N: 6121B on right engine. Functional and leak tested good.

DATE: 4/4/2018

SIGNED:

Daniel Honeycutt, IA

Work Order: 10386-03-2018
Printed by EBis 3 (datcomedia.com)

ENGINE MODEL: IO-550-C
ENGINE S/N (R): 686512
REG. NO: 959CM
WORK ORDER: 10545-12-2018



Honeycutt Aviation, Inc.

1489 Sky Harbor Dr.
Olivehurst, CA 95961
Phone: (530) 741-1345

DATE: 1/21/2019
A/C TSN: 1911.6
ENG TT (R): 1913.9
TSMOH (R): 290.6
HOBBS: 1911.6

Right Engine Entries

Installed new Superior Airparts Millennium cylinder assembly SA52006-A23P S/N: 526L1836452 at #4 location IAW Continental Manual M-16. Performed functional check. No defects noted.

DATE: 1/21/2019

SIGNED:

Daniel Honeycutt, IA

Work Order: 10545-12-2018
Printed by EBis 3 (datcomedia.com)

Page No. _____

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATION NO. OF PERSON PERFORMING WORK
ENGINE MODEL: IO-550-C ENGINE S/N (R): 686512 REG. NO. 959CM WORK ORDER: 10553-01-2019				Honeycutt Aviation, Inc. [Redacted Signature] DATE: 3/18/2019 A/C TSN: 1917.9 ENG TT (R): 1920.2 TSMOH (R): 296.9 HOBBS: 1917.9
Right Engine Entries I certify that this engine has been inspected in accordance with an annual inspection and was determined to be in airworthy condition. Performed oil & filter change. Drained oil, cut and inspected oil filter, no defects noted. Installed new AA48108 oil filter. Serviced with 10 qts Phillips 20/50XC and added 1 pint of CamGuard. No leaks noted after run-up. Installed all new RHB32E spark plugs.				
SIGNED: [Redacted Signature] Daniel Honeycutt				Work Order: 10553-01-2019 Printed by EBis 3 (datcomedia.com)
DATE: 3/18/2019				



Sonoma
JET CENTER

Sonoma Jet Center

Santa Rosa, Ca. 95403

Date: 4/19/2019; Aircraft: N959CM; Type: Beechcraft; Hobbs: 1931.00; Engine - Type: ,
S/N: Replaced right engine Starter P/N MHJ-4003 S/N H-[Redacted]

Stuart Vos A&P [Redacted Signature]

ENGINE MODEL: IO-550-C
ENGINE S/N (R): 686512
REG. NO. 959CM
WORK ORDER: 10686-08-2019

Honeycutt Aviation, Inc.

DATE: 8/29/2019
A/C TSN: 1977
ENG TT (R): 1979.3
TSMOH (R): 356
HOBBS: 1977

Right Engine Entries

I certify that this engine has been inspected in accordance with an annual inspection and was determined to be in airworthy condition.
Performed oil & filter change. Drained oil, cut and inspected oil filter, no defects noted. Installed new CH48108-1 oil filter. Serviced with 10 qts Phillips 20/50XC and added 1 pint of CamGuard. No leaks noted after run-up.

SIGNED: [Redacted Signature]
Daniel Honeycutt

Work Order: 10686-08-2019
Printed by EBis 3 (datcomedia.com)

DATE: 8/29/2019

SUB-TOTALS this page

TOTALS—Carry forward to next page

LAST
Entry
(R)