

**Aero Diesel Aviation**

Repair Station No. 6KFR481C

Pompano Beach, FL

Phone:

Email:

AERO DIESEL AVIATION:

Date: 6/29/2020, 9:45 AM

CUSTOMER INFORMATION

conquest cargo

Wilmington, DE

Reg. No: N900dt

1969 Aero Commander 500 S

Current A/C TT: , Tach:

A/C Serial: 3056

Created on: 5/15/2020

Customer Estimate**Work Order: 0815-05-2020****AUTHORIZE**☒ Yes ☐ No**Item: 1 - Airworthy****Discrepancy & Corrective Action**

TACH AND HOBBS

Hours

N/C

Subtotal

0.00

AIRCRAFT TACH TIME:

HOBBS:881.9

Labor: \$0.00

Parts: \$0.00

Shipping: \$0.00

Item Subtotal: \$0.00

AUTHORIZE☒ Yes ☐ No**Item: 2 - Airworthy****Discrepancy & Corrective Action**

ANNUAL INSPECTION AIRFRAME

Hours

Flat

Subtotal

C/W ANNUAL INSPECTION ON THIS AIRFRAME IAW FAR 43 APPENDIX D USING AERO COMMANDER 500 S MM CH 5 INSP CHECKLIST AS A GUIDE. ALL AD's ARE CHECKED AND CURRENT TO THIS DATE.

Labor:

Parts: \$0.00

Shipping: \$0.00

Item Subtotal:

AUTHORIZE☒ Yes ☐ No**Item: 3 - Airworthy****Discrepancy & Corrective Action**

ANNUAL INSPECTION RH ENGINE

Hours

N/C

Subtotal

0.00

C/W ANNUAL INSPECTION ON THIS ENGINE IAW FAR 43 APPENDIX D USING LYCOMING INSP CHECKLIST AS A GUIDE. ADS CHECKED THROUGH CURRENT ON ATP. PERFORMED COMPRESSION CHECK #1-78 #2-78 #3-78 #4-78 #5-78 #6-78 /80PSI. REMOVED CLEANED, GAPPED CHECKED ALL SPARK PLUGS. POST MAINTENANCE ENGINE RUN AND LEAK CHECK GOOD.

Qty	Unit	Part Number	Description	Unit Price	Subtotal
1	EA	CH48110-1	OIL FILTER (Taxed) (Retail Price:)		
12	EA	ELITE AVIATION OIL 20W-50	OIL (Taxed) (Retail Price:)		
12	EA	M674	SPARK PLUG COPPER GASKET (USED 13 NEED 11 MORE) (Taxed) (Retail Price:)		

Labor: \$0.00

Parts:

Shipping: \$0.00

Item Subtotal:

Pd. 7/8/2020-

POSTED

AUTHORIZE
☒ Yes ☐ No

Item: 4 - Airworthy

Discrepancy & Corrective Action
ANNUAL INSPECTION LH ENGINE

Hours Subtotal
N/C 0.00

C/W ANNUAL INSPECTION ON THIS ENGINE IAW FAR 43 APPENDIX D USING LYCOMING INSP CHECKLIST AS A GUIDE. ADS CHECKED THROUGH CURRENT ON ATP. PERFORMED COMPRESSION CHECK #1-75 #2-78 #3-78 #4-76 #5-78 #6-74 /80PSI. REMOVED CLEANED, GAPPED CHECKED ALL SPARK PLUGS. POST MAINTENANCE ENGINE RUN AND LEAK CHECK GOOD.

Qty	Unit	Part Number	Description	Unit Price	Subtotal
1	EA	CH48110-1	OIL FILTER (Taxed) (Retail Price: [REDACTED])	[REDACTED]	[REDACTED]
12	EA	ELITE AVIATION OIL 20W-50	OIL (Taxed) (Retail Price: [REDACTED])	[REDACTED]	[REDACTED]
12	EA	M674	SPARK PLUG COPPER GASKET (Taxed) (Retail Price: [REDACTED])	[REDACTED]	[REDACTED]

Labor: \$0.00 Parts: [REDACTED] Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 5 - Airworthy

Discrepancy & Corrective Action
ANNUAL INSPECTION RH PROPELLER

Hours Subtotal
N/C 0.00

C/W ANNUAL INSPECTION ON THIS PROPELLER IAW FAR 43 APPENDIX D USING HARTZEL MM INSP CHECKLIST AS A GUIDE. ADS CHECKED THROUGH CURRENT ON ATP. OPS CHECK GOOD.

Labor: \$0.00 Parts: \$0.00 Shipping: \$0.00 Item Subtotal: \$0.00

AUTHORIZE
☒ Yes ☐ No

Item: 6 - Airworthy

Discrepancy & Corrective Action
ANNUAL INSPECTION LH PROPELLER

Hours Subtotal
N/C 0.00

C/W ANNUAL INSPECTION ON THIS PROPELLER IAW FAR 43 APPENDIX D USING HARTZEL MM INSP CHECKLIST AS A GUIDE. ADS CHECKED THROUGH CURRENT ON ATP. OPS CHECK GOOD.

Labor: \$0.00 Parts: \$0.00 Shipping: \$0.00 Item Subtotal: \$0.00

AUTHORIZE
☒ Yes ☐ No

Item: 7 - Airworthy

Discrepancy & Corrective Action
EMERGENCY NITRO BOTTLE HAS A LEAK.

Hours Subtotal
3.00 [REDACTED]

SYSTEM HAS BEEN SERVICED TO CHECK FOR LEAKS

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 8 - Airworthy

Discrepancy & Corrective Action
NLG SELF CENTERING NEEDS CHECKED

Hours Subtotal
2.00 [REDACTED]

NLG SELF CENTERING WORKING PROPERLY AFTER OPS CHECK. NO DEFECTS NOTED AT THIS TIME.

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 9 - Airworthy

Discrepancy & Corrective Action

RH MLG BUNGEE NEED REPLACED

Hours Subtotal
2.00 [REDACTED]

Qty	Unit	Part Number	Description
2	EA	9044	BUNGEE (REF P/N #52504) (Taxed)

Unit Price Subtotal
[REDACTED] [REDACTED]

Labor: [REDACTED] Parts: [REDACTED] Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 10 - Airworthy

Discrepancy & Corrective Action

LH MLG BUNGEE NEED REPLACED

Hours Subtotal
2.00 [REDACTED]

Qty	Unit	Part Number	Description
2	EA	9044	BUNGEE (REF P/N #52504) (Taxed)

Unit Price Subtotal
[REDACTED] [REDACTED]

Labor: [REDACTED] Parts: [REDACTED] Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 11 - Airworthy

Discrepancy & Corrective Action

GPS NAV DATA NEEDS UPDATED

Hours Subtotal
0.00 0.00

QSR AVIONICS SHOP

Labor: \$0.00 Parts: \$0.00 Shipping: \$0.00 Item Subtotal: \$0.00

AUTHORIZE
☒ Yes ☐ No

Item: 12 - Airworthy

Discrepancy & Corrective Action

RUDDER TRIM WHEEL LOOSE

Hours Subtotal
0.50 [REDACTED]

ATTACHED AS NEEDED. OPS CHECK GOOD.

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 13 - Airworthy

Discrepancy & Corrective Action

INSTR. PANEL FLOOD LIGHTS INOP

Hours Subtotal
1.00 [REDACTED]

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 14 - Airworthy

Discrepancy & Corrective Action

SUCTION GAUGE LIGHTS INOP

Hours Subtotal
1.00 [REDACTED]

Qty	Unit	Part Number	Description
2	EA	GE327	BULB (Taxed) (Retail Price: [REDACTED])

Unit Price Subtotal
[REDACTED] [REDACTED]

Labor: [REDACTED] Parts: [REDACTED] Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 15 - Airworthy

Discrepancy & Corrective Action

HYDR. PRESS. GAUGE LIGHTS INOP

Hours Subtotal
 1.00 [REDACTED]

Qty	Unit	Part Number	Description
2	EA	GE327	BULB (Taxed) (Retail Price [REDACTED])

Unit Price Subtotal
 [REDACTED] [REDACTED]

Labor: [REDACTED] Parts: [REDACTED] Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 16 - Airworthy

Discrepancy & Corrective Action

ARTIFICIAL HORIZ. GAUGE RH LIGHT INOP

Hours Subtotal
 1.00 [REDACTED]

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 17 - Airworthy

Discrepancy & Corrective Action

RH EGT NEEDS CHECKED. GAUGE READS LOW

Hours Subtotal
 1.50 [REDACTED]

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 18 - Airworthy

Discrepancy & Corrective Action

RUDDER TRIM HAS LESS TRAVEL TO THE RIGHT. CHECK.

Hours Subtotal
 1.50 [REDACTED]

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 19 - Airworthy

Discrepancy & Corrective Action

ELEVATOR TRIM GAUGE INDICATION ERRATIC. GAUGE MIGHT NEED SENT OUT AFTER TROUBLESHOOT.

Hours Subtotal
 2.00 [REDACTED]

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 20 - Airworthy

Discrepancy & Corrective Action

NAV LIGHT LH (RED) INOP.

Hours Subtotal
 1.00 [REDACTED]

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 21 - Airworthy

Discrepancy & Corrective Action

COMPASS FLUID LOW

Hours Subtotal
 0.50 [REDACTED]

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 22 - Airworthy

Discrepancy & Corrective Action

LH ENGINE PROP GOV. CABLE FRAYED. PLEASE CHECK AND ADVISE ON HOW TO PROCEED.

Hours Subtotal
 0.00 0.00

Labor: \$0.00 Parts: \$0.00 Shipping: \$0.00 Item Subtotal: \$0.00

AUTHORIZE
☒ Yes ☐ No

Item: 23 - Airworthy

Discrepancy & Corrective Action

LH ENGINE ALT AIR LEVER HARD TO PULL. CLEAN AND LUBE

Hours
0.50

Subtotal
[REDACTED]

REPAIRED AS NEEDED BY CLEANING AND LUBRICATING. OPS CHECK GOOD

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 24 - Airworthy

Discrepancy & Corrective Action

RH ENGINE ALT AIR LEVER HARD TO PULL. CLEAN AND LUBE

Hours
0.50

Subtotal
[REDACTED]

REPAIRED AS NEEDED BY CLEANING AND LUBRICATING. OPS CHECK GOOD

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 25 - Airworthy

Discrepancy & Corrective Action

RH ENGINE UPPER COWL CAM LOCKS RUSTY

Hours
2.00

Subtotal
[REDACTED]

Qty	Unit	Part Number	Description
24	EA	2600-6	CAM LOC STUD (Taxed)
24		4002-H	FLUSH GROMMET (Taxed)

Unit Price

Subtotal

Labor: [REDACTED] Parts: [REDACTED] Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 26 - Airworthy

Discrepancy & Corrective Action

LH ENGINE UPPER COWL CAM LOCKS RUSTY

Hours
2.00

Subtotal
[REDACTED]

Qty	Unit	Part Number	Description
24	EA	2600-6	CAM LOC STUD (Taxed)
24		4002-H	FLUSH GROMMET (Taxed)

Unit Price

Subtotal

Labor: [REDACTED] Parts: [REDACTED] Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 27 - Airworthy

Discrepancy & Corrective Action

RH WING NAV LIGHT CABLE RUBBING ON RIB IN 3 SECTIONS NEW RUBBER GROMMETS NEEDED (FLAGGED)

Hours
1.00

Subtotal
[REDACTED]

SECURED AND CORRECTED AS NEEDED. OPS CHECK GOOD

Qty	Unit	Part Number	Description
1	EA	RG56	GROMMET (Taxed) (Retail Price [REDACTED])

Unit Price

Subtotal

Labor: [REDACTED] Parts: [REDACTED] Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 28 - Airworthy

Discrepancy & Corrective Action

LH WING NAV LIGHT CABLE RUBBING ON RIB NEW RUBBER GROMMETS NEEDED (FLAGGED)

Hours
0.50

Subtotal
[REDACTED]

SECURED AND CORRECTED AS NEEDED. OPS CHECK GOOD

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 29 - Airworthy

Discrepancy & Corrective Action

LH FLAP CABLE TURNBUCKLE IN AFT LH ENGINE COWL HAS INCORRECT LOCKING PIN

Hours Subtotal
 1.00 [REDACTED]

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 30 - Airworthy

Discrepancy & Corrective Action

RUDDER TRIM CABLE CHAFFING ON RUDDER BRACKET

Hours Subtotal
 1.00 [REDACTED]

CORRECTED AS NEEDED BY INSTALLING PLASTIC HOSE GUARD. OPS CHECK GOOD.

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 31 - Airworthy

Discrepancy & Corrective Action

RH NOSE VENT SCAT HOSE NEEDS REPLACED

Hours Subtotal
 1.00 [REDACTED]

REPLACED RH NOSE VENT DUCT P/N: BE-004 IAW AERO COMMANDER 500 MM: SECTION X CH 10-2 - 10-4 AS A GUIDE. OPS CHECK GOOD.

Qty	Unit	Part Number	Description	Unit Price	Subtotal
1	EA	BE-004	DUCT(05399) (Taxed)	[REDACTED]	[REDACTED]

Labor: [REDACTED] Parts: [REDACTED] Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 32 - Airworthy

Discrepancy & Corrective Action

LH NOSE VENT SCAT HOSE NEEDS REPLACED

Hours Subtotal
 1.00 [REDACTED]

REPLACED LH NOSE VENT DUCT P/N: BE-004 IAW AERO COMMANDER 500 MM: SECTION X CH 10-2 - 10-4 AS A GUIDE. OPS CHECK GOOD.

Qty	Unit	Part Number	Description	Unit Price	Subtotal
1	EA	BE-004	DUCT(05399) (Taxed)	[REDACTED]	[REDACTED]

Labor: [REDACTED] Parts: [REDACTED] Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 33 - Airworthy

Discrepancy & Corrective Action

NOSE HEATER INLET HOSE NEEDS REPLACED

Hours Subtotal
 1.00 [REDACTED]

REPLACED RH NOSE VENT DUCT P/N: BE-004 IAW AERO COMMANDER 500 MM: SECTION X CH 10-2 - 10-4 AS A GUIDE. OPS CHECK GOOD.

Qty	Unit	Part Number	Description	Unit Price	Subtotal
1	EA	BE685-16-104-9	HEATER DUCT HOSE (05399) (Taxed)	[REDACTED]	[REDACTED]
1	EA	BE-006	DUCT(05399) (Taxed)	[REDACTED]	[REDACTED]

Labor: [REDACTED] Parts: [REDACTED] Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE
☒ Yes ☐ No

Item: 34 - Airworthy

Discrepancy & Corrective Action

NLG SCISSOR LINK HAS EXCESSIVE PLAY IN ALL JOINTS
 "LOOKING FOR NOS PART

Hours Subtotal
 1.50 [REDACTED]

Labor: [REDACTED] Parts: \$0.00 Shipping: \$0.00 Item Subtotal: [REDACTED]

AUTHORIZE ☒ Yes ☐ No		Item: 35 - Airworthy				
Discrepancy & Corrective Action NLG SCISSOR LINK NEEDS PAINT					Hours 1.50	Subtotal [REDACTED]
Labor: [REDACTED]		Parts: \$0.00		Shipping: \$0.00		Item Subtotal: [REDACTED]

AUTHORIZE ☒ Yes ☐ No		Item: 36 - Airworthy				
Discrepancy & Corrective Action LH BRAKE BACKING PLATES HAVE CORROSION					Hours 2.00	Subtotal [REDACTED]
Labor: [REDACTED]		Parts: \$0.00		Shipping: \$0.00		Item Subtotal: [REDACTED]

AUTHORIZE ☒ Yes ☐ No		Item: 37 - Airworthy				
Discrepancy & Corrective Action RH BRAKE BACKING PLATES HAVE CORROSION					Hours 2.00	Subtotal [REDACTED]
Labor: [REDACTED]		Parts: \$0.00		Shipping: \$0.00		Item Subtotal: [REDACTED]

AUTHORIZE ☒ Yes ☐ No		Item: 38 - Airworthy				
Discrepancy & Corrective Action RH BRAKE CALIPER SEALS LEAKING. NEED TO CONFIRM CORRECT SEAL P/N					Hours 1.50	Subtotal [REDACTED]
Qty	Unit	Part Number	Description	Unit Price	Subtotal	
4	EA	101-24200	O RING SUPERSEDED# MS28775-227 (Taxed)	[REDACTED]	[REDACTED]	
Labor: [REDACTED]		Parts: [REDACTED]		Shipping: \$0.00		Item Subtotal: [REDACTED]

AUTHORIZE ☒ Yes ☐ No		Item: 39 - Airworthy				
Discrepancy & Corrective Action NLG STEERING FRICTION PADS NEED REPLACED					Hours 1.00	Subtotal [REDACTED]
Qty	Unit	Part Number	Description	Unit Price	Subtotal	
4	EA	4057	SPRING (Taxed)	[REDACTED]	[REDACTED]	
1	EA	9935-1	COLLAR HALF AFT 9935-1 AND COLLAR HALF FWD 9935-3 NOW SOLD AS A ASSY (Taxed)	[REDACTED]	[REDACTED]	
1	EA	9935-3	COLLAR HALF FWD (Taxed)	0.00	0.00	
2	EA	9937	SHOE (Taxed)	[REDACTED]	[REDACTED]	
Labor: [REDACTED]		Parts: [REDACTED]		Shipping: \$0.00		Item Subtotal: [REDACTED]

AUTHORIZE ☒ Yes ☐ No		Item: 40 - Airworthy				
Discrepancy & Corrective Action LH LOWER BRAKE HOSE DATED 2005					Hours 0.00	Subtotal 0.00
Labor: \$0.00		Parts: \$0.00		Shipping: \$0.00		Item Subtotal: \$0.00

AUTHORIZE ☒ Yes ☐ No		Item: 41 - Airworthy				
Discrepancy & Corrective Action RH LOWER BRAKE HOSE DATED 2005					Hours 0.00	Subtotal 0.00
Labor: \$0.00		Parts: \$0.00		Shipping: \$0.00		Item Subtotal: \$0.00

AUTHORIZE
☒ Yes ☐ No

Item: 42 - Airworthy

Discrepancy & Corrective Action

RECOMMEND HYDRAULIC HOSE REPLACEMENT LH ENGINE DUE TO EXCESSIVE DRY ROT

Hours	Subtotal
0.00	0.00

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------	---------------	------------------	-----------------------

AUTHORIZE
☒ Yes ☐ No

Item: 43 - Airworthy

Discrepancy & Corrective Action

RECOMMEND HYDRAULIC HOSE REPLACEMENT LH ENGINE DUE TO EXCESSIVE DRY ROT

Hours	Subtotal
0.00	0.00

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------	---------------	------------------	-----------------------

AUTHORIZE
☒ Yes ☐ No

Item: 44 - Airworthy

Discrepancy & Corrective Action

BATTERY TRAY NEEDS STRIPPED AND PAINTED DUE TO BATTERY ACID.

Hours	Subtotal
2.50	[REDACTED]

CORROSION TREATED AS NEEDED IAW FAA AC 43-4B SEC 5 ALUMINUM AND ALUMINUM ALLOYS
 USING APPROVED AVIATION ZINC PRIMER AND APPROVED AVIATION GLOSS BLACK PAINT. OPS
 CHECK GOOD.

Labor: [REDACTED]	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: [REDACTED]
-------------------	---------------	------------------	---------------------------

AUTHORIZE
☒ Yes ☐ No

Item: 45 - Airworthy

Discrepancy & Corrective Action

RH MLG ACTUATOR OUTER HAS POSSIBLE LEAK

Hours	Subtotal
0.00	0.00

CLEANED ACTUATOR OF GREASE AND DIRT AND AFTER GEAR RETRACTION NO VISIBLE LEAK
 FOUND AT THIS TIME. OPS CHECK GOOD.

Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------	---------------	------------------	-----------------------

AUTHORIZE
☒ Yes ☐ No

Item: 46 - Airworthy

Discrepancy & Corrective Action

RH MLG SCISSOR LINK HAS PLAY IN CENTER BOLT. (CHECK FOR PROPER H/W INSTALLATION)

Hours	Subtotal
1.00	[REDACTED]

Qty	Unit	Part Number	Description	Unit Price	Subtotal
2	EA	ED11060	BUSHING (Taxed)	[REDACTED]	[REDACTED]
2	EA	ED11061	BUSHING (Taxed) (Retail Price: [REDACTED])	[REDACTED]	[REDACTED]

Labor: [REDACTED]	Parts: [REDACTED]	Shipping: \$0.00	Item Subtotal: [REDACTED]
-------------------	-------------------	------------------	---------------------------

AUTHORIZE
☒ Yes ☐ No

Item: 47 - Airworthy

Discrepancy & Corrective Action

NLG AXLE NEEDS REPLACED

Hours	Subtotal
1.50	[REDACTED]

Qty	Unit	Part Number	Description	Unit Price	Subtotal
1	EA	9545	AXLE (Taxed)	[REDACTED]	[REDACTED]

Labor: [REDACTED]	Parts: [REDACTED]	Shipping: \$0.00	Item Subtotal: [REDACTED]
-------------------	-------------------	------------------	---------------------------

AUTHORIZE	
☒ Yes	☐ No

Item: 48 - Airworthy

Discrepancy & Corrective Action
CORROSION X TREATMENT

Hours
Flat

Subtotal
[REDACTED]

THIS AIRCRAFT HAS BEEN TREATED WITH CORROSION X (Mil-C-81309E) TO STOP AND PREVENT CORROSION. TREATMENT IS EFFECTIVE FOR 18-24 MONTHS. RE-TREATING IS RECOMMENDED WHEN EFFECTIVENESS ENDS-AS DETERMINED BY EITHER TIME OR VISUAL INSPECTION.

Labor: [REDACTED]	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: [REDACTED]
-------------------	---------------	------------------	---------------------------

Additional Charges							Subtotal
Pilot Services	Tire Disposal	EPA Charge	Oil Analysis	Shop Supplies	Fuel	Misc.	
0.00	0.00	0.00	0.00	[REDACTED]	0.00	0.00	[REDACTED]

It will take an estimated 48.00 hours to complete the necessary work.

Total Labor:

Taxed Items:

Shop Parts, OSR Parts, Shipping In, Shop Supplies, Tire Disposal

Total Parts:

Total Shipping:

Tax Breakdown: (Before Calculated)

Shop Parts: [REDACTED]

OSR Parts: 0.00

Shipping In: 0.00

Shop Supplies: [REDACTED]

Tire Disposal: 0.00

Additional Charges:

Tax:

Total Estimate Before Deposit:

Deposits & Credits:

Total Estimate: [REDACTED]

PD. 5/19/2020 - [REDACTED]

PD. -7/8/2020 - [REDACTED]

Important Information

I hereby authorize the above repairs to be performed along with the necessary material, and hereby grant Aero Diesel Aviation Services, LLC., and/or Aero Diesel Aviation Services employee's permission to operate the aircraft herein described for the purpose of testing, inspection and or delivery. A post maintenance test flight may be necessary for this scope of work and additional charges may be incurred. A 4% consumable fee will be charged to each work order to cover miscellaneous materials. This amount will not exceed \$1,000.00. There will be a 15% handling fee charge added to the list price of any customer provided parts. Note: We do not warranty any customer provided parts. A 50% deposit is required on all estimates, regardless of customer terms, with an additional 25% estimated project total midway, and balance paid upon completion. Pre-purchase evaluations require 100% of the work scope to be paid prior to starting work on the aircraft, due to change in aircraft ownership. Once the inspection is complete, both parties, buyer and seller, will be provided a list of discrepancies with estimate for corrective action.

An express mechanics lien is hereby acknowledged on this aircraft to secure the amount of repairs thereto. Aero Diesel Aviation Services will not be responsible for loss or damage to the aircraft or articles left in the aircraft in case of fire, theft, or any cause beyond our control. If it becomes necessary for Aero Diesel Aviation Services to employ a collection agency and or an attorney to collect this account, I the undersigned, agree to pay all court costs plus reasonable attorney fees and or collection agency fees.

I agree to pay any outstanding balance due on my account prior to delivery of the aircraft unless prior arrangements have been made and agreed to by Aero Diesel Aviation Services. I authorize any unpaid charges to be charged to the credit card indicated herein if there is any balance due upon the departure of the aircraft from Aero Diesel Aviation Services. Aero Diesel Aviation Services accepts payments by credit card only subject to the agreement, acknowledged by your signature hereon, that credit cards payments are irrevocable. All credit charges will have a service fee of 4% of the total invoice. I will not cause any action to be done to rescind, cancel, make invalid or dispute any charges or payments made by credit card to Aero Diesel Aviation Services with reference to work I authorize Aero Diesel Aviation Services to perform. I acknowledge that I will promptly pay any unpaid amounts for warranty claims submitted to a third-party vendor on my behalf should such vendor deny or reduce said claim. Charges past due are subject to an 18% service charge. Credit cards limited to \$5,000 unless prior arrangements have been approved by management. Estimates do not include freight charges, applicable taxes, crew or fuel for any flight testing, or any other charges incurred due to unforeseen damages. Customers are charged travel fees for any work accomplished outside of Aero Diesel Aviation Services Hanger. Aero Diesel Aviation is not responsible for the unavailability of parts or delays in parts shipment beyond its control or any other cause beyond our control. All avionics, instruments, parts, and equipment removed from the airplane become property of Aero Diesel Aviation Services.

[REDACTED]
conquest cargo or Authorized Representative

Date

7/8/2020

CREDIT CARD INFORMATION:

[] American Express [] AMEX [] Discover [] MasterCard ☒ Visa

AMOUNT AUTHORIZED

CARD #

SECURITY CODE

EXPIRATION

NAME ON CARD (HAND WRITTEN)

SIGNATURE

Thomas P. Cooper