

DATE	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
19				

Date: 8/20/2020
Tach: 0614.5
ACTT: 5443.54

REPLACE ELT BATTERY BY:
JUN 2022

N18394

Performed annual inspection in accordance with an annual inspection as per Beechcraft manuals and forms.
Installed all new tires on left main. Treated with ACF 50 repaired step to wing.
Adjusted cow flap rigging
ELT was checked as per FAR 91.207(d) new battery installed DUE: 6/22
Checked. All AD'S thru FAA. gov data.
I certify that this aircraft was inspected in accordance with an annual inspection as per air frame and was determined to be in an airworthy condition.
Bruce Pernitza A [REDACTED] [REDACTED]

END

Date	Total Time		Time Since Last Overhaul	
	Hrs.	Min.	Hrs.	Min.

Engine Service and Maintenance Record

Installations, Inspections, Airworthiness Directives, Special Inspections, Modifications and Service Bulletins

N18394

Date: 8/20/2020
Tach: 0614.5
ACTT: 5443.54

SMOH: 866.54

Performed annual /100 Hr inspection in accordance with an annual/100 Hr from Beechcraft inspection manuals and forms. Replaced all six cylinders with New. installed new air filter P/N BA7112. Checked All AD'S thru FAA. Gov. R&R left and right Mufflers P/N 701-5 & 701-4. Installed new oil filter P/N CH48-109-1 Refilled oil with 11 Qt aeroshell 100 mineral oil. Installed new hose on oil breather. Cleaned and gaped spark plugs. Cleaned fuel injectors. I certify that this A/C has been inspected in accordance with an annual inspection as per Engine and was determined to be in an airworthy condition.
Bruce Pernitza [REDACTED]

END

ENGINE LOGBOOK ENTRY

N18394

Beech Model #A-36 Serial # E-1121
Continental Model # IO-520-BA Serial # 814459-R
Tach: 0654.9 Hrs.

Engine oil removed filter cut open and inspected for contaminants. None found. Installed Tempest AA48109 Filter and 11 Quarts Phillips 20W50X/C Engine oil. Checked for leaks none at this time.
The engine identified above was repaired & inspected IAW TCM IO-520-BA Maintenance Manual and is approved for return to service with respect to the work performed.
Details are on file at Hollingshead Aviation Services, LLC under Work Order # 25701.

[REDACTED]
Dallas R Smith

For

Hollingshead Aviation Services
[REDACTED] Smyrna, TN 37167