

The Accessories Listed Below Were Overhauled and Supplied With This Engine

ENGINE TS10-360-GB SN 309522 DATE 9-18-
P/N S/N P/N S/N

MAG. 10-72020-118 A271529

MAG. 10-79020-118 A271532

ALT./GEN. NONE

NJ. 640563-2 I248002A

FUEL PUMP 639508-6 I258010B

STARTER MCL6501 212000260

C.PUMP NONE

11033-11AC VALVE I248023C

PROPELLER NONE

PROP.GOV. NONE

TACH.GEN. NONE

TURBO CHARGER 646396 2172

WASTE GATE NONE

CONTROLLER NONE

CONTROLLER NONE

REL.VALVE 641404-1 JDO

G & N AIRCRAFT, INC.

W.O. # 45100

1 East Main St., Griffith, IN 46319
phone: (219) 924-7110

Authorized Signature

DATE 2013	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
8/17, 2013	3252.3		921.4	TS10-360-GB Ser 309522 N9514R Cylinder N° 3 was removed and replaced w/ New Assy Part N° 658189A2BP Assy Approval by DMIR 2511010-CE work Order s 329951/344017 At this Log Work done IAW Continental Engine Man and current TAA's. Engine Oil and F were changed refilled w/ 8 qts Phil X/C 20W-50. Engine Run with no Found. the above component has been Insp. and found airworthy to return to service by John A Knight
				[NK]

This is to certify that the engine described hereafter has been overhauled to manufacturer's new parts limits
Engine disassembled, cleaned, inspected and reassembled in accordance with manufacturer's overhaul instructions. All steel parts magnafluxed. Engine test run in F.A.A. approved test cell. All applicable Airworthiness Directives and Manufacturer's Service Bulletins are in compliance. A description of these repairs is on file at this agency under:

JOB NO. 45100

MFG. CONT

Serial No. 302522

DATED 9-18-92


MODEL TS10-360-GB

Time in svc. 2335.9

G & N AIRCRAFT, INC.



1701 East Main St., Griffith, IN 46319
Telephone: (219) 924-7110

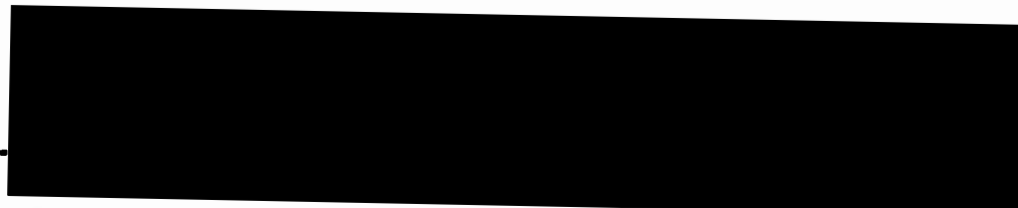

	RECORDING TACH TIME	TODAYS FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
--	---------------------------	------------------	-----------------------------	---

ENGINE MODEL:
TSIO-360-GB
ENGINE S/N: 309522
REG. NO: 9514R
WORK ORDER: 12382

Air West Aircraft Engines

670 Airport Blvd.
San Carlos, CA 94070

Repair Station No. TV3R881L

DATE: 6/28/2005

TTA:


TTE: 2707.3

TSMOH: 371.4

TACH:

Engine Entries

Repaired TCM TSIO-360-GB, s/n 309522. Disassembled, cleaned and visually inspected engine due to crankcase cracked behind fuel pump. Reassembled engine referencing TCM TSIO-360 manual part no. X30596A. Installed yellow tagged crankcase, serial no. F239407S (Crankcase Services, Inc; CSI #8817), new main bearings, new camshaft & new lifters, new seals & gaskets. Honed cylinders and reinstalled with new rings. Reinstalled magnetos, starter and alternator. Engine serviced with Aeroshell mineral oil & CH48108-1 filter. ... C/W AD 97-26-17 by crankshaft is VAR and ultrasonic inspection OK IAW TCM MSB 96-10 ...

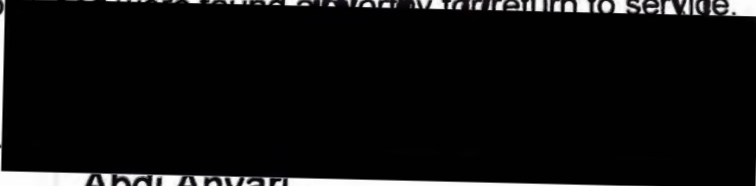The component(s) and/or discrepancy (ies) identified on this work order, to the above mentioned aircraft were repaired and inspected in accordance with current Federal Air Regulation.  found satisfactory for return to service.

DATE: 6/28/2005

WORK ORDER: 123

Abdi Anvari

Certified Repair Station No. TV3R881L

Printed by EBis (<http://www.datcomedia.com>)