



Photo 1 – Right aft view of airplane in the trees. (Courtesy of Cumberland Fire Rescue)



Photo 2 – View of right wing damage. (Courtesy of Cumberland Fire Rescue)



Photo 3 – View of propeller damage. (Courtesy of Cumberland Fire Rescue)



Photo 4 – View of right canopy frame and latch assembly without striker pin installed. Note weatherstripping.

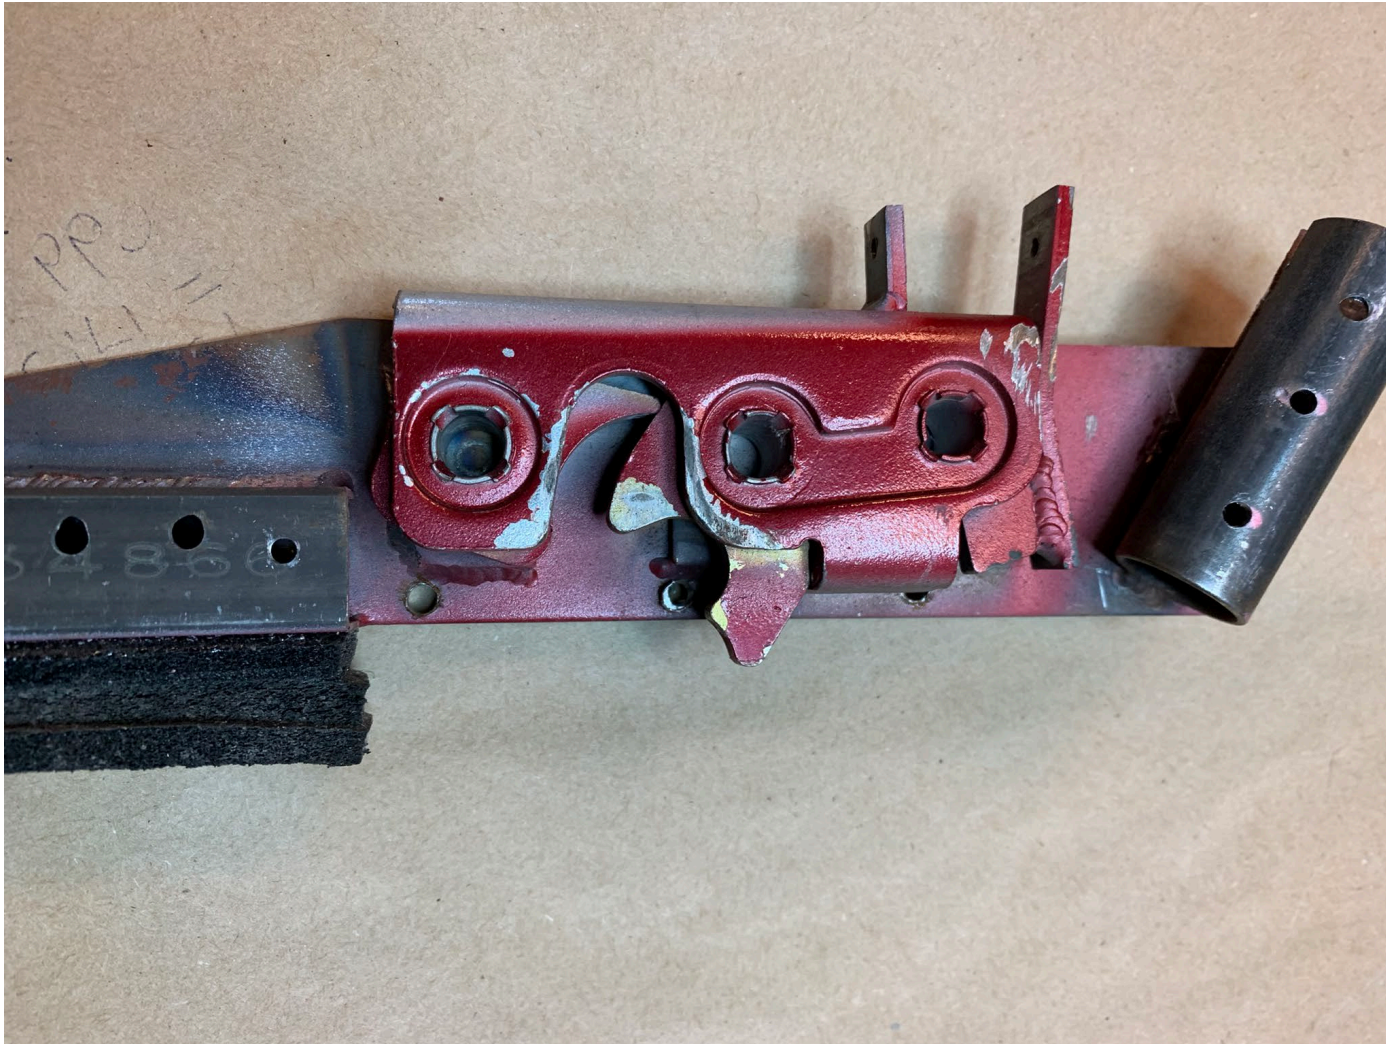


Photo 5 – Closeup view of canopy latch without striker pin. Photograph is in correct orientation.



Photo 6 – Closeup view of canopy latch with striker pin in the latch mechanism. Note fingers on the trigger for scale.



Photo 7 – Closeup view of canopy latch with striker pin ejected after applying pressure to trigger.