



Photo 1 – Left side view of glider at accident site



Photo 2 - Front view of glider at accident site



Photo 3 - Right wing with speed brake deployed



Photo 4 -Tail section with up end of the elevator connection visible between elevator and horizontal stabilizer



Photo 5 - Left side view of elevator connection (not connected)



Photo 6 - Left side view of elevator connection (connected by NTSB IIC). Note: the drill hole for the spring clip is visible below the number stamps.