

P	RECORDING	TODAY'S	TOTAL	Description of Inspections, Tests, Repairs and Alterations
N6016K			September 10, 2021	Certificate Number of (S.)
Tach: 7110.1				
		AIRCRAFT		
				Removed and replaced customer supplied left and right main gear shock disc AEC-169-380098-1 and adjusted per service manual, reinstalled main landing gear doors and performed retraction and extension tests.
				Replaced upper and lower nose gear strut bearings 169-810016-3, repaired strut tube, and replaced roll pins MS20392-2C11 and reshimmed 50-820024.
				Replaced brake hoses with customer supplied parts.
				Replaced left and right brake caliper 'o' rings MS28775-224 and serviced with 5606 hydraulic fluid.
				All work done in accordance with Beechcraft service procedures.
				This aircraft is ok for return to service in reference to work performed.
				Mack Air, LLC Shelbyville, TN
				Charles McGaughy [REDACTED] A&P-IA [REDACTED]