

AIRPLANE LOGBOOK

Date: 03/22/2021

David Wood, A&P

Date: 04/06/2022

David Wood, A&P [REDACTED] IA

[illegible]

HMT: 742.4

Date: 01/28/2022

Wash, ground run, leak check, and return to service.

A&P

HMT: 756.5

Date: 04/06/2022

Perform Annual inspection IAW FAR 43 App. D and Beechcraft G58 AMM. Lube cables. Clean & inspect air filter element. Remove spark plugs. Replace with new UHRB32S and install. Perform differential compression test with the following results: all cylinders better than 70 over 80. Remove, clean, flow check, and reinstall fuel injection nozzles. Time mags. Set unmetered fuel pressure, idle mixture, and idle RPM. Ground run, leak check, and RTS. I certify this engine has been inspected IAW annual inspection, applicable FAR's, TCM Service instructions and bulletins and found to be in Airworthy condition & approved for RTS.

David Wood, A&P [REDACTED] A

Business Directives, Special Inspections,

[illegible]

N495AU
Baron G58
Serial Number TH-2287
HMT: 705.7

Continental IO550C
S/N 1002146 (R)
TSNEW 705.7
Date: 08/27/2021

Drain crankcase oil and remove filter in accordance with Continental Motors Critical Service Bulletin CSB07-1A. Service with 12 qts of Phillips XC. Install new Champion CH48109 filter. Inspect old filter for contaminants. None found. Lube throttle and prop cables. Wash, ground run, leak check, and return to service.


Max J. Cohen
A&P 

N495AU
Baron G58
Serial Number TH-2287
HMT: 742.4

Continental IO550C
S/N 1002146 (R)
TSNEW 742.4
Date: 01/28/2022

Drain crankcase oil and remove filter in accordance with Continental Motors Critical Service Bulletin CSB07-1A. Service with 12 qts of Phillips XC. Install new Champion CH48109 filter. Inspect old filter for contaminants. None found. Lube throttle and prop cables. Wash, ground run, leak check, and return to service.


Max J. Cohen
A&P 

N495AU
Baron G58
Serial Number TH-2287
HMT: 756.5

Continental IO550C
S/N 1002146 (R)
TSNEW 756.5
Date: 04/06/2022

Perform Annual inspection IAW FAR 43 App. D and Beechcraft G58 AMM. Lube cables. Remove and replace air filter element with new Tempest AA12-8167. Replace vacuum pump with new Tempest

Maintenance Record

iness Directives, Special Inspections,

S

