

ERA24FA206

EXCERPTS - MAINTENANCE LOGBOOKS

MAINTENANCE/INSPECTION ENTRIES 60

Aircraft Model _____ Serial Number _____
 Reg # _____ Owner's Name _____

 
 
DATE			TIME	ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D	HOURS			
				AIRCRAFT-N629BE BEECHCRAFT A36 S/N-E-3287 HOBBS-2026.8 Remove and replace outside free air temperature gauge with new unit (P/N-35-380019-5). Form 8130-3 placed with aircraft records. [REDACTED] Wade Anthony Robertson	DATE 4/02/2024	
				AIRCRAFT-N629BE 10-550-B S/N-1012367 HOBBS-2026.8 Change engine oil and filter. Filter cut for metal check. None detected. Oil sample taken for analysis. Service engine with 9 Qts. Phillips 20W/50 XC oil. Operation check performed. Found satisfactory with no leaks noted. [REDACTED] Wade Anthony Robertson	DATE 4/02/2024	

Photograph 1 - Excerpt - Aircraft Logbook (NTSB Photo)

59

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____
 Reg # _____ Owner's Name _____

DATE	TIME	ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y M D	HOURS			
 TECHNICAIR Aircraft Maintenance A BBA Aviation company				
11/08/2023 N629BE, MODEL A36 S/N E-3287, ITEM 1943.0 WORKSHEET 23-06610				
1. Re-position right rear heat shield and bladed engine support mount as required and finished up with primer of ACA3, 10-115.				
2. Removed landing service assembly WML installed a overhaul of actuator assembly P/N 05-8100172-34 S/N 96-B-196 with a overhaul of motor P/N 50-80000-1 S/N 8294, ref Boschuttl Boscara Series MM 32-1040, rigged landing gear per Boschuttl Boscara Series MM 32-1040, performed 3 normal maintenance easy gear operational checks, no defects noted.				
I certify that the aircraft, aircraft log and logbook, or appliance identified above was repaired and/or inspected in accordance with current FAA regulations and was found acceptable for return to service.				
APPROVED BY: _____ Signature: TechnicaAir, Winston Salem NC FAA Repair Station PAIR208A				
 Palmetto Aviation FAA CRS# 3PXR8708 Aircraft Make & Model: BEECH A36 Aircraft Reg No: N629BE Aircraft Habs: 2013-4 Date: 03/15/2024				
1. COMPLIED WITH GARMIN SERVICE BULLETIN 23034 REV. A DATED: MAY 4, 2023. REMOVED GSA-20 ROLL SERVO P/N 011-02927-11 S/N 509009851 AND INSTALLED OVERHAULED ROLL SERVO P/N 011-02927-21 S/N 6N2002053. REMOVED GSA-20 PITCH SERVO P/N 011-02927-11 S/N 509009778 AND INSTALLED OVERHAULED PITCH SERVO P/N 011-02927-21 S/N 509015058. REMOVED GSA-20 PITCH-TRIM SERVO P/N 011-02927-11 S/N 509009775 AND INSTALLED OVERHAULED PITCH-TRIM SERVO P/N 011-02927-21 S/N 6N20020131. REMOVED GSA-20 YAW SERVO P/N 011-02927-11 S/N 509009775 AND INSTALLED OVERHAULED YAW SERVO P/N 011-02927-21 S/N 6N20020797. GARMIN GFC-500 AUTOPILOT SYSTEM WAS TESTED AND IS FUNCTIONING PROPERLY.				
The aircraft and/or component identified above was repaired and/or inspected in accordance with the current regulations of the Federal Aviation Administration and is approved for return to service.				
repair station under Work Order number: 2023 _____ Authorized Signature: _____				
 FiveByFive N629BE Date: 03/15/2024 Tach: 2013.4 Serviced oxygen system with an air breathing oxygen. Repaired by _____ Gordon Henshberger Signature: _____				

Photograph 2 - Excerpt - Aircraft Logbook (NTSB Photo)

58

MAINTENANCE/INSPECTION ENTRIES

Aircraft Model _____ Serial Number _____
 Reg # _____ Owner's Name _____

DATE	TIME	ENTRIES MAY BE ON MULTIPLE LINES IF REQUIRED	INSPECTOR'S SIGNATURE	LICENSE NUMBER
Y	M	D	HOURS	
Airframe page 1 of 1 STARR Star's Aero LLC, 10558 Truckee Airport Rd, Hanger #1, Truckee, CA 96161 NOISE: RAYTHEON AIRCRAFT COMPANY, A/S, S/N: 6-0287 Date: 05/08/2023 TACH: 1986.9 1. Adjusted prop governor travel to spec. 2. Performed idle function test. No unusual noise. With respect to the work performed, this aircraft is approved for return to service. Details of work performed are on file with Star's Aero LLC under work order WO_3447. Bryan Whitfield AIT				
Airframe page 1 of 1 STARR Star's Aero LLC, 10558 Truckee Airport Rd, Hanger #1, Truckee, CA 96161 NOISE: RAYTHEON AIRCRAFT COMPANY, A/S, S/N: 6-0287 Date: 05/08/2023 TACH: 1986.9 1. Replaced main battery with new. Installed P/N RC24-10 - Battery S/N: 41267881. 2. Replaced LH & RH intake discs and pads with new. Installed (2) P/N 060-10500 - Cleveland 060-10500 Organic Linings. Installed (2) P/N 184-0203 - Cleveland standard intake disc. 3. Replaced LH & RH intake inverter cylinders. Installed (4) P/N 110-3-16 - Proponent Seal. For Fixed Wing Aircraft. Installed (4) P/N M20775-111 - O-ring. Installed (4) P/N M20775-011 - O-ring. Installed (4) P/N M20775-113 - O-ring. Installed (4) P/N M20775-113 - O-ring. Installed (4) P/N M20775-113 - O-ring. 4. Cleaned and resealed fuel flow transducer connections. 5. Good of throttle body and fuel line. 6. Resecured all turbo hoses with new tie wraps and side clamps. 7. Tightened all intake hose clamps. 8. Replaced fuel cap o-rings with new. Installed (4) P/N M20513-030 - O-ring. 9. Resecured engine intake breather gaskets. With respect to the work performed, this aircraft is approved for return to service. Details of work performed are on file with Star's Aero LLC under work order WO_3450. Taylor Good AIT				
Airframe Annual - page 1 of 1 STARR Star's Aero LLC, 10558 Truckee Airport Rd, Hanger #1, Truckee, CA 96161 NOISE: RAYTHEON AIRCRAFT COMPANY, A/S, S/N: 6-0287 Date: 05/08/2023 TACH: 1986.9 1. Performed annual inspection per Star's Aero LLC Inspection Checklist - C/W with FAR 91.207(j) ELT check, no discrepancies noted. ELT battery replacement due 04/02/2027. Installed P/N 04-7110 - Beamsleeve. 2. C/W AD 76-07-12. Function test normal. 3. Complied with AD 01-08-08. Replaced Exhaust exhaust clamp with new. Next due at Tach 2300.9. Installed P/N 05-20055 - EATON 440K375-M CLAMP. Pressurized ADs, see attached AD Compliance Report. I certify that this AIRCRAFT has been inspected MAY an ANNUAL inspection and found to be airworthy on this date. -END- Details of work performed are on file with Star's Aero LLC under work order WO_3460. Taylor Good AIT				

Photograph 3 - Excerpt - Aircraft Logbook (NTSB Photo)

Date	Total Time		Time Since Last Overhaul		Engine Service and Maintenance Record
	Hours	Min	Hours	Min	
Carried forward →					Record maintenance actions including engine part removal and installation and compliance with inspections, Airworthiness Directives, Special Inspections, Modifications and Service Bulletins
 TECHNICAIR™ Aircraft Maintenance A BBA Aviation company					
11/08/2023 N#:N629BE MODEL:A36 SN:E-3287 TT/HM:1943.0 WO#:S19-23-06610					
1. Replaced left and right magneto with overhaul magnetos P/N:10-349350-5 S/N:L-08212 and P/N:10-349350-4 S/N:L-09538 ref TCM Spark Ignited Standard Practice MM 10-5 ops checked					
2. Reposition right rear heat shield and blended engine support mount as required and touched up with primer ref AC43. 1B 6-115					
3. Drained engine oil and removed filter. inspected filter no metal noted. installed a new AA48109-2 filter and serviced engine with Phillips 20W50 X/C oil. ref Beechcraft Bonanza Series MM 12-10-00 leaked checked satisfactory					
I certify that the aircraft, aircraft engine, propeller, or appliance identified above was repaired and or inspected in accordance with current FAA regulations and was found airworthy with respect to the work performed and is approved for return to service.					
APPROVED BY [REDACTED]					
Signature TechnicAir Winston Salem NC FAA Repair Station PAIR208A					

Photograph 4 - Excerpt - Engine Logbook (NTSB Photo)

Photograph 5 - Excerpt - Engine Logbook (NTSB Photo)

wo: WO_3195

Propeller Annual - page 1 of 1

SIERRA
AERO

Sierra Aero LLC - 10356 Truckee Airport Rd, Hanger #1 - Truckee, CA 96161

N629BE HARTZELL, PHC-C3YF-1RF/F8086, S/N: QG990B March 08, 2022
TACH: 454.4 TSOH: 454.4

Performed annual inspection per Sierra Aero LLC Inspection Checklist. Visually inspected spinner, hub and propeller blades, no discrepancies noted.

I certify that this PROPELLER has been inspected IAW an ANNUAL inspection and found airworthy on this date. -END- Details of work performed are on file with Sierra Aero LLC under work order: WO_3195.

Bryan Whitfield [REDACTED]

wo: WO_3883

Propeller Annual - page 1 of 1

SIERRA
AERO

Sierra Aero LLC - 10356 Truckee Airport Rd, Hanger #1 - Truckee, CA 96161

N629BE HARTZELL, PHC-C3YF-1RF/F8086, S/N: QG990B May 09, 2023
TACH: 1966.9 TSOH: 520.7

Performed annual inspection per Sierra Aero LLC Inspection Checklist. Visually inspected spinner, hub and propeller blades, no discrepancies noted.

I certify that this PROPELLER has been inspected IAW an ANNUAL inspection and found airworthy on this date. -END- Details of work performed are on file with Sierra Aero LLC under work order: WO_3880.

Taylor Good IA [REDACTED]

Photograph 6 - Excerpt - Propeller Logbook (NTSB Photo)