

ENGINE LOG

Serial No. _____

Date	Time		REPAIRS - ADJUSTMENTS - SERVICE - REMARKS	Signature	License Number
	Hrs	Min			

19 Aug. 2005 Lycoming 0-360-A4M S/N L-34988-36A
Tach; 232.3

Perform I.R.A.N. (Inspect repair as necessary). Reassembled
engine with the following new parts;

SL75439-1 Gasket Kit

ST203 Piston Ring Set (4)

18A19441 Bearing (2)

SL11020 Bearing (4)

AEL75060 Con Rod Bolt (8)

 
SL18109A-S Oil Pump Impeller

18M19388 Bearing (8)

 
SL16711A Bearing (4)

Continued

Eng.
Amca

Date	Time		REPAIRS - ADJUSTMENTS - SERVICE - REMARKS	Signature	License Number
	Hrs	Min			
			Magnaflux results and yellow tags attached Replace oil filter p/n CH48110-1 and oil (mineral) Installed engine with existing Mags, Carb, Vac pump, and Propeller. Performed ground run, leak check, and test flight. Aircraft returned to service.  		
Total to Date					

Heart of Virginia Aircraft



9/6/23

N7716G

Tach: 1557.2 ATT:4777.3 ETT: 1557.2 PTT: 1557.2

I certify this engine has been inspected in accordance with an annual inspection and was determined to be in airworthy condition. Drained oil and checked screen, no contamination found. Serviced with 7 quarts of W180 Plus oil. Engine cylinder compressions: 1/78 2/74 3/70 4/78. Cleaned gapped, tested, and installed spark plugs. All operation and leak checks satisfactory and engine is approved for return to service.

Stephen M Leo

SUB-TOTAL THIS PAGE

TOTAL - CARRY FORWARD TO