

ERA24LA205

AIRWORTHINESS

Group Chair's Factual Report - Attachment 2

Hillsborough County Sheriff's Office (HCSO) Work Order No. 1461



Hillsborough County Sheriffs Aviation

User: Parsons, Brian

Work Order #1461

Demographics

Bill From: Hillsborough County Sheriffs Aviation

Date: Thursday, August 17, 2023

Bill To: No Billing Recipient Selected

SO3 N413JM S/N: 8646 Starting Ending

ACTT	1,970.1	1,970.2
Hobbs	706.1	0.0
Hobbs - Billable	2,117.6	2,118.5
Torque Events	3970	3970
Landings	4731	4733
Engine 1 TT	1,970.1	1,970.2
Engine 1 Starts	2,127.25	2,132.43
NP/NF	875.78	877.73
Engine 1 Flights	3757	3759
Engine 1 Creep %	1.8	1.8

Initial Problem: MSM 05-25-00 3000FH//72M----MSM 05-23-00 1500FH//48----MSM 05-22-00 750FH//24M----
MSM 05-21-00 150FH//12M

Work Order / Discrepancy
Status:

Completed

Jobs

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
1	1800 HR Retirement----Hydraulic Belt PolyV Show Hide Details	Completed	Parsons, Brian	No	No	No	Mechanic: Yes QC: Yes	
Corrective Action:								
Installed new Poly "V" Belt P/N PolyV597K4 per AMM 63-11-00, 5-1.								
Parts Removed 0 Parts Installed 1								
Inventory Items 1 Non-Inventory Items 0								
Labor 0.00 Documents 0								
2	MSM 05-25-00----600FH // 24 M----Hydraulic Pump - Belt Drive----Spline Lube----LUB Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
<i>Corrective Action:</i>								
C/W 600 HR/ 24 M Hydraulic Pump Belt Drive Spline Lube, Ref. AMM 63-11-00, 3-2.								
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0								
3	750 HR Airframe Inspection/24month Inspection MSM 05-22-00 Show Hide Details <i>Corrective Action:</i> C/W IAW MSM 05-22-00.	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	
Parts Removed 0 Parts Installed 2 Inventory Items 20 Non-Inventory Items 0 Labor 0.00 Documents 2								
4	1000HR // 12 Month----MAIN BATTERY Show Hide Details <i>Corrective Action:</i> Concorde RG390E S/N 41258002 24VDC Battery installed at 1970.2 A/F TT. Completed battery capacity check per CMM 24-30-71. Document 5-0171, Rev. P. Dated 02/2015. Testing and Fault Isolation Para. 1.A.1.a.b.c.d.	Completed	Parsons, Brian	No	No	No	Mechanic: Yes QC: Yes	
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0								
5	EASB 05.00.86 Periodic check of the T/R Hub elastomeric P/C Rod. Show Hide Details <i>Corrective Action:</i> None	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0								
6	50 HR---StarFlex Inspection ALS 04-20-00 Star Flex Star 350A-1918-00 (GVI) Show Hide Details <i>Corrective Action:</i> None	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0								
7	12 MONTH---CONCORDE BATTERY CAP CHECK Show Hide Details	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	<i>Corrective Action:</i>							
	Concorde RG390E S/N 41258002 24VDC Battery installed at 1970.2 A/F TT. Completed battery capacity check per CMM 24-30-71. Document 5-0171, Rev. P. Dated 02/2015. Testing and Fault Isolation Para. 1.A.1.a.b.c.d.							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
8	12 MONTH---CABIN FIRE EXTINGUISHER Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	<i>Corrective Action:</i>							
	C/W IAW AMM 26-21-00, 6-4. Weighed 1.80kg.							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
9	MSM 05-25-00-----30 DAY CABIN FIRE EXTINGUISHER Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	<i>Corrective Action:</i>							
	Weighed IAW MSM 05-25-00. 1.80 Kg. Passed.							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
10	MSM 05-25-00---ELT 30 DAY Function Check---FT Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	<i>Corrective Action:</i>							
	C/W IAW AMM 25-66-20, 5-1.							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
11	AD2021-05-09---Tail Rotor Control System---Pitch Change Link Elastomeric Bearing Inspection. Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	<i>Corrective Action:</i>							
	None							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
12	BLOWER MOTOR /AFT/FORWARD/CONSENSER ASSY-- ---Service Life Limit Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	SSL Recommended by Manufacturer. System Operational Check Good. Continue to Monitor in Service.							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
13	Bearing, Tail Rotor Drive Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W T/R Bearing replacement Ref AMM 65-11-00,4-7.							
	Parts Removed 0 Parts Installed 3							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 4.00 Documents 1							
14	Bearing, Tail Rotor Drive Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W T/R Bearing replacement Ref AMM 65-11-00,4-7.							
	Parts Removed 0 Parts Installed 3							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 4.00 Documents 1							
15	Bearing, Tail Rotor Drive Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W T/R Bearing replacement Ref AMM 65-11-00,4-7.							
	Parts Removed 0 Parts Installed 3							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 4.00 Documents 1							
16	Bearing, Tail Rotor Drive Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W T/R Bearing replacement Ref AMM 65-11-00,4-7.							
	Parts Removed 0 Parts Installed 3							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 4.00 Documents 1							
17	Bearing, Tail Rotor Drive Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	C/W T/R Bearing replacement Ref AMM 65-11-00,4-7.							
	Parts Removed 0	Parts Installed 3						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 4.00	Documents 1						
18	30 HR Airframe Inspection ALS 04-20-00 Tail Rotor Blade (GVI) Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	None							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
19	20 HR Airframe Inspection ALS 04-20-00 P/N: 704A33633303 Laminated pitch half-bearing (GVI) Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W 20 Hour inspection ALS 04-20-00 per AMM 05-40-00,6-7b. (GVI)							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
20	12 MONTH ELT INSPECTION FAR 91.207 Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	Completed IAW FAR 91.207/ AMM 25-66-20, 6-1.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
21	30 HR----Airframe Inspection MSM 05-25-00 Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W 30 Hour Inspection per MSM 05-25-00 IAW AMM 62-11-00 3-1, 64-10-00, 3-1.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
22	150HR/6Months Airframe Inspection MSM 05-25-00 Yaw Compensator Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	C/W IAW AMM 29-00-00, 3-5. Serviced to 15.5 Bar.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
23	150 HR / 12 MONTH AIRFRAME INSPECTION MSM 05-21-00 Show Hide Details Corrective Action: C/W IAW MSM 05-21-00.	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
24	MSM 05-21-00----150 HR / 12 MONTH INSPECTION Show Hide Details Corrective Action: C/W IAW MSM 05-21-00.	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
25	3000 HR / 48 months Hydraulic Fluid Change MSM 05-25-00 Show Hide Details Corrective Action: C/W 3000 HR / 48 M Hydraulic Fluid change, Ref. AMM 29-00-00, 3-6.	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 3						
	Inventory Items 4	Non-Inventory Items 0						
	Labor 0.00	Documents 1						
26	AD 2022-01-01---Main Rotor Pitch Rod upper link at Pitch Horn hardware torque stripe indication Show Hide Details Corrective Action: None	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
27	AD 2023-01-04 Tail Rotor Pitch Change Spider Bearing Spacer Black Index Mark Alignment Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	None							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
28	MSM 05-25-00----150 HR // 3 Month---Blade Pin--- -LUB Show Hide Details Corrective Action:	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	None							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
29	Compressor Wash Frequency Safran H.E. MM 71- 01-00-610-801-A01 Show Hide Details Corrective Action:	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	C/W Compressor Wash per Safran H.E. MM 71-01-00-610-801-A01							
	Parts Removed 0 Parts Installed 0 Inventory Items 1 Non-Inventory Items 0 Labor 1.00 Documents 0							
30	1200HR//48 Month Replacement 1 Filter Hydraulic, Port Show Hide Details Corrective Action:	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	C/W IAW AMM 29-11-00,4-1.							
	Parts Removed 0 Parts Installed 0 Inventory Items 3 Non-Inventory Items 0 Labor 0.00 Documents 1							
31	12 Month Annual Inspection per 14 CFR 91.409 Show Hide Details Corrective Action:	Completed	Parsons, Brian	No	No	No	Mechanic: Yes QC: Yes	
	Complied with CFR 14 FAR 91.409 Annual Inspection in accordance with the manufacturers aircraft maintenance manual. C/W ELT Checks per FAR 91.407(d). ELT battery replacement due 12/2024. C/W fire extinguisher re-weight per AMM 26-21-00, 6-4, satisfactory.							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
32	Engine, XSMN, TRGB SOAP samples Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	Soap Samples Optional. Not Currently on Program.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
33	Twist Grip Spring, Limited Life Part, Due Replacement Show Hide Details Corrective Action:	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	Removed Twist Grip Spring P/N 350A27324924, Installed NEW P/N 350A27324924 Ref. AMM 76-12-04,4-2. Adjusted Spring tension Ref. AMM 76-12-04,5-2. Set to 5.5 LBF. 8130 attached.							
	Parts Removed 0	Parts Installed 1						
	Inventory Items 0	Non-Inventory Items 1						
	Labor 4.00	Documents 1						
34	M/R Swashplate Cushions Worn. Show Hide Details Corrective Action:	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Removed and Replaced Swashplate Cushions P/N 350A37121220 (2EA) w/ New IAW AMM 62-32-00,4-2.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 3.00	Documents 1						
35	M/R Swashplate Uni-Ball Has Flat Spot. Show Hide Details Corrective Action:	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Removed and Replaced Swashplate Uni-Ball P/N 350A37107421 w/New IAW AMM 62-32-00,4-2. Adjusted Axial Play with P/N 350A93-3714-00a Adjustment tool as Req'd.							
	Parts Removed 1	Parts Installed 1						
	Inventory Items 1	Non-Inventory Items 1						
	Labor 3.00	Documents 1						
36	MSM 05-25-00----1500 HR/ 48 Month Airframe Inspection----Specific Periodic Inspections Show Hide Details Corrective Action:	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	
	C/W IAW MSM 05-25-00.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
37	Mast Seal Requires Replacement. Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	Removed and Replaced Mast Seal w/ New P/N 704A39811029 IAW AMM 62-31-00,4-3.							
	Parts Removed 0	Parts Installed 1						
	Inventory Items 2	Non-Inventory Items 0						
	Labor 2.00	Documents 1						
38	Due to Mast Removal Comply with ASB AS350-62-00.43. Show Hide Details Corrective Action: Mast P/N 350A37-1290-04 S/N FR3197 Overhauled TSO-0- By Able Aerospace Services Inc. W/O 627638. ASB350-62-00.43 Complied with.	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
39	T/R Lever ASSY P/N 355A27-0082-01 Pivot Bearing Ratcheting/Rough. Show Hide Details Corrective Action: Removed and Replaced w/ New IAW AMM 67-34-00,4-2.	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 1						
40	M/R Blade Pin Corrosion Out of Limits. Show Hide Details Corrective Action: Replaced Blade Pin Assemblies (6ea) w/New P/N 350A31177001 S/N's M70501,M70504,M70463,M70436,M70450,M70457.	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 6	Parts Installed 0						
	Inventory Items 6	Non-Inventory Items 0						
	Labor 0.00	Documents 1						
41	M/R Caliper Ring Stop P/N 350A37116920 Bent. Show Hide Details Corrective Action: Installed new retaining cup P/N 350A37116920	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 1						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
42	M/R Frequency Adapter Spherical Bearings Require Replacement. Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	Removed and Replaced M/R Frequency Adapter Spherical Bearings (3ea) P/N 704A33633124 w/New IAW AMM 62-21-00,4-4B.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 1						
43	T/R Pitch Change Spider END BALL, Split Bushes and Scraper Lip Seals require replacement. Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: No	
	Corrective Action:							
	Installed a new END BALL on the T/R P/C Spider (Spherical bearing yoke) Ref. AMM 65-21-00,4-11, Replaced Split Bushes Ref. AMM 65-21-00,8-4 and Replaced Scraper Lips Seals Ref. AMM 65-21-00,4-9B (F-43).							
	Parts Removed 0	Parts Installed 5						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 8.00	Documents 2						
44	All Upper and Lower M/R PC-Link Bearings have excessive axial/radial play. Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	Removed and Replaced Upper M/R PC Link Bearings (3ea) P/N 12-6891P and Nuts (3ea) P/N 22461BC120L w/New. Removed and Replaced Lower M/R PC Link Bearings (3ea) P/N 12-6892P and Nuts (3ea) P/N 22462BC120L w/New. All lengths set to Nominal.IAW AMM 62-33-00,4-1. Final Torque and Correlation to be set when installed on Aircraft.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 12	Non-Inventory Items 0						
	Labor 2.50	Documents 1						
45	ASB No. AS350-52-00.65 Doors- Sliding Doors. Double Locking of the Upper Rail Roller of the LH and RH Sliding Door and Locking Markings. MOD 0720150 Embodied. Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W ASB No. AS350-52-00.65. Installed Kit for Upper Roller of LH and RH Sliding Doors. P/N 350A0867660071 (2ea).							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 2						
	Labor 1.50	Documents 2						
46	Starter / Generator Harness requires replacement Per Airbus SB No. AS350-05.00.98 Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: No	
	Corrective Action:							
	Removed Old Starter Generator harness and installed new harness P/N 350A62402202AA Ref Airbus SB No. As350-05.00.98.							
	Parts Removed 0	Parts Installed 1						
	Inventory Items 0	Non-Inventory Items 1						
	Labor 12.00	Documents 1						
47	Tail boom-to-fuselage junction----AMM 53-31-00, 6-1 Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	<i>Corrective Action:</i>							
	Check - Tightening Torque of the Intermediate Structure / Tail Boom Coupling - Rear fuselage. Satisfactory.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
48	T/R Hub requires removal to facilitate T/R Spider End Ball, Split Bushes and Lip Seals replacement. (Refer to Job 47 on this WO) Show Hide Details <i>Corrective Action:</i>	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: No	
	Reinstalled T/R Hub with new Lock washer, torqued Hub bolt and applied sealant Ref. AMM 65-21-00,4-8 (F.2.)							
	Parts Removed 0	Parts Installed 1						
	Inventory Items 1	Non-Inventory Items 0						
	Labor 4.00	Documents 1						
49	T/R Anti-Rotation Rings Need To Be Replaced. P/N 355A12510821. Show Hide Details <i>Corrective Action:</i>	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Replaced w/New IAW AMM 65-21-00,4-12.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 2	Non-Inventory Items 0						
	Labor 0.00	Documents 1						
50	Service Bulletin No. AS350-62.00.46 Main Rotor Replacement of the Pitch Horn/Pitch Rod Upper Screws Needs to be Complied With. Show Hide Details <i>Corrective Action:</i>	Completed	Parsons, Brian Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	C/W Service Bulletin No. AS350-62.00.46 Main Rotor Replacement of the Pitch Horn/Pitch Rod Upper Screws.							
	Parts Removed 0	Parts Installed 1						
	Inventory Items 12	Non-Inventory Items 3						
	Labor 0.00	Documents 0						
51	Landing Gear FWD & AFT Upper/Lower Chafing Strips Worn. Show Hide Details <i>Corrective Action:</i>	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Removed and Replaced Landing Gear Chafing Strips. 4ea Upper P/N 350A41108820, 2ea Front Lower P/N 350A41109020, and 2ea Aft Lower P/N 350A41109920 IAW AMM 32-11-00,4-1.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 6	Non-Inventory Items 0						
	Labor 0.00	Documents 1						
52	Engine Control System Wiring contactors 53Ka or 53Kb. (Co-Pilot twist grip) Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
<i>Corrective Action:</i>								
C/W AD 2024-24-07, Collective Relay checks of the microswitches 53ka and 53kb. Ref SB 05.00.77. No defects noted.								
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0								
53	Pilots door spring rod requires replacement. inop Show Hide Details	Completed	Parsons, Brian	No	No	No	Mechanic: Yes QC: Yes	
<i>Corrective Action:</i>								
Installed new P/N 350A25136500 Gas Rod onto pilots door.								
Parts Removed 0 Parts Installed 1 Inventory Items 0 Non-Inventory Items 1 Labor 0.17 Documents 1								
54	Annual Onboard Systems Cargo Hook Swing Suspension System Inspection. Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
<i>Corrective Action:</i>								
Completed IAW Onboard Systems ICA 123-011-02 Rev. 22. Sec 5.1. Installed Overhaul Kit P/N 212-040-00 and Frame Strut Spherical Bearings 4 ea P/N 517-055-00. Lubricated with Mobil 28 Grease.								
Parts Removed 0 Parts Installed 0 Inventory Items 5 Non-Inventory Items 0 Labor 0.00 Documents 1								
55	Self-lubricating Adhesive Tape on Cyclic Swashplate Guide Worn. Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
<i>Corrective Action:</i>								
Removed and Replaced Tape w/ New P/N 350A37105720 IAW AMM 62-32-00,8-1.								
Parts Removed 0 Parts Installed 0 Inventory Items 1 Non-Inventory Items 0 Labor 0.00 Documents 1								
56	AD2020-22-20----ASB No. AS350-05.00.92----Check for the Presence of the Main Gear Box Suspension Bar Attachment Bracket Screw Head. (T Check) Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
<i>Corrective Action:</i>								
Inspected IAW ASB No. AS350-05.00.92 Par 3. Complied with at T-Check per Par. 3.D. No Defects Noted.								
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0								
57	ALS 04-20-00----300 FH----Tail Rotor Drive Shaft - Greaseable Bearing----593404----DI Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	36 M Time expired, New 593404 bearings installed per AMM 65-11-00, 4-8							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
58	750 HOUR / 12 MONTH FACET SCAVENGE OIL FILTER Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	Removed and Replaced Filter Kit P/N 1742510-01 IAW Facet Kit No. 1741320 Installation and Service Manual.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
59	MSM 05-22-02----24 Month Inspection Show Hide Details	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W IAW MSM 05-22-02.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
60	MSM 05-23-02----48 Month Skid Landing Gear----DI Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	Completed IAW AMM 32-11-00, 6-3							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
61	MSM 05-20-00----1200 Hour // 24 Month----Tail Rotor Hub Hinge Bearing----GVI Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W IAW AMM 26-21-00, 6-4.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
62	MSM 05-25-00----600 Hour // 24 Month----M/R Pitch Change Link----GVI Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	C/W IAW AMM 62-33-00, 6-1.							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
63	MSM 05-25-00----600 Hour // 24 Month--- Hydraulic Pump Bearing---LUB Show Hide Details	Completed	Not Assigned	No	No	No	Mechanic: Yes	QC: Yes
	Corrective Action:							
	Post MOD 079558. Complied with IAW AMM 63-11-00, 3-1.							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
64	MSM 05-25-00----600 Hour // 24 Month Cabin Vibrator Absorber Blade----RTQ/GVI Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes	QC: Yes
	Corrective Action:							
	C/W IAW AMM 53-32-00, 6-1.							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
65	MSM 05-25-00----600 Hour // 24 Month--- Fuselage----DI Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes	QC: Yes
	Corrective Action:							
	C/W IAW AMM 53-00-00, 6-1.							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
66	MSM 05-25-00----600 Hour // 24 Month---Sliding Door-----DS Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes	QC: Yes
	Corrective Action:							
	C/W IAW AMM 52-12-00, 4-3.							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
67	MSM 05-25-00----600 Hour // 24 Month---Sliding Door---DI Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes	QC: Yes

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action: C/W IAW AMM 52-12-00, 6-1.							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
68	MSM 05-25-00----600 Hour // 24 Month----Lateral Cargo Door---FT Show Hide Details Corrective Action: C/W IAW AMM 52-31-00, 5-1.	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
69	MSM 05-25-00----600 Hour // 24 Month DI----DART Footsteps Show Hide Details Corrective Action: C/W IAW AMM 32-11-00, 6-9.	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
70	MSM 05-25-00----3000 Hour // 24 Month Hydraulic system Salt Laden Atmosphere----DRN Show Hide Details Corrective Action: C/W IAW AMM 29-00-00, 3-6.	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
71	MSM 05-22-00----750 HR Airframe Inspection // 24month Inspection Show Hide Details Corrective Action: C/W IAW MSM 05-22-00.	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
72	15 HR / 7 Day Engine Inspection Safran H.E. MM 05-20-10-201-810 Show Hide Details	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	None							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
73	MSM 05-25-00---TRH pitch change unit - Greaseable bearing---600 Hour // 24 Month---DI/LUB Show Hide Details Corrective Action: C/W 600 HR / 24 M TRH P/C Unit Greaseable Bearing Lube, Ref. AMM 65-21-00, 3-1 and 6-8.	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
74	MSM 05-25-00---Casing TGB Attachment bolt---600 Hour---TCK Show Hide Details Corrective Action: C/W IAW 65-21-00, 6-18.	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
75	MSM 05-25-00---TRH pitch change unit---600 Hour // 24 Month---DI Show Hide Details Corrective Action: C/W 600 HR / 24 MO TRH Pitch Change Unit Inspection, Ref. AMM 65-21-00, 6-27.	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
76	MSM 05-25-00---600 Hour // 24 Month---Tail rotor drive shaft---TCK/DI Show Hide Details Corrective Action: C/W 600 Hr / 24 MO T/R Drive shaft Torque Chk and Detailed Inspection Ref. AMM 65-11-00, 6-5. No Defects Noted.	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
77	MSM 05-25-00---600FH // 24 M---Hydraulic Pump - Belt Drive---Spline Lube---LUB Show Hide Details	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	C/W IAW AMM 63-11-00, 3-2.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
78	MSM 05-25-00---600 Hour//24 Month---Scissor Link---8646 is Pre Mod. 07-60013---TCK Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W IAW AMM 62-33-00, 6-3.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
79	MSM 05-25-00---600 Hour // 24 Month---Upper and Lower Fin---GVI/TCK/RTQ Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W IAW AMM 55-20-00, 6-4.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
80	MSM 05-30-00---10 FH / 7 Day---"P" Check Optional Equipment---GVI Show Hide Details	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	None							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
81	MSM 05-31-02-----12 Month -----Onboard Load Release Unit---CLN/GVI Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	Completed IAW Onboard Systems ICA 123-011-02 Rev. 22. Sec 5.1. Installed Overhaul Kit P/N 212-040-00 and Frame Strut Spherical Bearings 4 ea P/N 517-055-00. Lubricated with Mobil 28 Grease.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
82	MSM 05-32-00---750 HR // 24 MONTH---Freon Air Conditioner---DI/FT/CLN Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	C/W IAW AMM 21-51-10,6-2.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
83	MSM 05-32-00----750 FH // 24 M---Tail Rotor Guard (Protector)----TCK Show Hide Details Corrective Action: C/W IAW AMM 32-70-00,6-1.	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
84	MSM 05-32-00----750 FH // 24 M---Load Compensator System----FT Show Hide Details Corrective Action: C/W IAW AMM 67-34-00, 5-1 AMM 67-34-00, 6-1.	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
85	MSM 05-32-00----750 Hour // 24 Month----Servo Control Load Detector----FT Show Hide Details Corrective Action: C/W IAW AMM 67-34-00, 6-1.	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
86	MSM 05-32-00----750FH // 24 M---Servo-control----Twin Hydraulic System----TCK Show Hide Details Corrective Action: C/W IAW 67-32-00, 6-3.	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
87	EASB AS350-05.00.86 Periodic check of the T/R Hub elastomeric P/C Rod. Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	None							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
88	ALS 04-20-00---50 HR---STARFLEX---GVI Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	None							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
89	24M - ALTIMETER / PITOT STATIC ENCODER RE- CERT - FAR 91.411 Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	Completed By Sarasota Avionics International W/O 22744.							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
90	24M - TRANSPONDER RE-CERT - FAR 91.413 Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	Completed By Sarasota Avionics International W/O 22744.							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
91	MSM 05-25-00---300 Hour Airframe Inspection--- Main Rotor Swashplate---VC/DI Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W IAW AMM 62-32-00, 6-1//AMM 62-32-00, 6-2//AMM 62-32-00, 6-3.							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
92	MSM 05-25-00---300 HR Starter/Generator--- Radial Play---Pre TU 211---DI Show Hide Details	Completed	Parsons, Brian	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
<i>Corrective Action:</i>								
C/W MSM 05-25-00 300 HR Starter/Generator Radial Play inspection Pre TU 211 DI per AMM 80-00-00, 6-4 check satisfactory.								
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0								
93	MSM 05-25-00----100 HR----MGB-TGB-MAST Chips Detectors GVI / FT Show Hide Details	Completed	Not Assigned	No	No	No	Mechanic: Yes	QC: Yes
<i>Corrective Action:</i>								
C/W IAW AMM 60-00-00, 6-2.								
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0								
94	MSM 05-25-00----150 Hr / 6 Month----Yaw Compensator Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes	QC: Yes
<i>Corrective Action:</i>								
C/W IAW AMM 29-00-00, 3-5.								
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0								
95	MSM 05-25-00-----1800 Hour-----Front Seats with shock absorbers----DI Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes	QC: Yes
<i>Corrective Action:</i>								
Not Applicable. Zodiac Seats Installed. P/N 19810-02-00.								
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0								
96	EASB 67.00.77 Main rotor servo actuator link between the lower ball end fitting and the actuator rod. Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes	QC: Yes
<i>Corrective Action:</i>								
C/W IAW Par. 3.B.2.b.								
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0								
97	EASB AS350-05.00.77 Time Limits Maintenance Checks Twist Grip Contacts 53Ka and 53Kb Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes	QC: Yes

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action: C/W per 3.B.1.b, 3.B.3., 3.B.4., 3.B.6. Satisfactory.							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
98	MSM 05-25-00----100 HR----MGB Chip Detector----GVI Show Hide Details Corrective Action: C/W IAW AMM 60-00-00, 6-2.	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
99	ALS 04-20-00----10 HR----FREQUENCY ADAPTER / SPHERICAL THRUST BEARING-----GVI Show Hide Details Corrective Action: C/W 10 Hr Spherical Thrust Bearing Inspection Ref AMM 62-21-00, 6-4.	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
100	ALS 04-20-00----50 HR----TRH PITCH CHANGE LINKS----GVI----AD 2021-05-09 & ASB 05.00.86R3 Show Hide Details Corrective Action: None	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
101	ALS 04-20-00----10 FH----TRH Pitch Change Unit--- -350A33-2167-00---AD 2023-01-04 Show Hide Details Corrective Action: None	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
102	RSG Air Conditioning System Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action: C/W IAW RSG ICA IFSE-0007.							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
103	Airbus----Left and Right Cargo Mirrors Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes	QC: Yes
	Corrective Action: C/W IAW ICA-ECI-131 Rev.1 Par. 4.1.2.							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
104	AIRBUS BATTERY RELOCATION-----150 HR/12 MONTH Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes	QC: Yes
	Corrective Action: C/W IAW ICA-ECI-125 Rev 11.							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
105	MSM 05-22-01-----750 HR Airframe Inspections Show Hide Details	Completed	Not Assigned	No	No	No	Mechanic: Yes	QC: Yes
	Corrective Action: C/W IAW MSM 05-22-01.							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
106	MSM 05-25-00-----750 FH// 48 M---DI---Load compensator assy - Lever Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes	QC: Yes
	Corrective Action: C/W IAW AMM 67-34-00,6-2. New Lever Installed.							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
107	MSM 05-25-00----TGB Chip Detector----100 Hour--- -GVI Show Hide Details	Completed	Not Assigned	No	No	No	Mechanic: Yes	QC: Yes

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	C/W IAW AMM 60-00-00, 6-2.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
108	MSM 05-25-00----30 Hour-Tail Rotor Blade----CLN	Completed	Phillips, Jason	No	No	No	Mechanic: Yes	
	Show Hide Details						QC: Yes	
	Corrective Action:							
	None							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
109	MSM 05-25-00-----750 Hour // 48 Month-----Engine-	Completed	Konig, Max	No	No	No	Mechanic: Yes	
	to-MGB coupling-Hydraulic----DI		Phillips, Jason				QC: Yes	
	Show Hide Details							
	Corrective Action:							
	Inspection Interval Changed. 1200H//48 Month. C/W IAW AMM 63-11-00, 6-12 AMM 63-11-00, 6-16.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
110	MSM 05-25-00----100 FH---Rod End Fitting----MRH	Completed	Phillips, Jason	No	No	No	Mechanic: Yes	
	PC Link---DI						QC: Yes	
	Show Hide Details							
	Corrective Action:							
	C/W IAW AMM 62-33-00, 6-1. New Rod End Bearings Installed.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
111	MSM 05-25-00-----300 Hour // 24Month----Diapason	Completed	Phillips, Jason	No	No	No	Mechanic: Yes	
	Scissor Link----TCK						QC: Yes	
	Show Hide Details							
	Corrective Action:							
	C/W IAW AMM 62-33-00, 6-2.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
112	MSM 05-25-00-----150 Hour // 6 Month----Corrosion	Completed	Phillips, Jason	No	No	No	Mechanic: Yes	
	Preventative Bead						QC: Yes	
	Show Hide Details							

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	C/W IAW AMM 12-30-00, 3-4.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
113	MSM 05-25-00----300 FH----Fuel shut-off valve---- GVI Show Hide Details Corrective Action: C/W IAW AMM 28-21-00, 6-1 AMM 28-21-01, 6-1.	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
114	MSM 05-25-00----3 Month Fuel Tank Tropical and Damp Atmosphere-----DI Show Hide Details Corrective Action: C/W IAW MTC 20.08.06.401.	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
115	MSM 05-31-00----150 HR / 12 MONTH INSPECTION-- --FREON AIR CONDITIONER Show Hide Details Corrective Action: C/W IAW AMM 21-51-10, 6-1.	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
116	ASB AS350-01.00.70 TAIL ROTOR DRIVE SHAFT BEARINGS Show Hide Details Corrective Action: Not Applicable P/N 704A33-651-181 Bearings Installed.	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
117	1200HR//48 Month Replacement 2 Filter, Hydraulic, Starboard Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action: C/W IAW AMM 29-11-00,4-1.							
	Parts Removed 0 Parts Installed 0 Inventory Items 3 Non-Inventory Items 0 Labor 0.00 Documents 1							
118	ALS 04-20-00----150 FH---- Tail Rotor Drive Shaft (GVI) See also AD 2021-07-15 Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action: Inspected T/R D/S Bearings P/N 593404 per ASB 350A-01.00.70 R1. No defects noted at this time.							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
119	300 HR Engine Inspection Safran H.E. MM 05-20-10-201-835-A01 Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action: Not Applicable. The AFS IBF system provides dust separation efficiencies exceeding 99% for Society of Automotive Engineers (SAE) AC Coarse and AC Fine dust as defined in specification SAE J726, Air Cleaner Test Code. Inspection applies to operations in an Erosive atmosphere and airframe fitted with an adapted sand filter that has accumulated by-pass opening time &8805; 300 hrs (a sand filter is adapted if its demonstrated filtration efficiency is &8805; 98% per Standard ISO 5011 with ISO12103 - A4 (ISO Coarse) test dust.							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
120	ASB AS350-05.00.64----Checking the locking of the stop screws of the yaw flight controls Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action: Not Applicable. Post MOD 07.4602.							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
121	12 Month----Aero Dynamics NVG Inspection Show Hide Details	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action: C/W IAW Aero Dynamix ICA AS350B3-01 Table 5-2.							
	Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0							
122	ASB AS350-63.00.38----Main Rotor Drive----Main Gear Box (MGB) engine coupling----Check the correct assembly of the MGB engine coupling flange Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	PCW @ 1917.0 ACTT. One Time Inspection.							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
123	MSM 05-21-02----12 Month Inspection Show Hide Details	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W IAW MSM 05-21-02.							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
124	MSM 05-25-00----2250 Hour // 72 Month----Oil temperature warning system----DRN/DI/FT Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	Completed IAW AMM 63-42-00, 5-1 & 5-2. Switch Closed @ 115C +- 5C and Opened @ approx. 15C.							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
125	MSM 05-25-00----2250 Hour // 72 Month----Heating pipe----DI Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W IAW AMM 21-21-00,6-5. No discrepancies Noted.							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
126	MSM 05-32-00----750 HR // 24 Month----On Board Load Release Unit----RIG Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W IAW AMM 25-91-01,5-3B.							
	Parts Removed 0 Parts Installed 0							
	Inventory Items 0 Non-Inventory Items 0							
	Labor 0.00 Documents 0							
127	MGB Oil Filter change. Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	<i>Corrective Action:</i>							
	Changed MGB Oil Filter, Ref. AMM 12-10-00, 3-1.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
128	MSM 05-22-00----750HR // 24 Month---- Main Gearbox Oil Change Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	<i>Corrective Action:</i>							
	C/W 750 Hr / 24 MO Main Gearbox Oil Change Ref. AMM 12-10-00, 3-1.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
129	MSM 05-22-00---750FH // 24 Month---- Tail Rotor Gearbox Oil Change Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	<i>Corrective Action:</i>							
	Drained and Serviced with Royco-586 IAW AMM 12-10-00,3-1.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
130	Engine Oil Change Mobil 254 Safran H.E. MM 05-20-10-201-855-A01 Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	<i>Corrective Action:</i>							
	Changed Engine Oil with Mobil 254 Ref. Safran H.E. MM 05-20-10-201-855-A01.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
131	MSM 05-25-00----1200 Hour // 48 Month----Engine- to-MGB coupling - MGB Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	<i>Corrective Action:</i>							
	C/W IAW AMM 63-11-00, 6-4, AMM 63-11-00, 6-5, AMM 63-11-00, 6-6, AMM 63-11-00, 6-7 AMM 63-11-00, 6-8 AMM 63-11-00, 6-9 AMM 63-11-00, 6-1.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
132	Tail Rotor Blades P/N 355A12006004 S/N 22733 Removed for Refurbish. TSN 1970.2. Show Hide Details	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	Reinstalled Tail Rotor Blades Repaired by Advanced Composite Structures w/o 5011 IAW AMM 64-10-00,4-2.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
133	DONALDSON INLET BARRIER FILTER 300 FH // 12 MO// 100 FH INSPECTION Show Hide Details Corrective Action: C/W IAW AFS-EC130-IBF-ICA Aerospace Filtration Systems, Inc Table 1.	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
134	AD 2001-04-14---Fuselage Frame Show Hide Details Corrective Action: C/W Inspection IAW par. d. Intervals not to exceed 2500 hours or 6 years.	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
135	AD 2020-20-14 To Address an Uncoupled M/R Servo Actuator Rod. This Condition Could Result in Excessive Vibrations, Increased Loads on the Flight Controls, Failure of the M/R Servo Actuator, and Subsequent Loss of Control of the Helicopter Show Hide Details Corrective Action: C/W IAW ALERT SERVICE BULLETIN 67.00.77.	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
136	AD 2020-24-07 Engine Control System Wiring contactors 53Ka or 53Kb. Show Hide Details Corrective Action: C/W AD 2020-24-07, Per EASB 05.00.77 Rev. 1 dated 06/15/2015 Para. 3.B.1 thru 3.B.6. No defects noted.	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
137	AD 2021-07-15 Tail Rotor Drive Shaft Bearing Inspection Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	Corrective Action:							
	Inspected T/R D/S Bearings P/N 593404 per ASB 350A-01.00.70 R1. No defects noted at this time.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
138	AD 2023-22-03 To Prevent Failure of Life-Limited Parts. The Unsafe Condition, if Not Addressed, Could Result in Uncontained Release of a Critical Part, Damage to the Engine, and Damage to the Helicopter Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	Revise the ALS of the existing EMM or instructions for continued airworthiness and the existing approved maintenance or inspection program, as applicable.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
139	MSM 05-25-00----3000 FH // 72 M----Tail boom to Fuselage Junction Inspection----RTQ/GVI Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W IAW AMM 53-31-00, 6-1.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
140	Vibration Damper, spring type (Anti-Vibrator) Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W Spring Anti-Vibrator inspection Ref: AMM 62-21-00,4-5 / AMM 62-21-00,6-11 and AMM 60-00-00,3-1. Replaced Fairing P/N 350A31201600, S/N NA. No other defects noted.							
	Parts Removed 0	Parts Installed 1						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
141	MSM 05-25-00----3000 Hour // 72 Month----MGB Suspension cross bar---Dog Bone---DI Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
	Corrective Action:							
	C/W IAW AMM 63-31-00, 6-1 AMM 63-31-00, 6-3.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
142	MSM 05-25-00----3000 Hour // 72 Month----Vibration Dampner, Spring Type----DI Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
Corrective Action:								
C/W 3000 HR / 72 MO Vibration Dampner Inspection. No Defects Noted.								
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0								
143	MSM 05-25-00---5400 // 72 Month---Main Rotor Mast Upper Housing---DI Show Hide Details Corrective Action:	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
Mast P/N 350A37-1290-04 S/N FR3197 Overhauled TSO-0- By Able Aerospace Services Inc. W/O 627638.								
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 1								
144	MSM 05-25-00---5400 Hour // 72 Month---Main Rotor Mast Detailed Inspection with Removal---DI Show Hide Details Corrective Action:	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
Mast P/N 350A37-1290-04 S/N FR3197 Overhauled TSO-0- By Able Aerospace Services Inc. W/O 627638.								
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 2								
145	SB 05.00.83 Rev. 2 P2 PIPES Show Hide Details Corrective Action:	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
Helicopter is Post Mod 074765. The embodiment of this modification cancels the instructions of this Service Bulletin for pipes which have been replaced with stainless steel pipes.								
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0								
146	AD 2000-20-19C----To prevent ground resonance due to reduced structural stiffness. Show Hide Details Corrective Action:	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	
Ref. AMOC Dated 12Jun2023, Aerospatiale SB 350.01.17a para CC.3. C/W par (a) and (b) in conjunction with MSM 05-22 Basic Airframe- T and/or A Inspection. Intervals no to exceed 600 FH.								
Parts Removed 0 Parts Installed 0 Inventory Items 0 Non-Inventory Items 0 Labor 0.00 Documents 0								
147	M/R Head Spring Anti-Vibrator Hoist Cover Spacer Corroded P/N 350A31203320. Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC	LC	FCF	Sign	Options
	<i>Corrective Action:</i>							
	Removed and Replaced w/ New IAW AMM 62-21-00,4-6.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 1	Non-Inventory Items 0						
	Labor 0.00	Documents 1						
148	VOR Antenna mounts corroded Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	
	<i>Corrective Action:</i>							
	Removed antenna, cleaned the corrosion on the antenna mounts and repainted. Reinstalled with new mounting hardware P/N 22272BC040012L (X 8 Screws) and applied sealant to the edges of the mounts.							
	Parts Removed 0	Parts Installed 1						
	Inventory Items 8	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
149	Removed EBCAU Auxiliary Actuator P/N 13006-2 S/N 3353 In Serviceable Condition for use on N227ND S/N 9296 ACTT 542.3. Show Hide Details	Completed	Phillips, Jason	No	No	No	Mechanic: No QC: No	
	<i>Corrective Action:</i>							
	Installed New EBCAU Auxiliary Actuator P/N 13006-2 S/N 4256 IAW AMM 71-11-00,4-4C.							
	Parts Removed 0	Parts Installed 1						
	Inventory Items 4	Non-Inventory Items 0						
	Labor 0.00	Documents 1						
150	M/R Head Fairing P/N 350A31201600 Requires Replacement. Show Hide Details	Completed	Not Assigned	No	No	No	Mechanic: Yes QC: Yes	
	<i>Corrective Action:</i>							
	Installed New IAW AMM 62-21-00,4-6.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 1						
151	Removed Main Rotor Servo (Lateral) P/N SC8042 S/N 4313 with 2209.7 TTSN/TSO-TSN in Serviceable Condition for use on N717CC S/N 8505 2268.1 ACTT. Show Hide Details	Completed	Parsons, Brian	No	No	No	Mechanic: Yes QC: Yes	
	<i>Corrective Action:</i>							
	Installed -0- TSO replacement servo P/N SC8042 S/N 61 with 18542.2 FH TTSN. Servo S/N 61 TTSN 18542.2. Total Time Since Transfer from AS355F1 to AS350B3 is 15263.3 FH. Servo S/N 61 has 4736.7 FH remaining with a SLL of 20000 FH. See log Cards for details. Installation per AMM 67-31-00, 4-3A with new rod end bearings.							
	Parts Removed 0	Parts Installed 0						
	Inventory Items 0	Non-Inventory Items 0						
	Labor 0.00	Documents 0						
152	ASU 3 Card P/N 704A43211012 S/N 2577 Removed In Serviceable Condition For Continued Use On SO2 N911DG S/N: 8859 1,650.0 ACTT. Show Hide Details	Completed	Konig, Max	No	No	No	Mechanic: Yes QC: Yes	

#	Job / Corrective Action	Status	Mechanic Assigned	QC LC FCF	Sign	Options
Corrective Action:						
Installed New ASU 3 Card P/N 704A43211012 S/N 3817. Function check Good, No Defects Noted.						
Parts Removed 0 Inventory Items 0 Labor 0.00 Parts Installed 0 Non-Inventory Items 0 Documents 1						

Parts Removed

Parts Installed

Part Number	Serial Number	Job #	Quantity	TSN	TSO	TSI	CSN	CSO	CSI	LSN	LSO	LSI
704A39811029	N/A	37	1									
704A39821037	NA	43	2									
704A43211007	4256	149	1									
EN2023R12L	NA	3	1									
MS28775-016	NA	25	1									
POLYV597K4	NA	1	1									
Total			37									

Inventory Items

Item Name	Part Number	Serial Number	PO Number	Job #	Quantity	Price	Total Price
22462BC120L	22462BC120L			44	3		
23116AG080LE	23116AG080LE	00		50	6		
23310CA015020	23310CA015020	0		50	3		
23350AC080LE	23350AC080LE	0		3	6		
350A31-2033-20	350A31-2033-20	0		147	1		
350A31177001	350A31177001	M70436		40	1		
350A31177001	350A31177001	M70450		40	1		
350A31177001	350A31177001	M70457		40	1		
350A31177001	350A31177001	M70463		40	1		
350A31177001	350A31177001	M70501		40	1		
350A31177001	350A31177001	M70504		40	1		
350A33-2057-21	350A33-2057-21	0		48	1		
350A37-1057-20	350A37-1057-20	0		55	1		
350A37-1074-21	350A37-1074-21	0		35	1		
350A41-1088-20	350A41-1088-20			51	4		
350A41-1099-20	350A41-1099-20	N/A		51	2		
704A34-1140-41	704A34-1140-41			44	3		
806966	806966	0		30	1		
806966	806966	0		117	1		
81810-051-23B7	81810-051-23B7	0		37	1		
9945000060	9945000060	0		29	1		
ASNA0045-100BCL	ASNA0045-100BCL	00		3	6		
MS28775-015	MS28775-015	0		30	1		
MS28775-016	MS28775-016	0		3	2		
MS28775-016	MS28775-016	0		25	4		
MS28775-127	MS28775-127	0		30	1		
MS28775-127	MS28775-127	0		117	2		
Nut, Castellated	ASNA0045-080BCL	0		50	3		
NUT, Upper Pitch Link And M/R Servo Upper & Lower	22461BC120L			44	3		
Overhaul Kit, Onboard Systems Cargo Swing	212-040-00	0		54	1		
POLYV597K4	POLYV597K4	0		1	1		
Ring Anti Rotation	355A12510821	0		49	2		
Rod end M/R	704A34-1140-39	0		44	3		
Rod End, Bearings, Cargo Swing	517-055-00	0		54	4		
Screw	22272bc040012L	0		148	8		
Seal, lip	704A39811029	0		37	1		
Split Pin	23310CA020025	0		3	6		
Washer Lock	23350CA040	0		149	4		
Total					93		

Non Inventory Items

Item Name	Part Number	Serial Number	PO Number	Job #	Quantity	Price	Total Price
Generator Harness				46	1		
Kit For Upper Roller of LH/RH Sliding Door				45	2		
Rod, Gas				53	1		
SCREW				50	3		
Shim, Peel				35	1		
Spring				33	1		
Total					9		

Labor Hours

Job #	Name	Hours	Rate	Total Cost
13	Konig, Max	4.00		
14	Konig, Max	4.00		
15	Konig, Max	4.00		
16	Konig, Max	4.00		
17	Konig, Max	4.00		
29	Konig, Max	1.00		
33	Other	4.00		
34	Other	3.00		
35	Other	3.00		
37	Phillips, Jason	2.00		
43	Other	8.00		
44	Other	2.50		
45	Other	1.50		
46	Konig, Max	12.00		
48	Konig, Max	4.00		
53	Parsons, Brian	0.17		
Total		61.17		

Total Labor Hours By Job Total Labor Hours By User

13	4.00	Konig, Max	37.00
14	4.00	Other	22.00
15	4.00	Parsons, Brian	0.17
16	4.00	Phillips, Jason	2.00
17	4.00		
29	1.00		
33	4.00		
34	3.00		
35	3.00		
37	2.00		
43	8.00		
44	2.50		
45	1.50		
46	12.00		
48	4.00		
53	0.17		

Work Order Documents

Job #	Date	Description	View
25	9/1/2023	Hydraulic Hose (2 meters)	

<u>Job #</u>	<u>Date</u>	<u>Description</u>	<u>View</u>
13	9/2/2023	Ball Bearing, Rubber Bushing and Sleeve	
14	9/2/2023	Ball Bearing, Rubber Bushing and Sleeve	
15	9/2/2023	Ball Bearing, Rubber Bushing and Sleeve	
17	9/2/2023	Ball Bearing and Sleeve	
16	9/2/2023	Ball Bearing, Rubber Bushing and Sleeve	
33	9/12/2023	Spring, Twist Grip	
3	9/19/2023	Seal, Lip (MAST)	
3	9/19/2023	Bearing, Spheric, Swashplate	
34	9/20/2023		
35	9/20/2023		
37	9/20/2023		
42	9/21/2023		
43	9/21/2023	End Ball	
44	9/21/2023		
45	9/25/2023		
45	9/26/2023		
40	9/26/2023		
46	9/27/2023		
43	10/3/2023	T/R Pitch change Spider Scraper Seals and Bushes	
48	10/7/2023		
51	10/31/2023		
49	11/15/2023		
53	11/21/2023		
54	11/27/2023		
55	11/28/2023		
149	1/16/2024		
147	1/17/2024		
39	1/31/2024		
150	2/29/2024		
144	3/5/2024		
117	3/25/2024		
30	3/25/2024		
144	3/25/2024		
143	3/25/2024		
152	3/26/2024		

Active Jobs

<u>Name</u>	<u>Job # Assigned</u>	<u>Status</u>	<u>Labor</u>	<u>Job Description</u>
Konig, Max	2	Completed	0.00	MSM 05-25-00----600FH // 24 M----Hydraulic Pump - Belt Drive----Spline Lube----LUB
	13	Completed	4.00	Bearing, Tail Rotor Drive
	14	Completed	4.00	Bearing, Tail Rotor Drive
	15	Completed	4.00	Bearing, Tail Rotor Drive
	16	Completed	4.00	Bearing, Tail Rotor Drive
	17	Completed	4.00	Bearing, Tail Rotor Drive
	25	Completed	0.00	3000 HR / 48 months Hydraulic Fluid Change MSM 05-25-00
	29	Completed	1.00	Compressor Wash Frequency Safran H.E. MM 71-01-00-610-801-A01
	33	Completed	0.00	Twist Grip Spring, Limited Life Part, Due Replacement
	43	Completed	0.00	T/R Pitch Change Spider END BALL, Split Bushes and Scraper Lip Seals require replacement.
	46	Completed	12.00	Starter / Generator Harness requires replacement Per Airbus SB No. AS350-05.00.98
	48	Completed	4.00	T/R Hub requires removal to facilitate T/R Spider End Ball, Split Bushes and Lip Seals replacement. (Refer to Job 47 on this WO)
	52	Completed	0.00	Engine Control System Wiring contactors 53Ka or 53Kb. (Co-Pilot twist grip)

Name	Job # Assigned	Status	Labor	Job Description
	57	Completed	0.00	ALS 04-20-00----300 FH----Tail Rotor Drive Shaft -Greaseable Bearing----593404----DI
	73	Completed	0.00	MSM 05-25-00---TRH pitch change unit - Greaseable bearing---600 Hour // 24 Month---DI/LUB
	75	Completed	0.00	MSM 05-25-00---TRH pitch change unit---600 Hour // 24 Month---DI
	76	Completed	0.00	MSM 05-25-00---600 Hour // 24 Month---Tail rotor drive shaft---TCK/DI
	97	Completed	0.00	EASB AS350-05.00.77 Time Limits Maintenance Checks Twist Grip Contacts 53Ka and 53Kb
	109	Completed	0.00	MSM 05-25-00----750 Hour // 48 Month----Engine-to-MGB coupling-Hydraulic---DI
	116	Completed	0.00	ASB AS350-01.00.70 TAIL ROTOR DRIVE SHAFT BEARINGS
	118	Completed	0.00	ALS 04-20-00----150 FH---- Tail Rotor Drive Shaft (GVI) See also AD 2021-07-15
	127	Completed	0.00	MGB Oil Filter change.
	128	Completed	0.00	MSM 05-22-00---750HR // 24 Month--- Main Gearbox Oil Change
	129	Completed	0.00	MSM 05-22-00---750FH // 24 Month--- Tail Rotor Gearbox Oil Change
	130	Completed	0.00	Engine Oil Change Mobil 254 Safran H.E. MM 05-20-10-201-855-A01
	136	Completed	0.00	AD 2020-24-07 Engine Control System Wiring contactors 53Ka or 53Kb.
	137	Completed	0.00	AD 2021-07-15 Tail Rotor Drive Shaft Bearing Inspection
	140	Completed	0.00	Vibration Damper, spring type (Anti-Vibrator)
	142	Completed	0.00	MSM 05-25-00---3000 Hour // 72 Month---Vibration Dampner, Spring Type---DI
	148	Completed	0.00	VOR Antenna mounts corroded
	152	Completed	0.00	ASU 3 Card P/N 704A43211012 S/N 2577 Removed in Serviceable Condition For Continued Use On SO2 N911DG S/N: 8859 1,650.0 ACTT.
Parsons, Brian	1	Completed	0.00	1800 HR Retirement---Hydraulic Belt PolyV
	4	Completed	0.00	1000HR // 12 Month---MAIN BATTERY
	31	Completed	0.00	12 Month Annual Inspection per 14 CFR 91.409
	50	Completed	0.00	Service Bulletin No. AS350-62.00.46 Main Rotor Replacement of the Pitch Horn/Pitch Rod Upper Screws Needs to be Complied With.
	53	Completed	0.17	Pilots door spring rod requires replacement. inop
	92	Completed	0.00	MSM 05-25-00---300 HR Starter/Generator---Radial Play---Pre TU 211---DI
	151	Completed	0.00	Removed Main Rotor Servo (Lateral) P/N SC8042 S/N 4313 with 2209.7 TTSN/TSO-TSN in Serviceable Condition for use on N717CC S/N 8505 2268.1 ACTT.
Phillips, Jason	5	Completed	0.00	EASB 05.00.86 Periodic check of the T/R Hub elastomeric P/C Rod.
	6	Completed	0.00	50 HR---StarFlex Inspection ALS 04-20-00 Star Flex Star 350A-1918-00 (GVI)
	8	Completed	0.00	12 MONTH---CABIN FIRE EXTINGUISHER
	9	Completed	0.00	MSM 05-25-00----30 DAY CABIN FIRE EXTINGUISHER
	10	Completed	0.00	MSM 05-25-00---ELT 30 DAY Function Check---FT
	11	Completed	0.00	AD2021-05-09---Tail Rotor Control System---Pitch Change Link Elastomeric Bearing Inspection.
	12	Completed	0.00	BLOWER MOTOR /AFT/FORWARD/CONSENSER ASSY----Service Life Limit
	18	Completed	0.00	30 HR Airframe Inspection ALS 04-20-00 Tail Rotor Blade (GVI)
	19	Completed	0.00	20 HR Airframe Inspection ALS 04-20-00 P/N: 704A33633303 Laminated pitch half-bearing (GVI)
	20	Completed	0.00	12 MONTH ELT INSPECTION FAR 91.207
	21	Completed	0.00	30 HR---Airframe Inspection MSM 05-25-00
	22	Completed	0.00	150HR/6Months Airframe Inspection MSM 05-25-00 Yaw Compensator
	26	Completed	0.00	AD 2022-01-01---Main Rotor Pitch Rod upper link at Pitch Horn hardware torque stripe indication
	27	Completed	0.00	AD 2023-01-04 Tail Rotor Pitch Change Spider Bearing Spacer Black Index Mark Alignment
	28	Completed	0.00	MSM 05-25-00----150 HR // 3 Month---Blade Pin---LUB
	30	Completed	0.00	1200HR//48 Month Replacement 1 Filter Hydraulic, Port
	32	Completed	0.00	Engine, XSMN, TRGB SOAP samples
	34	Completed	0.00	M/R Swashplate Cushions Worn.
	35	Completed	0.00	M/R Swashplate Uni-Ball Has Flat Spot.
	37	Completed	2.00	Mast Seal Requires Replacement.
	38	Completed	0.00	Due to Mast Removal Comply with ASB AS350-62-00.43.

Name	Job # Assigned	Status	Labor	Job Description
	39	Completed	0.00	T/R Lever ASSY P/N 355A27-0082-01 Pivot Bearing Ratcheting/Rough.
	40	Completed	0.00	M/R Blade Pin Corrosion Out of Limits.
	41	Completed	0.00	M/R Caliper Ring Stop P/N 350A37116920 Bent.
	42	Completed	0.00	M/R Frequency Adapter Spherical Bearings Require Replacement.
	44	Completed	0.00	All Upper and Lower M/R PC-Link Bearings have excessive axial/radial play.
	45	Completed	0.00	ASB No. AS350-52-00.65 Doors- Sliding Doors. Double Locking of the Upper Rail Roller of the LH and RH Sliding Door and Locking Markings. MOD 0720150 Embodied.
	47	Completed	0.00	Tail boom-to-fuselage junction---AMM 53-31-00, 6-1
	49	Completed	0.00	T/R Anti-Rotation Rings Need To Be Replaced. P/N 355A12510821.
	50	Completed	0.00	Service Bulletin No. AS350-62.00.46 Main Rotor Replacement of the Pitch Horn/Pitch Rod Upper Screws Needs to be Complied With.
	51	Completed	0.00	Landing Gear FWD & AFT Upper/Lower Chafing Strips Worn.
	54	Completed	0.00	Annual Onboard Systems Cargo Hook Swing Suspension System Inspection.
	55	Completed	0.00	Self-lubricating Adhesive Tape on Cyclic Swashplate Guide Worn.
	56	Completed	0.00	AD2020-22-20---ASB No. AS350-05.00.92---Check for the Presence of the Main Gear Box Suspension Bar Attachment Bracket Screw Head. (T Check)
	58	Completed	0.00	750 HOUR / 12 MONTH FACET SCAVENGE OIL FILTER
	60	Completed	0.00	MSM 05-23-02---48 Month Skid Landing Gear---DI
	61	Completed	0.00	MSM 05-20-00---1200 Hour // 24 Month---Tail Rotor Hub Hinge Bearing---GVI
	62	Completed	0.00	MSM 05-25-00---600 Hour // 24 Month---M/R Pitch Change Link---GVI
	64	Completed	0.00	MSM 05-25-00---600 Hour // 24 Month Cabin Vibrator Absorber Blade---RTQ/GVI
	65	Completed	0.00	MSM 05-25-00---600 Hour // 24 Month---Fuselage---DI
	66	Completed	0.00	MSM 05-25-00---600 Hour // 24 Month---Sliding Door---DS
	67	Completed	0.00	MSM 05-25-00---600 Hour // 24 Month---Sliding Door---DI
	68	Completed	0.00	MSM 05-25-00---600 Hour // 24 Month---Lateral Cargo Door---FT
	69	Completed	0.00	MSM 05-25-00---600 Hour // 24 Month DI---DART Footsteps
	74	Completed	0.00	MSM 05-25-00---Casing TGB Attachment bolt---600 Hour---TCK
	78	Completed	0.00	MSM 05-25-00---600 Hour//24 Month---Scissor Link---8646 is Pre Mod. 07-60013---TCK
	79	Completed	0.00	MSM 05-25-00---600 Hour // 24 Month---Upper and Lower Fin---GVI/TCK/RTQ
	81	Completed	0.00	MSM 05-31-02---12 Month ---Onboard Load Release Unit---CLN/GVI
	82	Completed	0.00	MSM 05-32-00---750 HR // 24 MONTH---Freon Air Conditioner---DI/FT/CLN
	83	Completed	0.00	MSM 05-32-00---750 FH // 24 M---Tail Rotor Guard (Protector)---TCK
	84	Completed	0.00	MSM 05-32-00---750 FH // 24 M---Load Compensator System---FT
	85	Completed	0.00	MSM 05-32-00---750 Hour // 24 Month---Servo Control Load Detector---FT
	86	Completed	0.00	MSM 05-32-00---750FH // 24 M---Servo-control---Twin Hydraulic System---TCK
	87	Completed	0.00	EASB AS350-05.00.86 Periodic check of the T/R Hub elastomeric P/C Rod.
	88	Completed	0.00	ALS 04-20-00---50 HR---STARFLEX---GVI
	89	Completed	0.00	24M - ALTIMETER / PITOT STATIC ENCODER RE-CERT - FAR 91.411
	90	Completed	0.00	24M - TRANSPONDER RE-CERT - FAR 91.413
	91	Completed	0.00	MSM 05-25-00---300 Hour Airframe Inspection---Main Rotor Swashplate---VC/DI
	94	Completed	0.00	MSM 05-25-00---150 Hr / 6 Month---Yaw Compensator
	95	Completed	0.00	MSM 05-25-00---1800 Hour---Front Seats with shock absorbers---DI
	96	Completed	0.00	EASB 67.00.77 Main rotor servo actuator link between the lower ball end fitting and the actuator rod.
	99	Completed	0.00	ALS 04-20-00---10 HR---FREQUENCY ADAPTER / SPHERICAL THRUST BEARING---GVI
	100	Completed	0.00	ALS 04-20-00---50 HR---TRH PITCH CHANGE LINKS---GVI---AD 2021-05-09 & ASB 05.00.86R3
	101	Completed	0.00	ALS 04-20-00---10 FH---TRH Pitch Change Unit---350A33-2167-00---AD 2023-01-04
	102	Completed	0.00	RSG Air Conditioning System
	103	Completed	0.00	Airbus---Left and Right Cargo Mirrors
	104	Completed	0.00	AIRBUS BATTERY RELOCATION---150 HR/12 MONTH
	106	Completed	0.00	MSM 05-25-00---750 FH// 48 M---DI---Load compensator assy - Lever
	108	Completed	0.00	MSM 05-25-00---30 Hour-Tail Rotor Blade---CLN
	109	Completed	0.00	MSM 05-25-00---750 Hour // 48 Month---Engine-to-MGB coupling-Hydraulic---DI
	110	Completed	0.00	MSM 05-25-00---100 FH---Rod End Fitting---MRH PC Link---DI
	111	Completed	0.00	MSM 05-25-00---300 Hour // 24Month---Diapason Scissor Link---TCK

<u>Name</u>	<u>Job # Assigned</u>	<u>Status</u>	<u>Labor</u>	<u>Job Description</u>
	112	Completed	0.00	MSM 05-25-00---150 Hour // 6 Month---Corrosion Preventative Bead
	114	Completed	0.00	MSM 05-25-00---3 Month Fuel Tank Tropical and Damp Atmosphere---DI
	115	Completed	0.00	MSM 05-31-00---150 HR / 12 MONTH INSPECTION---FREON AIR CONDITIONER
	117	Completed	0.00	1200HR//48 Month Replacement 2 Filter, Hydraulic, Starboard
	119	Completed	0.00	300 HR Engine Inspection Safran H.E. MM 05-20-10-201-835-A01
	120	Completed	0.00	ASB AS350-05.00.64---Checking the locking of the stop screws of the yaw flight controls
	122	Completed	0.00	ASB AS350-63.00.38---Main Rotor Drive---Main Gear Box (MGB) engine coupling---Check the correct assembly of the MGB engine coupling flange
	124	Completed	0.00	MSM 05-25-00---2250 Hour // 72 Month---Oil temperature warning system---DRN/DI/FT
	125	Completed	0.00	MSM 05-25-00---2250 Hour // 72 Month---Heating pipe---DI
	126	Completed	0.00	MSM 05-32-00---750 HR // 24 Month---On Board Load Release Unit---RIG
	131	Completed	0.00	MSM 05-25-00---1200 Hour // 48 Month---Engine-to-MGB coupling - MGB
	134	Completed	0.00	AD 2001-04-14---Fuselage Frame
	138	Completed	0.00	AD 2023-22-03 To Prevent Failure of Life-Limited Parts. The Unsafe Condition, if Not Addressed, Could Result in Uncontained Release of a Critical Part, Damage to the Engine, and Damage to the Helicopter
	139	Completed	0.00	MSM 05-25-00---3000 FH // 72 M---Tail boom to Fuselage Junction Inspection---RTQ/GVI
	141	Completed	0.00	MSM 05-25-00---3000 Hour // 72 Month---MGB Suspension cross bar---Dog Bone---DI
	143	Completed	0.00	MSM 05-25-00---5400 // 72 Month---Main Rotor Mast Upper Housing---DI
	144	Completed	0.00	MSM 05-25-00---5400 Hour // 72 Month---Main Rotor Mast Detailed Inspection with Removal---DI
	145	Completed	0.00	SB 05.00.83 Rev. 2 P2 PIPES
	146	Completed	0.00	AD 2000-20-19C---To prevent ground resonance due to reduced structural stiffness.
	147	Completed	0.00	M/R Head Spring Anti-Vibrator Hoist Cover Spacer Corroded P/N 350A31203320.
	149	Completed	0.00	Removed EBCAU Auxiliary Actuator P/N 13006-2 S/N 3353 In Serviceable Condition for use on N227ND S/N 9296 ACTT 542.3.
Other	33	Completed	4.00	Twist Grip Spring, Limited Life Part, Due Replacement
	34	Completed	3.00	M/R Swashplate Cushions Worn.
	35	Completed	3.00	M/R Swashplate Uni-Ball Has Flat Spot.
	43	Completed	8.00	T/R Pitch Change Spider END BALL, Split Bushes and Scraper Lip Seals require replacement.
	44	Completed	2.50	All Upper and Lower M/R PC-Link Bearings have excessive axial/radial play.
	45	Completed	1.50	ASB No. AS350-52-00.65 Doors- Sliding Doors. Double Locking of the Upper Rail Roller of the LH and RH Sliding Door and Locking Markings. MOD 0720150 Embodied.

In-Active Jobs

<u>Job #</u>	<u>Job Description</u>
3	750 HR Airframe Inspection/24month Inspection MSM 05-22-00
7	12 MONTH---CONCORDE BATTERY CAP CHECK
23	150 HR / 12 MONTH AIRFRAME INSPECTION MSM 05-21-00
24	MSM 05-21-00---150 HR / 12 MONTH INSPECTION
36	MSM 05-25-00---1500 HR/ 48 Month Airframe Inspection---Specific Periodic Inspections
59	MSM 05-22-02---24 Month Inspection
63	MSM 05-25-00---600 Hour // 24 Month---Hydraulic Pump Bearing---LUB
70	MSM 05-25-00---3000 Hour // 24 Month Hydraulic system Salt Laden Atmosphere---DRN
71	MSM 05-22-00---750 HR Airframe Inspection // 24month Inspection
72	15 HR / 7 Day Engine Inspection Safran H.E. MM 05-20-10-201-810
77	MSM 05-25-00---600FH // 24 M---Hydraulic Pump - Belt Drive---Spline Lube---LUB
80	MSM 05-30-00---10 FH / 7 Day---"P" Check Optional Equipment---GVI
93	MSM 05-25-00---100 HR---MGB-TGB-MAST Chips Detectors GVI / FT
98	MSM 05-25-00---100 HR---MGB Chip Detector---GVI
105	MSM 05-22-01---750 HR Airframe Inspections

<u>Job #</u>	<u>Job Description</u>
107	MSM 05-25-00----TGB Chip Detector----100 Hour----GVI
113	MSM 05-25-00----300 FH----Fuel shut-off valve----GVI
121	12 Month----Aero Dynamics NVG Inspection
123	MSM 05-21-02----12 Month Inspection
132	Tail Rotor Blades P/N 355A12006004 S/N 22733 Removed for Refurbish. TSN 1970.2.
133	DONALDSON INLET BARRIER FILTER 300 FH // 12 MO// 100 FH INSPECTION
135	AD 2020-20-14 To Address an Uncoupled M/R Servo Actuator Rod. This Condition Could Result in Excessive Vibrations, Increased Loads on the Flight Controls, Failure of the M/R Servo Actuator, and Subsequent Loss of Control of the Helicopter
150	M/R Head Fairing P/N 350A31201600 Requires Replacement.

