

ERA25LA204


INVESTIGATION PHOTOGRAPHS



**Photograph 1 - View of tail rotor separated from helicopter
(Courtesy of FAA)**



**Photograph 2 - View of missing tail rotor assembly and damage airframe
(Courtesy of FAA)**

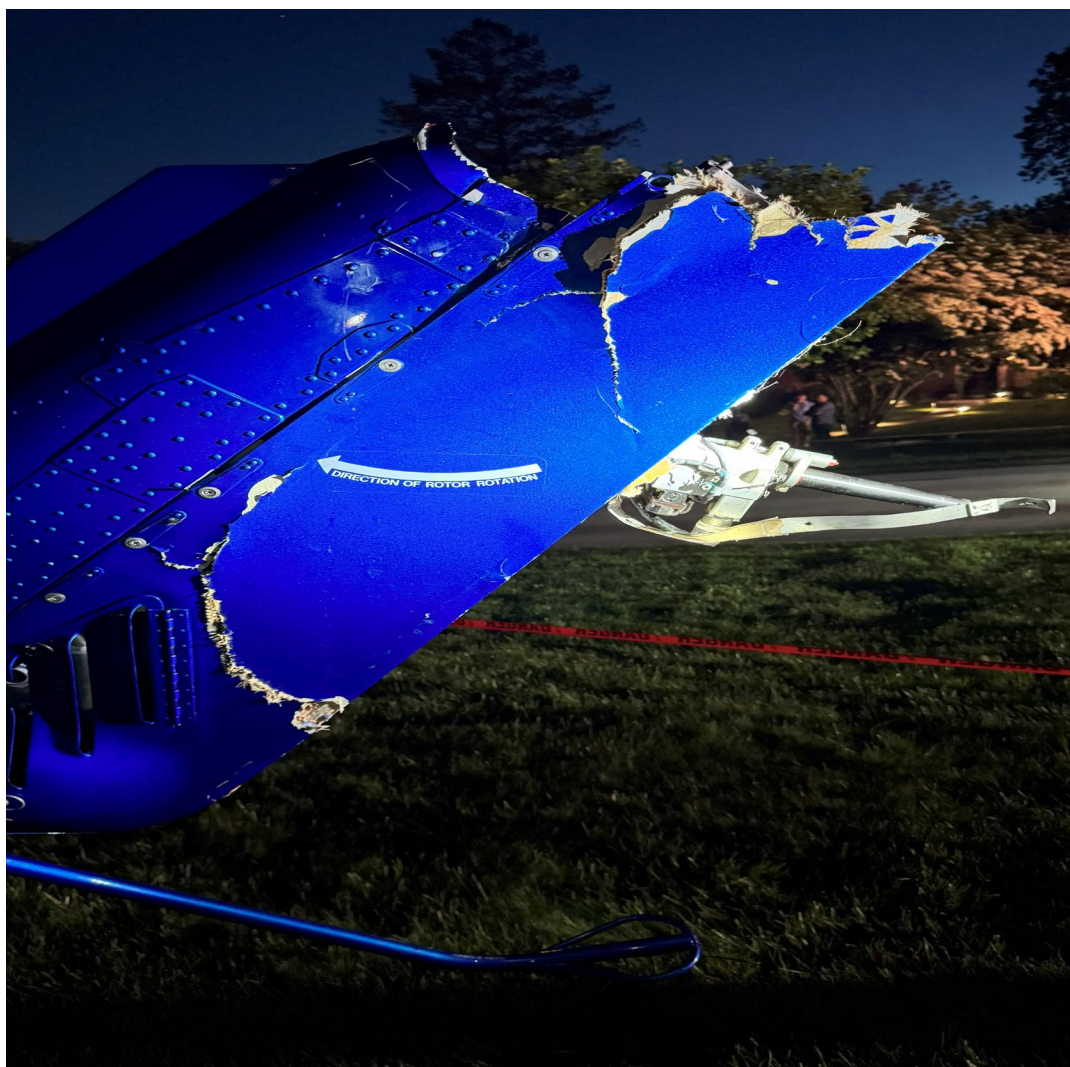

**Photograph 3 - Left side view of damaged vertical stabilizer
(Courtesy of FAA)**



**Photograph 4 - View of missing A/C panel
(Courtesy of FAA)**



**Photograph 5 - View of tail rotor assembly
(Courtesy of FAA)**



**Photograph 6 - View of striped rivnut thread
(Courtesy of FAA)**



**Photograph 7 - View of striped rivnut threads
(Courtesy of FAA)**