



Photo 1 – View of damaged tail rotor (Photo courtesy of the operator)