



Photo 1 – View of damaged main rotor blade (courtesy of the operator)