



Photo 1 – View of left horizontal stabilizer damage from underneath (Photo courtesy of the operator)