

Date: July 16, 2016 at 20:25
To: Marcus B. Paine [REDACTED]

4/20/2016, 1271.0 Hobbs Lubed airframe IAW TO-01-70-AB-2 Stearman service instructions Inspected and tested ELT IAW FAR91.207 Complied with AD 60-08-02 by inspection. Installed Airwolf oil filter Kit AFC-K015B IAW STC SA0128NY & installation instructions Dated 09/01/99 revised 10/01/00. Repaired fabric on right aileron out board tip, repaired hole left wing near rear strut, and left outboard aileron. All repair done IAW Poly fiber installation manual.

I certify this aircraft has been inspected IAW an annual inspection and was determined to be in airworthy condition [REDACTED]

Tom Torchia A&P [REDACTED] IA

4/20/2016 1271.0 hobbs Compression #1 74/80, #2 75/80, #3 71/80, #4 77/80, #5 70/80, #6 73/80, #7 75/80, #8 71/80, #9 73/80. Changed oil serviced with 8 gallons of Phillips X-C 25W60. Complied with AD78-08-07 by inspection. Installed Airwolf filter kit AFC-K015B IAW STC SA0128NY.

I certify this Engine has been inspected IAW an annual inspection and was determined to be in airworthy condition [REDACTED]

Tom Torchia A&P [REDACTED] IA

Maintenance Record Excerpt