

10119

N6181A	Aircraft Time in Service	Airframe Cycles	R.I.N.S.	Engine Hours	Engine Cycles	Inventory Review	D.O.M. Review
Date: 5-17-2011	6634.9			6463.3			

Aircraft Discrepancies

Aircraft Discrepancies			
Aircraft Discrepancies	Signature	Clearing Action	Signature & Number
① ASB 206-11-127		Completed with ASB 206-11-127 Dated 2 May 2011. Not applicable by P/N. Installed engine relight module 15 PAR ANON P/N 206ER-3100-1.	
② Blade wear inspect		Inspected blades and filled voids on inside of leading edge strip with EPoxy IAW 206A/B-series-MM-6 - Volume 6 chapter 62-15 Para 11	
③ Isolation mount out of tolerance		R/R Pylon mounting Assembly 206-030-539-101 Removed S/N LK3266 Installed S/N LK8458 IAW 206A/B MM 6 chapter 63-67 (E3)	

Parts Removed / Installed

[illegible]

Parts Control Form

[illegible]