

Maintenance Logbook Excerpts

BLEED VALVE REMOVED 09.16.16

CUST PO: 10796	P/N: 3100829-03	BLEED VALVE
	S/N: 4P791	

Work Required: OVERHAUL

PT6A-27 TYPE
QUOTE PRIOR TO OVERHAUL
VERIFY S/N

Work Performed: OVERHAULED

REPLACED FCU 10.15.16

10/15/16	66635				Replaced L/H engine Driven Fuel Pump Drive
					Garlock Seal with new Seal per Pratt &
					Whitney mm. 72-60-00 A 1-3. Replaced
					Fuel Control Unit with overhauled FCU
					S/N A85231. Performed Rigging of FCU

BLEED VALVE REMOVED/REPLACED 11.04.16

CUST PO: MAINT-10886	P/N: 3100829-03	BLEED VALVE
	S/N: 21518	

Work Required: OVERHAUL

PT6A-28
QUOTE PRIOR TO OVERHAUL

ENGINE MODEL (#1): PT54-28	RFSV Reno Flying Service, Inc.	DATE: 11/15/2016
ENGINE S/N (#1): PCES2015	435 S. Rock Blvd. Hangar B Reno, NV 89510	Airframe TT: 8890.1
REG. NO: 779MF	Phone: (775) 856-2003	ENG TT (#1): 8814.3
WORK ORDER: 13534-11-2016		ENG TC (#1): 8831
		ENG TSO (#1): 3117.2
		ENG TCSD (#1): 3217
		TACH: 8890.1

Engine #1 Entries

(2) Removed and replaced the bleed valve with a serviceable bleed valve P/N 3100829-03, S/N 4E591.

The aircraft and/or component(s) on 779MF was repaired and inspected in accordance with current FARs rules of the Federal Aviation Regulations and was found Airworthy for return to service.

BLEED VALVE REMOVED/REPLACED 11.15.16

Item: 2 - Airworthy Airframe						
Discrepancy					Hours	Subtotal
L/H engine is low on torque					4.84	[REDACTED]
Corrective Action						
Removed and replaced the bleed valve with a serviceable bleed valve P/N 3100829-03, S/N 4E591.						
Inspection Information:						
Inspector Code: DAVID L DRAGOLI on 11/15/16						

Qty	Unit	Part Number	Description	Serial Number	Unit Price	Subtotal
1	EA	3100829-03	Bleed Valve (P/O: Maint-10796) (Taxed)	4P791	[REDACTED]	[REDACTED]

Labor: [REDACTED]	Parts: [REDACTED]	Shipping: \$0.00	Item Subtotal: [REDACTED]
-------------------	-------------------	------------------	---------------------------

Cust P.O. : N/A	P/N : 2524440-5	S/N :
Our Code : PWOH	Desc : FUEL CONTROL UNIT	CSO/CSN :
Work Code :	S/N : A66449	Tag Info :
Work Req'd : OVERHAULED	MFG :	Manual :
Contract :	Qty : 1	Cond As : OH
Completed P/N : 2524440-7-6	S/N As : A66449	Revision :
Into Bin Loc : PW16		
Company : 1	Division : 01	Department :
Order Date : Nov-04-2016	Received Date : Nov-02-2016	Due Date : Nov-24-2016
Print Date : May-22-2017		
Repair/Service WORK ORDER No. 149180		
Customer Comments OVERHAUL AND UPGRADE Receiving Inspection UPGRADE PER 3029224-73-9 Inspection Findings REPAIR BODY ASSEMBLY PER REPAIR #7, BELLOWS ASSEMBLY PER REPAIR #8 AND BUSHING ASSEMBLY PER DRY FILM REPAIR. SCRAPPED PLUG AND BI-METAL DISC GROUP DUE TO WEAR. Parts Installed BODY ASSEMBLY P/N 2525063 (REPAIRED), BELLOWS ASSEMBLY P/N 2526385 S/N 21836 (REPAIRED), BUSHING ASSEMBLY P/N 2523975 (EXCHANGED), PLUG P/N 2523578, BI-METAL DISC GROUP P/N 343461, LEVER ASSEMBLY P/N 2526113 (ROUNDED HEAD) AND ALL CONSUMABLES. Test Comments UNIT TESTED WITHIN LIMITS Comments COMPLIED WITH SERVICE BULLETINS 3029224-73-9 AND DPF2-73-7		