

SPORT 600
N914NK
Foster Turre



AMATEUR-BUILT AIRCRAFT LOG BOOK



05/04/16 Overhauled Bing Carburetors sn 040029 &
sn 040089 for 914 sn 418601. Rotax carb overhaul kit installed a
per Rotax Heavy maint. Manual. Jet needle moved to leaner setting
per customer request. Carbs returned to customer for install. .
Bryan Toepfer LSRM [REDACTED]

5-4-16

02/2016 Klob Sport 6000 S/N: 792 2004 Tach: 537.1 TT: 537.1
Performed annual condition inspection. Changed oil and filter Aeroshell Sport
oil, NAPA 1056 filter. Compression #1 78/80, #2 78/80, #3 78/80, #4 78/80.
Installed new spark plugs, lubed all control bearings.
I certify this aircraft has been inspected in accordance with the scope and de
of appendix D to part 43 and has been found in condition for safe operation
Donald H Chaption Jr [REDACTED] [REDACTED]

05/12/2016 N914NK Klob Sport 6000 S/N: 792 2004 Tach: 537.1 TT: 537.1

Removed the cowling, removed the left and right carburetors and shipped to California Power Systems for
overhaul. Made up two new throttle cables using the following parts from Lockwood Aviation HWCC-
black Teflon lined 1/16" ID cable housing, HWCB-116 stainless steel 1x19-1/16" cable, HWTF1 .064" ID
.118" OD-.154" long brass throttle ferrule, WHBR08 chrome conduit end. Installed the carburetors after
they were overhauled, balanced and turned them. Installed the cowling. Pertinent details are on file at the
repair facility under Work Order No. 00748, Invoice No. 90984 dated 04/20/2016. A copy of this work
order and invoice was given to the operator to become a permanent part of the aircraft records.

Rick Robinette [REDACTED] [REDACTED]

installed new spark plugs - @ 537.1 private P-10 [REDACTED]

Total to Date

--	--