

Prime Turbines

DATE 10/2/15
PAGE 1 OF 3

FAA Approved Repair Station No. UE5R246N
COMPONENT INSPECTION RECORD

Reference: 02-05-02
Revision: Original

CUSTOMER <u>PRO TURBINES</u>				W.O. <u>52266</u>			MODEL <u>PT6A-65</u>	
QTY	PART NUMBER	S/N	DESCRIPTION	QUANTITY				
				OK	REW	REJ		
1	3104661-01		COVER				GP-OK	
Corrective Action <u>FPI C/W NDN. SCS INSPECTED COVER PIN-NDN- [REDACTED] Replaced cover pin. [REDACTED]</u>								
5	3012675		NUT			5		
Corrective Action <u>replaced (5) nuts. [REDACTED]</u>								
5	MS9320-09		WASHER			5		
Corrective Action <u>replaced (5) washers. [REDACTED]</u>								
2	3002376		DOWEL			2		
Corrective Action <u>replaced (2) dowels. [REDACTED]</u>								
1	MS9902-02		PLUG	1				
Corrective Action								
1	MS9902-01		PLUG	1				
Corrective Action								
1	3112712-01		HOUSING			1	BER-COATING ^{BORE} DAMAGED	
Corrective Action <u>INSTALLED OH HOUSING WHICH C/W SB13284 (STUDS) - BECOMES 3123046-01 ASSOCIATED FY30 HAS WBOING P/N</u>								
1	3106877-01		GASKET			1	100% C/W SB13207, P/N 3115928-01	
Corrective Action <u>C/W SB13207, INSTALLED P/N 3115928-01. UCR</u>								
REMARKS: ASSY. NO. 3112714-01								
SN. <u>3N788</u> <u>UPGRADE TO 3123126-01, SBs 13207 / 13284 ASBESTOS STUDS</u>								
<u>HOUSING [REDACTED], COATING DAMAGED</u>								
<u>VALVE UPGRADED TO 3123126-01. [REDACTED]</u>								

Prime Turbines

DATE 10/7/15
PAGE 2 OF 3

FAA Approved Repair Station No. UE5R246N
COMPONENT INSPECTION RECORD

Reference: 02-05-02
Revision: Original

CUSTOMER <u>Pro Turbines</u>				W.O. <u>52266</u>			MODEL <u>PT6A-65</u>
QTY	PART NUMBER	S/N	DESCRIPTION	QUANTITY			
				OK	REW	REJ	
1	MS171620		PIN, SPRING			1	100%
Corrective Action <u>replaced spring pin. [REDACTED]</u>							
1	3106873-01		PISTON			1	[REDACTED]
Corrective Action <u>installed new piston. [REDACTED]</u>							
1	3021293		SPACER	1			
Corrective Action							
1	3106914-01		SEAL RING, P	1			
Corrective Action							
1	3106869-01		SEAL RING, M	1			
Corrective Action							
5	AN154726		STUD			5	Scrap w Housing, c/w SB 13284 (STUDS)
Corrective Action <u>SB 13284 c/w WITH INSTALLATION OF OH HOUSING. [REDACTED]</u>							
1	*3104658-01		RING, RETAINING	1			
Corrective Action <u>DO NOT REINSTALLED RING. [REDACTED]</u>							
1	*3104659-01		SEAL RING, M			1	[REDACTED]
Corrective Action <u>DO NOT REINSTALLED RING. [REDACTED]</u>							
REMARKS:							

Prime Turbines

DATE 10/7/15
PAGE 3 OF 3

FAA Approved Repair Station No. UE5R246N
COMPONENT INSPECTION RECORD

Reference: 02-05-01
Revision: One

CUSTOMER <u>PRO TURBINES</u>				W.O. <u>52266</u>			MODEL PT6A-65	
QTY	PART NUMBER	S/N	DESCRIPTION	QUANTITY				
				OK	REW	REJ		
1	*3033519		SEAT				NOT INSTALLED	
Corrective Action								
1	*3011740		SCREW				REF DER07- PT004 NOT INSTALLED	
Corrective Action <u>INSTALLED (2) screws using 90275A105. [REDACTED]</u>								
Corrective Action								
Corrective Action								
Corrective Action								
Corrective Action								
Corrective Action								
Corrective Action								
REMARKS: * NOT REQUIRED FOR OVERHAUL				INSPECTION DETAILED		DATE <u>10/8/15</u>	COMPLETED [REDACTED]	
				If this work order includes any life limited parts attach a life limited component worksheet to this inspection record.		<u>N/A</u>	<u>N/A</u>	
				FINAL*		<u>12/9/15</u>	[REDACTED]	

* FINAL INSPECTION INCLUDES VERIFICATION LIFE LIMITS HAVE NOT BEEN EXCEEDED