

PHOTOGRAPHS



Figure 1: Airplane on Side of Runway



Figure 2: Fuel Line

RECORDS

MAKE: Cessna
MODEL: P210n
S/N: P21000407
REG. NO: 7546K
WORK ORDER:
3253-10-2010

Fair Air L.L.C.
Repair Station No. QFBR152Y
3821 S Airport Road, Unit C6
Ogden, UT 84405
Phone: [REDACTED]

DATE: 10/14/2010
A/C TSN:
TACH: 6450

Airframe Entries
(1) Landing gear will not retract. Located hydraulic leak at left gear actuator down line fitting. Removed fitting and replaced o-ring P/N MS28778-4. Reassembled and serviced hydraulic reservoir. Gear swing ops and leak check satisfactory.... (2) Removed Pilots attitude indicator P/N IU367-002-2 S/N 1-1-948B. Installed Overhauled unit P/N IU367-002-2 S/N 1-2178B Operational and leak check good.

Maintenance Release

Figure 3: Logbook 10-14-2010 Entry

GUSTIN AVIATION, INC. No: 24236
PHONE [REDACTED] P. O. BOX 519 LEWISTON, IDAHO 83501

NAME: Steve Zollman DATE: 3-13-18
ADDRESS:

NO.	MAKE	MODEL	SERIAL No.	NATIONALITY	HOURS
	Cessna	P210	N7546K		384

NO.	DESCRIPTION OF WORK	AMOUNT
	Check Landing Gear	
	Labor: 3.5 hrs @ [REDACTED]	

NO.	MATERIALS	AMOUNT
1	637 Valve Cap	[REDACTED]

Figure 4: Invoice 03-13-18

17 May 2018 N7546K P210, Zollman, Steve Tach 392.6 hrs

Landing gear inop for up/dn. Pilot report did pump gear down

Troubleshoot source of hydraulic fluid leak, found to be at hyd. power pack gear system. Tube fitting line cracked at double flare below ferrule. Aux line on pressure side. Duplicate a new line from 1/4" alum tube same size and length. Install in place, tightened fittings and B nuts. Replaced vent system bottle and service with 5606 hyd fluid as required. With aircraft jacked up perform gear swings cycles up and down, emergency extension performed green lite indicate dn-locked. Check gear warning horn throttle closed gear handle up all appeared normal horn sounding. Return gear dn green lite found normal, no leaks noted at this time.

Figure 5: Logbook Entry 05-17-2018

GUSTIN AVIATION, INC. N° 24291 PHONE [REDACTED] P. O. BOX 519 LEWISTON, IDAHO 83501					NO. MATERIALS AMOUNT	
NAME <u>Steve Zollman</u> DATE <u>5-8-18</u> ADDRESS _____					2 Qt 5606 Hyd Fluid 1 327 GE Bulb 8 4x 3/8 PK Screw 1 1820 GE Bulb 1 Ft 3003-0 1/4" Alum. Tube. 6 6 x 3/8 PK Screw 2 6 x 1/2 PK Screw 1 MS21919 D626 Adol	
MAKE MODEL SERIAL No. NATIONALITY HOURS <u>Cessna</u> <u>P210N</u> <u>N7546K</u> <u>392</u>						
NO. DESCRIPTION OF WORK AMOUNT						
Check Landing Gear						
Fill Hyd. Reservoir						
Change Indicator Light Bulb						
Repair Hydraulic Leak - 5-16-18						
Clean Belly						
Labor: 10.0 hrs @ [REDACTED]						

Figure 6: Invoice 5-18-2018