



Photo 1 – Airplane at Accident Site



Photo 2 – Damage to Lower Aft Fuselage



Photo 3 – Throttle Linkage at Fuel Injection Servo