

From: [REDACTED]
To: [REDACTED]
Subject: N632W
Date: Tuesday, September 25, 2018 1:09:26 PM
Attachments: [REDACTED]

Hello Maja

On Monday it was found some oil leaking out of filter. When filter was removed we found that fitting (fig 3, page 5 of 5) was loose and case empty (no oil). This fitting got worked only during overhaul by the manufacture or an approve R/Station. This fitting being not torque properly it will cause the filter not sitting properly into the housing and "O" ring not sealing properly. I attached a picture and some reference for you. As per overhaul manual this fitting requires 245 in.lb of torque and torque seal. See also copy of email from Tech. Rep.

From: [REDACTED]
Sent: Tuesday, September 25, 2018 6:50 AM
To: Sanchez, Juan (FAA [REDACTED])
Subject:

Sent from my mobile.

