

ENCLATURE T/R BLADE ASSEMBLY

PIÈCE/PART NUMBER 222-016-001-139

SÉRIE/SERIAL NUMBER A-2354

E 1 DE/OF 1

Bell Helicopter

Une société de Textron

Mirabel, Québec J7J 1R4

AVERTISSEMENT: QUAND UNE COMPOSANTE AVEC UNE LIMITE DE VIE EST RETOURNÉE À BHTC/BHTI PEU IMPORTER LA RAISON IL EST OBLIGATOIRE QUE LA COMPOSANTE SOIT ACCOMPAGNÉE PAR UN DOCUMENT HISTORIQUE DE SERVICE QUI EST VALIDE

NOTICE: WHEN RETURNING ANY LIMITED LIFE COMPONENT TO BHTC/BHTI FOR ANY REASON IT IS MANDATORY THAT A VALID HISTORICAL SERVICE RECORD ACCOMPANY THE COMPONENT

DOCUMENT HISTORIQUE DE SERVICE - HISTORICAL SERVICE RECORD

DONNÉE DE POSE - INSTALLATION DATA						HORAIRE DE DÉPOSE SCHEDULED REMOVAL		DONNÉE DE DÉPOSE - REMOVAL DATA				
DATE	POSÉ SUR AÉRONEF NO. INSTALLED ON A/C NO.	PAR (ACTIVITÉ) BY (ACTIVITY)	INSTALLÉ À INSTALLED AT	HRS/RIN DE LA COMPOSANTE COMPONENT HOURS/RIN				DATE	DÉPOSÉ À REMOVED AT	COMP HRS	COMP OH	RAISON DE LA DÉPOSE REASON FOR REMOVAL
				DEPUIS NEUF SINCE NEW	DEPUIS RÉV. SINCE O/H					DEPUIS NEUF SINCE NEW	DEPUIS RÉV. SINCE O/H	
			HRS D'AÉRONEF A/C HOURS	HRS COMP. HRS	HRS COMP. HRS	INSP. HRS	RETIR. HRS / YEARS	HRS D'AÉRONEF A/C HOURS	HRS COMP. HRS	HRS COMP. HRS		
				RIN		O/H HRS	RETIR. RIN / DATE		RIN			
R 21/2008	49129	BHTCL	0.0	0.0	NEW		5000 /	Aug 25/2008	27:06	27:06	Dent in Spar	
							/					
01-14	49071	msp	4878.5	27.6	27.6		9850.9 xtt	01/26	6457.5	1606.6	NEW	BEARINGS
							/	2017				WORN
2/02	49071	HPI	6457.5	1606.6	NEW		/		6663.9	1813.0	TSN	Scrap for
017							9850.9 APT	11-14-18	6619			TIR sudden stop
							/					
							/					
							/					
							/					

DIRECTIVES TECHNIQUES ET HISTORIQUE DE RÉVISION - TECHNICAL DIRECTIVES AND HISTORY OF OVERHAUL

TEMPS/RIN TOTAL DE LA COMPOSANTE COMPONENT TOTAL TIME/RIN	DESCRIPTION DU TRAVAIL ACCOMPLI - DESCRIPTION OF WORK ACCOMPLISHED	LA SIGNATURE AFFIRME QUE LE TRAVAIL A ÉTÉ EXÉCUTÉ CONFORMÉMENT AU STANDARD DE NAVIGABILITÉ SIGNATURE AFFIRMS WORK PERFORMED IN ACCORDANCE WITH APPLICABLE AIRWORTHINESS STANDARD		
		SIGNATURE	NO. CERT. NO	DATE
27:06	A-2354 Inspected and repaired per 204-099-223 Vol. XVI Rev L, Polished out nick @ Apex Station 29.5 IAW BHT 204-099-223 Vol. XVI Rev. L Section 1 I.22 b., Refinished and Balanced. All actions performed per BHT and RBI specs. Reference RBI WO # 222T-2354			5/13/09
7:06	A-2354 Inspected and Repaired per 204-099-223 Vol. XVI Rev L, Polished Leading Edge @ Station 29.5 and Verified Balanced. All actions performed per BHT specs. Reference W.O.# 222T-2354-1			11/15/10
606.6	Removed and Replaced 2ea Worn Bearings with 2ea New Condition Bearings P/N: 222-312-761-101 & Repaired a Delamination at the Spar Closure Cap of Tail Rotor Blade IAW BHT-430-CR&O-3, Rev B, Dated 01 Nov 2012, Ch.64, Para 64-16 & Instructions on Bell Helicopter Product Support Engineering Ticket #8000312791.		A&P	02/02 2017