

YEAR 20 DATE	RECORDING TACH TIME	MAINTENANCE RELEASE	1/29/2020	ins er of Techni
		Disassemble engine and inspect for low oil pressure. Check for hidden damage. Alternator failure - Metal caused oil pressure problem. Replace rod nuts & bolts. Replace main & rod bearings. Replace seals and gaskets, as necessary. Replace alternator, oil cooler & starter adapter with overhauled units. See listed parts. Reassemble engine, test run, ready for installation.		
		WO # 31323 on file at: One Stop Aviation, Inc. FAA Repair Station XR3R981L 3245 Production Ave. Ste D Oceanside, CA 92058		
		Model # IO-520-M	Serial # 270903-R	
				
		Authorized Representative		

N101G
Engine Log Left side 2020

Bob Golo

ENGINE LOG 2020
N101G LEFT SIDE

Bob Go/0

wo: 191017

Engine L - page 1 of 1



West Coast Jet Services

West Coast Jet Services, Inc - 25010 Mesa Estates Rd. - Ramona, CA 92065 - 6199809315 - CRS#: W99R498N

N101G

Continental, IO-520-M, S/N: 270903-R

January 31, 2020

Hobbs: 1157.1

Left engine smoh: 962.1

- Installed customers engine after repair by One Stop Aviation, Repair Station XR3R981L under W.O.# 31323 (see previous logbook entry for details).
- Replaced engine mounts part# J9613-58.
- Replaced engine mount bolts part# AN7-33A.
- Installed new lock tabs part# 0851559-1.
- Serviced engine with 12 Qts Aeroshell 100W oil.
- Fabricated a new left engine manifold pressure indication line and installed.
- Fabricated a new left engine fuel flow drain line and installed.
- Installed a new left vacuum pump exhaust elbow part# RA1K8-6-10.

With respect to the work performed, the left engine is approved for return to service. Details of work performed are on file with West Coast Jet Services, Inc under work order: 191017.

Richard J. Egan

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------	---------------------------	-------------------	-----------------------------	--

4-18-20 N101G Left Engine Hobbs 1197.2 SMOH 1002.2

Completed Annual inspection. Checked compressions. 1/62 2/61 3/64 4/65 5/62 6/64. Replaced oil with 10 qts Aeroshell 100 and filter with new CH48108. Checked and adjusted engine magneto to engine timing. Serviced spark plugs.

I certify that this engine has been inspected in accordance with an Annual inspection and was found to be in airworthy condition.

Jim Norman A&P, IA [REDACTED]

8-3-20 N101G Left Engine Hobbs 1250.4

Replaced oil with 10 qts Aeroshell 100 and filter with new CH48109.

Jim Norman A&P [REDACTED]

N101G
Left SIDE ENGINE Log 2020

Bob 6010

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------	---------------------------	-------------------	-----------------------------	--

wo: 202011

Engine L - page 1 of 1



West Coast Jet Services, Inc. - 25010 Mesa Estates Rd. - Ramona, CA 92065 - 6199809315 - CRS#: W99R498N

N101G**Continental, IO-520-M, S/N: 270903-R****March 21, 2020**

Hobbs: 1186.1

Left engine smoh: 962.1

Right engine smoh:

Left prop spoh: 324.0

962.1

Right prop spoh: 324.0

- Removed left engine cowling to gain access to alternator. Removed left alternator part# ALT-9422 serial# 8P00004C and installed a customer furnished alternator part# ALT-9422R serial# H-R040267, overhauled by Aero Accessories, Repair Station XB2R286L under W.O.# 49511. Reinstalled left engine cowling.
- Removed left engine tach generator part# MS20538-2 serial# 68799 and installed customer supplied tach generator part# MS25038-2 serial# AE5088, overhauled by Quality Aircraft Accessories, Inc., Repair Station QYIR334Y under W.O.# 060514.

With respect to the work performed, the left engine is approved for return to service. Details of work performed are on file with West Coast Jet Services, Inc under work order: 202011.

Richard J. Egan

N101G
Engine Log LEFT SIDE 2020

Bob Golo