

pair

Leon D. Borden

RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
			Franklin 6A4-165-B3 ser#: 20437-6-125 Tach: 1374.67 TTIS: 3420.00 TSMOH: 2032.30 03-04-2020 Complied with AD: 98-01-06: Replaced White Carb float with Blue carb float. Approved for return to service. Compression check: #1=76/80 #2=77/80 #3=77/80 #4=76/80 #5=77/80 #6=76/80. I certify that this engine has been inspected in accordance with a 100 hour Inspection Procedure per Title 14 CFR part 43 appendix D and was determined to be in an airworthy condition. Larry Buchanan McCauley 1A170 Tach: 1374.67 TTIS: 3420.00 03-04-2020 I certify that this propeller has been inspected in accordance with a 100 hour Inspection Procedure per Title 14 CFR part 43 appendix D and was determined to be in an airworthy condition. Larry Buchanan

Annual Inspection Logbook Entries