



Photo 1 – View of substantial damage to N116MJ. Source owner.



Photo 2 – View of substantial damage to composite material. Source owner.



Photo 3 – Substantial damage to mount. Source owner.